

# SPECTRA PRECISION®

---

## FOCUS® 6 2" TOTAL STATION



Blank page: Inside cover

# User Guide

## **Spectra Precision® Focus® 6 2" Total Station**

Version 1.00  
Revision A  
October 2009



## Corporate Office

Spectra Precision  
10355 Westmoor Drive  
Suite #100  
Westminster, CO 80021  
USA  
+1-720-587-4700 Phone  
888-477-7516 (Toll free in USA)  
[www.spectraprecision.com](http://www.spectraprecision.com)

## Legal Notices

### Copyright and Trademarks

© 2006-2009, Nikon-Trimble Co. Limited. All rights reserved. All trademarks are the property of their respective owners.

Spectra Precision, the Spectra Precision logo, Focus, and the Focus logo are trademarks or registered trademarks of Spectra Precision, registered in the United States and in other countries.

The Bluetooth word mark and logos are owned by the Bluetooth SIG, Inc. and any use of such marks by Nikon-Trimble Co. Limited is under license.

All other trademarks are the property of their respective owners.

### Release Notice

This is the October 2009 release (Revision A) of the *Spectra Precision Focus 6 2" Total Station User Guide*. It applies to version 1.00 of the Focus 6 2" Total Station.

### Manufacturer

Nikon-Trimble Co., Ltd.  
Technoport Mituiseimei Bldg.  
16-2, Minamikamata 2-chome, Ota-ku  
Tokyo 144-0035 Japan

### Product Limited Warranty Information

For applicable product Limited Warranty information, please refer to the Limited Warranty Card included with this Spectra Precision product, or consult your Spectra Precision Authorized Distribution Partner.

### Notices

Class B Statement – Notice to Users. This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to Part 15 of the FCC rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communication. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and the receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.

Changes and modifications not expressly approved by the manufacturer or registrant of this equipment can void your authority to operate this equipment under Federal Communications Commission rules.



**WARNING** - This equipment has been certified to comply with the limits for a Class B personal computer and peripherals, pursuant to Subpart B of Part 15 of FCC Rules. Only peripherals (computer input/output devices, terminals, printers, etc.) certified to comply with the Class B limits may be attached to this equipment. Operation with non-certified personal computer and/or peripherals is likely to result in interference to radio and TV reception. The connection of a non-shielded equipment interface cable to this equipment will invalidate the FCC Certification of this device and may cause interference levels which exceed the limits established by the FCC for this equipment. You are cautioned that changes or modifications not expressly approved by the party responsible for compliance could void your authority to operate the equipment.

## Canada

This digital apparatus does not exceed the Class B limits for radio noise emissions from digital apparatus as set out in the radio interference regulations of the Canadian Department of Communications.

Le présent appareil numérique n'émet pas de bruits radioélectriques dépassant les limites applicables aux appareils numériques de Classe B prescrites dans le règlement sur le brouillage radioélectrique édicté par le Ministère des Communications du Canada.

## Europe

This product has been tested and found to comply with the requirements for a Class B device pursuant to European Council Directive 89/336/EEC on EMC, thereby satisfying the requirements for CE Marking and sale within the European Economic Area (EEA). These requirements are designed to provide reasonable protection against harmful interference when the equipment is operated in a residential or commercial environment.



### Representative in Europe

Trimble GmbH  
Am Prime Parc 11  
65478 Raunheim, Germany

### Australia and New Zealand

This product conforms with the regulatory requirements of the Australian Communications Authority (ACA) EMC framework, thus satisfying the requirements for C-Tick Marking and sale within Australia and New Zealand.



### Taiwan Battery Recycling Requirements

The product contains a removable Ni-MH battery. Taiwanese regulations require that waste batteries are recycled.



勞揸珍惠能潤

### Notice to Our European Union Customers

For product recycling instructions and more information, please go to [www.spectraprecision.com/ev.shtm](http://www.spectraprecision.com/ev.shtm).

Recycling in Europe: To recycle Spectra Precision WEEE (Waste Electrical and Electronic Equipment, products that run on electrical power.), Call +31 497 53 24 30, and ask for the "WEEE Associate". Or, mail a request for recycling instructions to:

Spectra Precision Europe BV  
c/o Menlo Worldwide Logistics  
Meerheide 45  
5521 DZ Eersel, NL



### Declaration of Conformity

We, Spectra Precision Limited

10355 Westmoor Drive  
Suite #100  
Westminster, CO 80021  
United States of America  
+1-720-587-4700

declare under sole responsibility that the product:  
**Focus 6 2" Total Station**  
complies with Part 15 of FCC Rules.

Operation is subject to the following two conditions:  
(1) this device may not cause harmful interference, and  
(2) this device must accept any interference received,  
including interference that may cause undesired  
operation.

## Notices for optional Bluetooth unit

### USA

FCC Part 15 Subpart C/RSS-210, OET bulletin 65 supplement C satisfied.



**CAUTION** - Any changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.

### Canada

RSS-210 Low Power Device

Operation is subject to the following two conditions: (1) This device may not cause interference, and (2) this device must accept any interference, including interference that may cause undesired operation of the device.

### European Union countries, Iceland, Norway, Liechtenstein, Turkey, and Switzerland

EN300 328v1.7.1, EN50360 satisfied

Hereby, Nikon-Trimble Co., Ltd., declares that this instrument is in compliance with the essential requirements and other relevant provisions of Directive 1999/5/EC.

Declaration of Conformity available at <http://www.nikon-trimble.com/>

### RF exposure compliance

- To comply with FCC/IC RF exposure compliance requirements, a separation distance of at least 20 cm must be maintained between the antenna of this device and all persons.
- This transmitter must not be co-located with or operate in conjunction with any other antenna or transmitter.



# Safety

For your safety read the safety and warnings section and this manual carefully and thoroughly before using the Spectra Precision® Focus® 6 2" total station.

Although Spectra Precision products are designed for maximum safety, using them incorrectly or disregarding the instructions can cause personal injury or property damage.

You should also read the documentation for any other equipment that you use with a Spectra Precision Focus 6 2" Total Station.

***Note** – Always keep this user guide near the instrument for easy reference.*

## Warnings and Cautions

The following conventions are used to indicate safety instructions:



---

**WARNING** – Warnings alert you to situations that could cause death or serious injury.

---



---

**CAUTION** – Cautions alert you to situations that could cause injury or property damage.

---

Always read and follow the instructions carefully.

## Rechargeable Lithium-ion (Li-ion) batteries



---

**WARNING** – Do not damage the rechargeable Lithium-ion battery. A damaged battery can cause an explosion or fire, and can result in personal injury and/or property damage. To prevent injury or damage:

- Do not use or charge the battery if it appears to be damaged. Signs of damage include, but are not limited to, discoloration, warping, and leaking battery fluid.
- Do not expose the battery to fire, high temperature, or direct sunlight.
- Do not immerse the battery in water.
- Do not use or store the battery inside a vehicle during hot weather.
- Do not drop or puncture the battery.
- Do not open the battery or short-circuit its contacts.

---



---

**WARNING** – Avoid contact with the rechargeable Lithium-ion battery if it appears to be leaking. Battery fluid is corrosive, and contact with it can result in personal injury and/or property damage. To prevent injury or damage:

- If the battery leaks, avoid contact with the battery fluid.
- If battery fluid gets into your eyes, immediately rinse your eyes with clean water and seek medical attention. Do not rub your eyes!
- If battery fluid gets onto your skin or clothing, immediately use clean water to wash off the battery fluid.

---



**WARNING** – Charge and use the rechargeable Lithium-ion battery only in strict accordance with the instructions. Charging or using the battery in unauthorized equipment can cause an explosion or fire, and can result in personal injury and/or equipment damage.

To prevent injury or damage:

- Do not charge or use the battery if it appears to be damaged or leaking.
- Charge the Lithium-ion battery only in a product that is specified to charge it. Be sure to follow all instructions that are provided with the battery charger.
- Discontinue charging a battery that gives off extreme heat or a burning odor.
- Use the battery only in equipment that is specified to use it.
- Use the battery only for its intended use and according to the instructions in the product documentation.

## Warnings

Before using the instrument, read the following warnings and follow the instructions that they provide.



**WARNING** – Never look at the sun through the telescope. If you do, you may damage or lose your eyesight.



**WARNING** – The Focus 6 2" Total Station is not designed to be explosion-proof. Do not use the instrument in coal mines, in areas contaminated with coal dust, or near other flammable substances.



**WARNING** – Never disassemble, modify, or repair the instrument yourself. If you do, you may receive electric shocks or burns, or the instrument may catch fire. You may also impair the accuracy of the instrument.



**WARNING** – Use **only** the specified battery charger and AC adapter that are supplied with the instrument. Do **not** use any other charger or adapter as this may cause the battery pack to catch fire or rupture.



**WARNING** – Do not cover the battery charger and AC adapter while the battery pack is being recharged. The charger must be able to dissipate heat adequately. Coverings such as blankets or clothing can cause the charger to overheat.



**WARNING** – Avoid recharging the battery pack in humid or dusty places, in direct sunlight, or near heat sources. Do not recharge the battery pack when it is wet. If you do, you may receive electric shocks or burns, or the battery pack may overheat or catch fire.



**WARNING** – Although the battery pack has an auto-reset circuit breaker, you should take care not to short circuit the contacts. Short circuits can cause the battery pack to catch fire or burn you.





**WARNING** – Never burn or heat the battery. Doing so may cause the battery to leak or rupture. A leaking or ruptured battery can cause serious injury.



**WARNING** – Before storing the battery pack or battery charger, cover the contact points with insulation tape. If you do not cover the contact points, the battery pack or charger may short circuit, causing fire, burns, or damage to the instrument.



**WARNING** – The battery is not waterproof on its own. Do not get the battery wet when it is removed from the instrument. If water seeps into the battery, it may cause a fire or burns.

## Cautions

Before using the instrument, read the following cautions and follow the instructions that they provide:



**CAUTION** – Use of controls, adjustments, or performance of procedures other than those specified herein may result in hazardous radiation exposure.



**CAUTION** – The tips of the tripod ferrules are very sharp. When handling or carrying the tripod, take care to avoid injuring yourself on the ferrules.



**CAUTION** – Before carrying the tripod or the instrument in the carry case, check the shoulder strap and its clasp. If the strap is damaged or the clasp is not securely fastened, the carry case may fall, causing personal injury or instrument damage. The shoulder strap is available as an optional extra.



**CAUTION** – Before setting up the tripod, make sure that no-one's hands or feet are underneath it. When the legs of the tripod are being driven into the ground, they could pierce hands or feet.



**CAUTION** – After mounting the instrument on the tripod, securely fasten the thumb screws on the tripod legs. If the thumb screws are not securely fastened, the tripod may collapse, causing personal injury or instrument damage.



**CAUTION** – After mounting the instrument on the tripod, securely fasten the clamp screw on the tripod. If the clamp screw is not securely fastened, the instrument may fall off the tripod, causing personal injury or instrument damage.



**CAUTION** – Securely fasten the tribrach clamp knob. If the knob is not securely fastened, the tribrach may come loose or fall off when you lift the instrument, causing personal injury or instrument damage.



**CAUTION** – Do not stack objects on the plastic carry case, or use it as a stool. The plastic carry case is unstable and its surface is slippery. Stacking or sitting on the plastic carry case may cause personal injury or instrument damage.



**CAUTION** – The system in the instrument may stop functioning in order to avoid any errors in measurements when the instrument detects strong electromagnetic wave(s). If this happens, turn off the instrument and remove the source of the electromagnetic wave(s). Then turn on the instrument to resume the work.

## Laser safety

The Focus 6 2" total station is a Class 3R laser instrument, in accordance with IEC60825-1, Am2 (2001): *Safety of Laser Products*.

Use of Laser Class 3R equipment can be dangerous.

To counteract hazards, it is essential for all users to pay careful attention to the safety precautions and control measures specified in the standard IEC60825-1, (2001-08), particularly EN60825-1:1994, A11:1996, and A2:2001, as this refers to the hazard distance that is defined in this User Guide.

***Note** – The **hazard distance** is the distance from the laser at which beam irradiance or radiant exposure equals the maximum permissible value to which personnel may be exposed without being exposed to health risks.*



**WARNING** – Only qualified and trained persons should be assigned to install, adjust, and operate the laser equipment.



**WARNING** – Areas in which these lasers are used should be posted with an appropriate laser warning sign.



**WARNING** – Precautions should be taken to ensure that persons do not look directly, with or without an optical instrument, into the beam.



**WARNING** – The laser beam should be terminated at the end of its useful beam path and should in all cases be terminated if the hazardous beam path extends beyond the limit (**hazard distance** - see above) of the area in which the presence and activities of personnel are monitored for reasons of protection from laser radiation.

**WARNING** – Wherever practicable, the laser beam path should be located well above or below eye level.



**WARNING** – When the laser instrument is not in use, store it where unauthorized personnel cannot gain access.



**WARNING – Do not** turn the class 3R laser beam to mirror-like specular surfaces—such as prisms, metal surfaces, or windows—even unintentionally. Take special precautions to avoid such situations.

## Specifications for laser emission

### Laser pointer

|              |                        |
|--------------|------------------------|
| Wave length  | 630-680 nm             |
| Output power | CW: $P_o \leq 4.75$ mW |

### Distance meter

|                    |  |
|--------------------|--|
| Wave length        | 630-680 nm                             |
| Output power       |  |
| Reflectorless mode | $P_p \leq 8.75$ mW $P_o \leq 4.75$ mW  |
| Prism mode         | $P_p \leq 0.037$ mW $P_o \leq 0.02$ mW |
| Pulse              | 1.2 nsec/400 MHz - 1.6 nsec/320 MHz    |


### Laser plummet (option)

|              |                    |
|--------------|--------------------|
| Wave length  | 635 nm             |
| Output power | CW: $P_o < 1.0$ mW |

## Conforming standards

|            |   |
|------------|---|
| <b>EU</b>  | EN60825-1/Am.2: 2001 (IEC60825-1/Am.2: 2001): class 3R  |
| <b>USA</b> | FDA21CFR Part 1040 Sec.1040.10 and 1040.11 (except for deviations pursuant to Laser Notice No.50, dated June24, 2007) |

## Labels

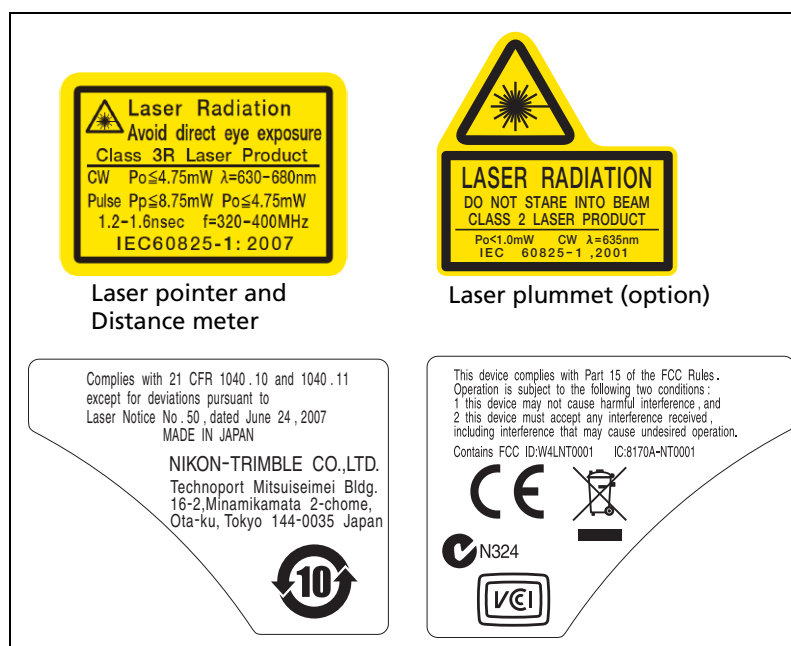

# Contents

|   |           |
|---|-----------|
| <b>Safety</b>   | <b>5</b>  |
| Warnings and Cautions                                 | 5         |
| Rechargeable Lithium-ion (Li-ion) batteries           | 5         |
| Warnings  | 6         |
| Cautions  | 7         |
| Laser safety  | 8         |
| Specifications for laser emission                     | 9         |
| Conforming standards                                  | 9         |
| Labels  | 10        |
| <b>1 Introduction</b>                                 | <b>17</b> |
| System diagram  | 18        |
| Care and maintenance                                  | 19        |
| Environmental conditions                              | 19        |
| Storage   | 19        |
| Cleaning  | 20        |
| Adjusting and tightening                              | 20        |
| Related information                                   | 21        |
| <b>2 Setting up the Instrument</b>                    | <b>23</b> |
| Unpacking and repacking the instrument                | 24        |
| Charging the battery pack                             | 24        |
| Applying power  | 26        |
| Charging the battery                                  | 26        |
| Conditioning / calibrating a battery                  | 27        |
| Detaching the battery pack                            | 28        |
| Attaching the battery pack                            | 28        |
| Setting up the tripod                                 | 29        |
| Centering the instrument                              | 29        |
| Centering with the optical plummet                    | 29        |
| Centering with the laser plummet                      | 30        |
| Centering with a plumb bob                            | 31        |
| Leveling the instrument                               | 31        |
| Focusing the telescope                                | 32        |
| Setting the measurement mode and preparing the target | 33        |
| Measurement with a prism                              | 33        |
| Measurement in reflectorless (N-Prism) mode           | 34        |
| Preparing the reflector sheet                         | 35        |
| Setting up the prism reflector                        | 36        |
| Adjusting the height of the tribrach adapter          | 37        |
| Changing the direction of the prism                   | 37        |

|   |           |
|---|-----------|
| Setting the prism constant . . . . .  | 37        |
| Viewing and changing the measurement settings. . . . .                              | 38        |
| <b>3 Getting Started. . . . .</b>   | <b>39</b> |
| Parts of the instrument . . . . .   | 40        |
| Instrument keyboard and display . . . . .   | 42        |
| Instrument keyboard . . . . .   | 42        |
| Status bar. . . . .   | 44        |
| LCD backlight, laser pointer, beep sound, and contrast adjustment. . . . .          | 46        |
| [DSP] button. . . . .   | 47        |
| [MODE] button. . . . .  | 49        |
| [COD] key . . . . .   | 50        |
| [HOT] key . . . . .   | 51        |
| Bubble indicator . . . . .  | 53        |
| Laser plummet (option). . . . .   | 53        |
| [USR] keys . . . . .  | 54        |
| [DAT] key . . . . .   | 55        |
| Turning on the instrument . . . . .   | 55        |
| Turning off the instrument . . . . .  | 56        |
| Sleep mode. . . . .   | 56        |
| Regional configuration. . . . .   | 56        |
| List available jobs or data. . . . .  | 57        |
| Entering data. . . . .  | 58        |
| Entering a point name or number . . . . .   | 58        |
| Entering a code . . . . .   | 61        |
| <i>Advanced feature: Searching for a code using the first character</i> . . . . .   | 62        |
| Entering values in feet and inches . . . . .  | 63        |
| Creating or opening a job . . . . .   | 63        |
| Creating a new job . . . . .  | 63        |
| Creating a control job . . . . .  | 64        |
| Measuring distances . . . . .   | 64        |
| Sighting a prism reflector. . . . .   | 65        |
| Taking a distance measurement . . . . .   | 65        |
| Viewing and changing the measurement settings . . . . .                             | 66        |
| <b>4 Applications . . . . .</b>   | <b>69</b> |
| HA reset and angle operations. . . . .  | 70        |
| Setting the horizontal angle to 0 . . . . .   | 70        |
| Entering the horizontal angle . . . . .   | 70        |
| Recording a foresight point after repeat angle measurement . . . . .                | 70        |
| Horizontal angle hold . . . . .   | 71        |
| Station setup . . . . .   | 71        |
| Setting up a station with known coordinates or azimuth. . . . .                     | 71        |
| Setting up a station using multiple point resection. . . . .                        | 74        |
| <i>Advanced feature: Viewing and deleting a measurement in resection.</i> . . . . . | 76        |

|  |            |
|--|------------|
| Setting up the station quickly without coordinates . . . . .                 | 77         |
| Determining station elevation. . . . .                                       | 78         |
| Checking and resetting the backsight direction. . . . .                      | 79         |
| Two-point resection along a known line . . . . .                             | 80         |
| Stakeout. . . . .  | 82         |
| Specifying the stakeout point by angle and distance. . . . .                 | 82         |
| Specifying the stakeout point by coordinates . . . . .                       | 84         |
| <i>Advanced feature: Specifying a stakeout list by range input</i> . . . . . | 86         |
| DivLine S-O . . . . .  | 86         |
| RefLine S-O. . . . .   | 87         |
| Program key . . . . .  | 89         |
| Measuring distance and offset values along a specified line . . . . .        | 89         |
| Measuring distance and offset values on the arc-curve . . . . .              | 91         |
| Remote distance measurement . . . . .  | 93         |
| Measuring remote elevation . . . . .   | 95         |
| Measuring distance and offset values on the vertical plane . . . . .         | 96         |
| Measuring distance and offset values on the slope. . . . .                   | 98         |
| Recording measurement data . . . . .   | 99         |
| Recording data from any observation screen . . . . .                         | 99         |
| Outputting data to the COM port . . . . .                                    | 100        |
| Measuring offsets . . . . .  | 101        |
| Measuring taped offsets. . . . .   | 101        |
| Measuring angle offsets. . . . .   | 102        |
| Two-prism pole . . . . .   | 102        |
| Extending a line by horizontal angle offset. . . . .                         | 103        |
| Entering a horizontal distance after an angle-only shot. . . . .             | 105        |
| Calculating a corner point . . . . .   | 105        |
| Measuring circle offsets. . . . .  | 107        |
| Extending the slope distance . . . . .                                       | 108        |
| <b>5 Menu Key . . . . .</b>  | <b>109</b> |
| Introduction . . . . .   | 110        |
| Job Manager . . . . .  | 110        |
| Opening an existing job. . . . .   | 110        |
| Creating a new job . . . . .   | 111        |
| Deleting a job . . . . .   | 112        |
| Setting the control job. . . . .   | 112        |
| Displaying job Information. . . . .  | 113        |
| Cogo . . . . .   | 114        |
| Calculating angle and distance between two coordinates . . . . .             | 114        |
| Calculating and manually inputting coordinates . . . . .                     | 116        |
| Calculating area and perimeter . . . . .                                     | 117        |
| <i>Advanced feature: Entering a range of points</i> . . . . .                | 118        |
| Calculating coordinates from line and offset . . . . .                       | 119        |

---

|  |            |
|--|------------|
| Calculating coordinates using intersection functions . . . . .                 | 120        |
| <i>Advanced feature: Entering angle and distance offsets</i> . . . . .         | 124        |
| Settings . . . . .   | 124        |
| Angle . . . . .  | 125        |
| Distance . . . . .   | 125        |
| Coordinate . . . . .   | 127        |
| Power saving. . . . .  | 128        |
| Communications . . . . .   | 128        |
| Stakeout . . . . .   | 128        |
| Unit . . . . .   | 128        |
| Recording. . . . .   | 129        |
| Others settings . . . . .  | 129        |
| Data . . . . .   | 131        |
| Viewing records. . . . .   | 131        |
| Deleting records . . . . .   | 134        |
| Editing records . . . . .  | 136        |
| Searching records. . . . .   | 138        |
| Entering coordinates . . . . .   | 140        |
| Point name list and code list. . . . .   | 140        |
| Communication . . . . .  | 144        |
| Downloading data . . . . .   | 144        |
| Uploading coordinate data. . . . .   | 145        |
| <i>Advanced feature: Editing the data order for upload</i> . . . . .           | 146        |
| Uploading a point name list or code list . . . . .                             | 146        |
| 1sec-Keys . . . . .  | 147        |
| [MSR] key settings . . . . .   | 147        |
| [DSP] key settings. . . . .  | 148        |
| [USR] key settings . . . . .   | 148        |
| [S-O] key settings. . . . .  | 148        |
| [DAT] key settings. . . . .  | 149        |
| Calibration . . . . .  | 149        |
| Time . . . . .   | 149        |
| <b>6   Checking and Adjustment. . . . .</b>                                    | <b>151</b> |
| Adjusting the electronic level . . . . .                                       | 152        |
| Checking and adjusting the circular level. . . . .                             | 152        |
| Checking and adjusting the optical/laser plummet. . . . .                      | 152        |
| Zero point errors of vertical scale and horizontal angle corrections . . . . . | 153        |
| Checking . . . . .   | 153        |
| Adjusting . . . . .  | 153        |
| Checking the instrument constant . . . . .                                     | 154        |
| Checking the laser pointer . . . . .   | 156        |



|          |                                       |            |
|----------|---------------------------------------|------------|
| <b>7</b> | <b>Specifications.</b>                | <b>157</b> |
|          | Main body.                            | 158        |
|          | Telescope.                            | 158        |
|          | Measurement range                     | 158        |
|          | Distance precision                    | 158        |
|          | Measurement intervals                 | 159        |
|          | Angle measurement                     | 159        |
|          | Tilt sensor                           | 159        |
|          | Tangent screw.                        | 159        |
|          | Tribrach.                             | 159        |
|          | Level.                                | 159        |
|          | Optical plummet                       | 160        |
|          | Optional laser plummet.               | 160        |
|          | Display and keypad                    | 160        |
|          | Connections in the base of instrument | 160        |
|          | Battery pack                          | 160        |
|          | Environmental performance.            | 161        |
|          | Dimensions                            | 161        |
|          | Weight.                               | 161        |
|          | Environmental protection              | 161        |
|          | Standard components                   | 161        |
|          | External device connector             | 162        |
| <b>8</b> | <b>System diagrams.</b>               | <b>165</b> |
|          | System components                     | 166        |
| <b>9</b> | <b>Communications</b>                 | <b>169</b> |
|          | Uploading coordinate data             | 170        |
|          | Settings                              | 170        |
|          | Record format.                        | 170        |
|          | Uploading point lists and code lists. | 172        |
|          | Settings                              | 172        |
|          | File format                           | 172        |
|          | Data example                          | 173        |
|          | Downloading data                      | 174        |
|          | Settings                              | 174        |
|          | Nikon raw record formats              | 174        |
|          | SDR2x and SDR33 record formats        | 177        |
|          | Data examples.                        | 182        |

---

|           |                                 |            |
|-----------|---------------------------------|------------|
| <b>10</b> | <b>Error Messages . . . . .</b> | <b>185</b> |
|           | Cogo . . . . .                  | 186        |
|           | Communications . . . . .        | 186        |
|           | Data . . . . .                  | 187        |
|           | Job Manager . . . . .           | 188        |
|           | Programs . . . . .              | 188        |
|           | Recording Data . . . . .        | 189        |
|           | Searching . . . . .             | 190        |
|           | Settings . . . . .              | 190        |
|           | Stakeout. . . . .               | 190        |
|           | Station Setup. . . . .          | 191        |
|           | System Error . . . . .          | 192        |

# Introduction

**In this chapter:**

- [System diagram](#)
- [Care and maintenance](#)
- [Related information](#)

This user guide describes the unique capabilities and features available in the Spectra Precision® Focus® 6 2" total station.

The software for the Focus 6 2" total station makes it easy for you to learn to operate one model of instrument and, with little additional training, to apply that knowledge to other models.


Before using the instrument, read this user guide carefully. In particular, pay attention to the warnings and cautions that appear in the Safety section, see [Safety, page 5](#).

Your comments and suggestions about the Focus 6 2" total station are welcome. Please contact us at the address given in the front of this manual.

In addition, your feedback about the supporting documentation helps us to improve it with each revision. Email your comments to [sales@spectraprecision.com](mailto:sales@spectraprecision.com).

## System diagram

The system diagram shows the hardware that is used with the Focus 6 2" total station.

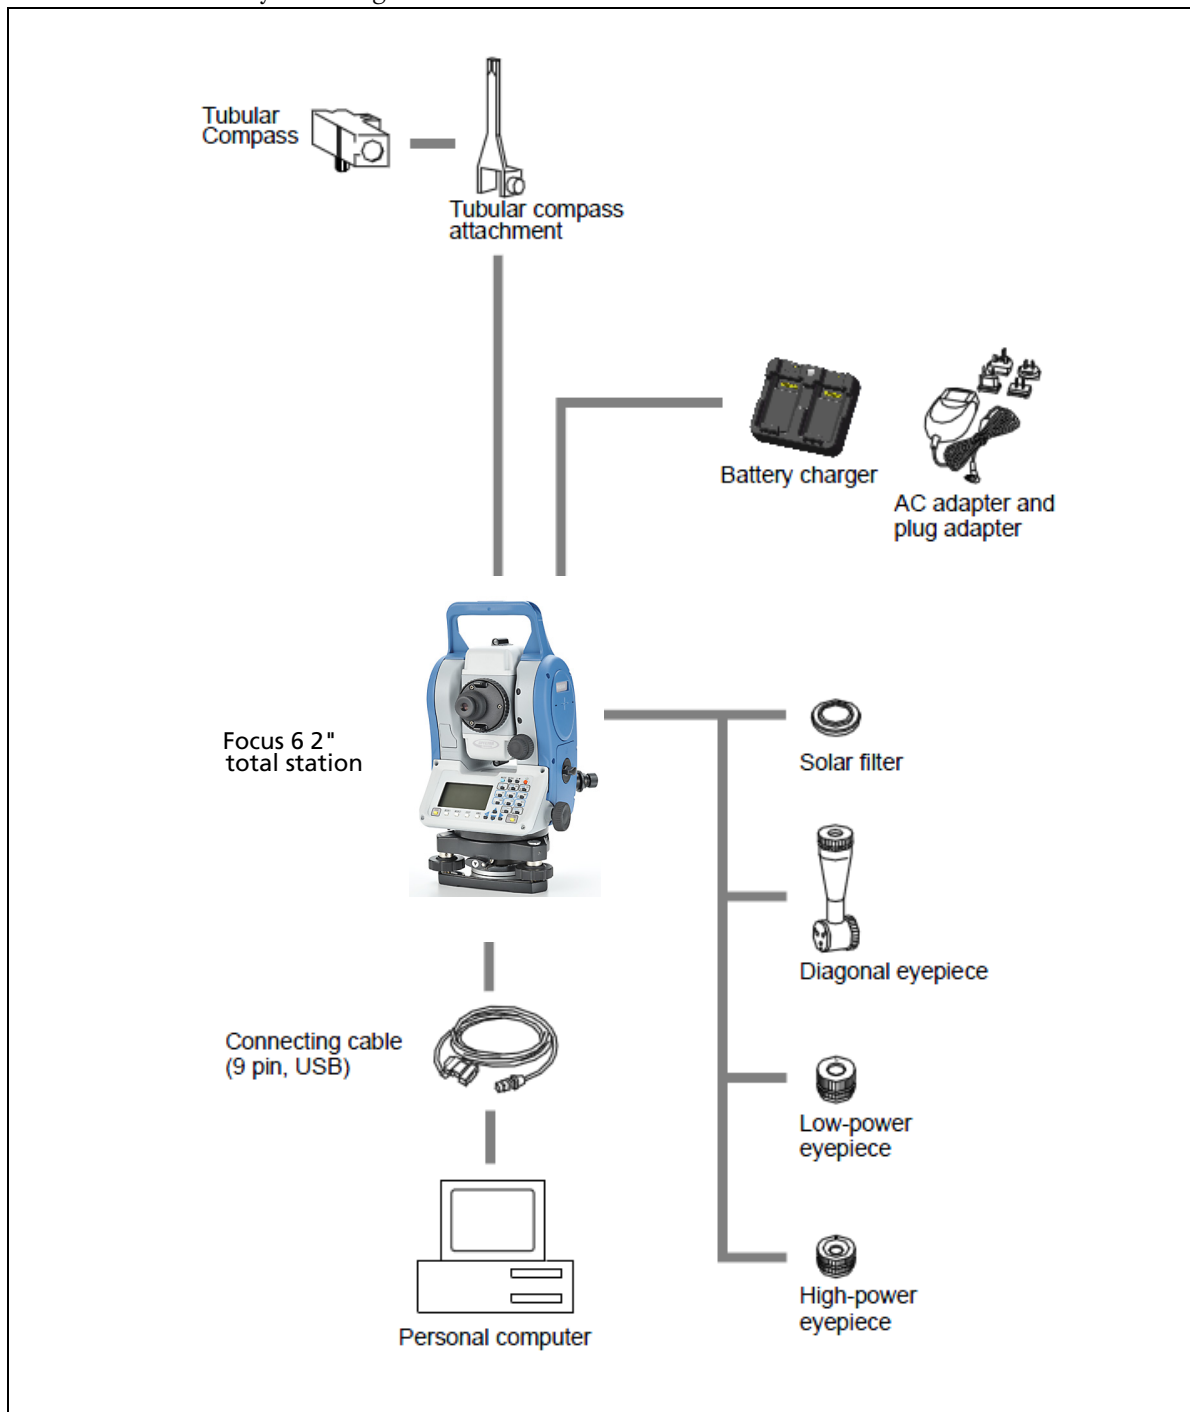

**Note** – You must use the Spectra Precision Focus 6 2" total station with tribrach W30 or W30b.

## Care and maintenance

Before using the instrument, read and follow the following maintenance instructions.

The Focus 6 2" total station is a precision instrument that you should store, use, and clean in an appropriate way.



**CAUTION** – The battery pack contains a Lithium-ion battery. When disposing of the battery pack, follow the laws or rules of your municipal waste system. For more information on the safety warnings associated with the Lithium-ion battery, see [Rechargeable Lithium-ion \(Li-ion\) batteries, page 5](#).



**CAUTION** – Store the battery pack with the battery pack discharged.

## Environmental conditions

- Do not leave the instrument in direct sunlight or in a closed vehicle for prolonged periods. Overheating the instrument may reduce its efficiency.
- If the total station has been used in wet conditions, immediately wipe off any moisture and dry the instrument completely before returning it to the carry case. The Focus 6 2" total station contains sensitive electronic assemblies which have been well protected against dust and moisture. However, if dust or moisture gets into it, severe damage could result.
- Sudden changes in temperature may cloud the lenses and drastically reduce the measurable distance, or cause an electrical system failure. If there has been a sudden change in temperature, leave the instrument in a closed carry case in a warm location until the temperature of the instrument returns to room temperature.

## Storage


- Do not store the total station in hot or humid locations. In particular, you must store the battery pack in a dry location at a temperature of less than 30 °C (86 °F). High temperature or excessive humidity can cause mold to grow on the lenses. It can also cause the electronic assemblies to deteriorate, and so lead to instrument failure.
- Store the battery pack with the battery discharged.
- When storing the instrument in areas subject to extremely low temperatures, leave the carry case open.
- If the tribrach will not be used for an extended period, lock down the tribrach clamp knob and tighten its safety screw.
- The carry case is designed to be watertight, but you should not leave it exposed to rain for an extended period. If exposure to rain is unavoidable, make sure that the carry case is placed with the Spectra Precision nameplate facing upward.

## Cleaning

- Do not use organic solvents such as ether or print thinner to clean the non-metallic parts of the instrument, such as the keyboard, or the painted or printed surfaces. Doing so could result in discoloration of the surface or in peeling of printed characters. Clean these parts only with a soft cloth or tissue that is lightly moistened with water or a mild detergent.
- To clean the optical lenses, lightly wipe them with a soft cloth or a lens tissue that is moistened with alcohol.

## Adjusting and tightening

- When adjusting the leveling screws, stay as close as possible to the center of each screw's range. The center is indicated by a line on the screw.
- The reticle plate cover has been correctly mounted. Do not release it or subject it to excessive force, for example in an attempt to make it watertight.

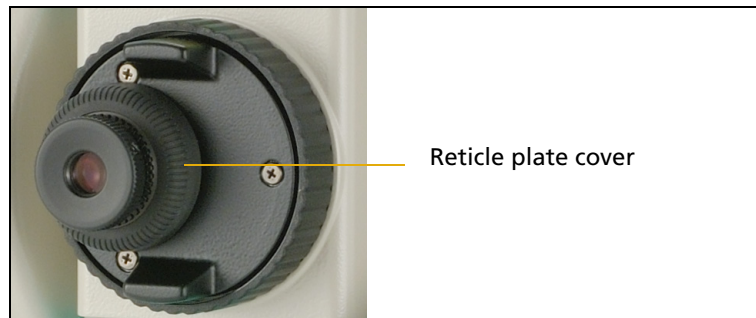

- Before attaching the battery pack, make sure that the contact surfaces on the battery and Focus 6 2" total station are clean.
- Securely press the cap that covers the data output/external power input connector terminal. The instrument is only watertight if the cap is attached securely or when the data output/external power input connector is used.
- The Focus 6 2" total station is not watertight when the data output/external power input connector is used.
- Static electricity from the human body, discharged through the data output/external power input connector, can damage the instrument. Before handling the instrument, touch any other conductive material once in order to remove static electricity.
- Be careful not to pinch your finger between the telescope and trunnion of the instrument.

## Related information

- Contact your local Spectra Precision dealer for more information about the support agreement contracts for software and firmware, and an extended warranty program for hardware.
- Consider a Spectra Precision training course to help you use your total station to its fullest potential. For more information, go to the Spectra Precision website at [www.spectraprecision.com](http://www.spectraprecision.com).

Alternatively, send an email to [support@spectraprecision.com](mailto:support@spectraprecision.com).





# Setting up the Instrument

**In this chapter:**

- Unpacking and repacking the instrument
- Charging the battery pack
- Detaching the battery pack
- Attaching the battery pack
- Setting up the tripod
- Centering the instrument
- Leveling the instrument
- Focusing the telescope
- Setting the measurement mode and preparing the target
- Viewing and changing the measurement settings

This chapter explains how to prepare the Spectra Precision Focus 6 2" total station before you use it in the field.

## Unpacking and repacking the instrument

**Note** – Handle the Focus 6 2" total station carefully to protect it from shocks and excessive vibration.

To unpack the instrument, grip the carry handle and carefully remove the instrument from the carry case.

To replace the instrument in the carry case, place it as shown in the figure.



## Charging the battery pack

Before charging the battery pack, read the following warnings, cautions, and notes.



---

**WARNING** – Do not damage the rechargeable Lithium-ion battery. A damaged battery can cause an explosion or fire, and can result in personal injury and/or property damage. To prevent injury or damage:

- Do not use or charge the battery if it appears to be damaged. Signs of damage include, but are not limited to, discoloration, warping, and leaking battery fluid.
  - Do not expose the battery to fire, high temperature, or direct sunlight.
  - Do not immerse the battery in water.
  - Do not use or store the battery inside a vehicle during hot weather.
  - Do not drop or puncture the battery.
  - Do not open the battery or short-circuit its contacts.
- 



---

**WARNING** – Avoid contact with the rechargeable Lithium-ion battery if it appears to be leaking. Battery fluid is corrosive, and contact with it can result in personal injury and/or property damage.

To prevent injury or damage:

- If the battery leaks, avoid contact with the battery fluid.
  - If battery fluid gets into your eyes, immediately rinse your eyes with clean water and seek medical attention. Do not rub your eyes!
  - If battery fluid gets onto your skin or clothing, immediately use clean water to wash off the battery fluid.
-



**WARNING** – Charge and use the rechargeable Lithium-ion battery only in strict accordance with the instructions. Charging or using the battery in unauthorized equipment can cause an explosion or fire, and can result in personal injury and/or equipment damage.

To prevent injury or damage:

- Do not charge or use the battery if it appears to be damaged or leaking.
- Charge the Lithium-ion battery only in a product that is specified to charge it. Be sure to follow all instructions that are provided with the battery charger.
- Discontinue charging a battery that gives off extreme heat or a burning odor.
- Use the battery only in equipment that is specified to use it.
- Use the battery only for its intended use and according to the instructions in the product documentation.



**WARNING** – To charge the battery pack, use **only** the battery charger and AC adapter that are supplied with the instrument. Do **not** use any other charger or you may cause the battery pack to catch fire or rupture. The enclosed battery pack cannot be used with other chargers.



**WARNING** – Do not cover the battery charger and AC adapter while the battery pack is being recharged. The charger must be able to dissipate heat adequately. Coverings such as blankets or clothing can cause the charger to overheat.



**WARNING** – Avoid recharging the battery pack in humid or dusty places, in direct sunlight, or near heat sources. Do not recharge the battery pack when it is wet. If you do, you may receive electric shocks or burns, or the battery pack may overheat or catch fire.



**WARNING** – Although the battery pack has an auto-reset circuit breaker, you should take care not to short circuit the contacts. Short circuits can cause the battery pack to catch fire or burn you.




**WARNING** – Never burn or heat the battery. Doing so may cause the battery to leak or rupture. A leaking or ruptured battery can cause serious injury.



**WARNING** – Before storing the battery pack or battery charger, cover the contact points with insulation tape. If you do not cover the contact points, the battery pack or charger may short circuit, causing fire, burns, or damage to the instrument.



**WARNING** – The battery is not waterproof on its own. Do not get the battery wet when it is removed from the instrument. If water seeps into the battery, it may cause a fire or burns.

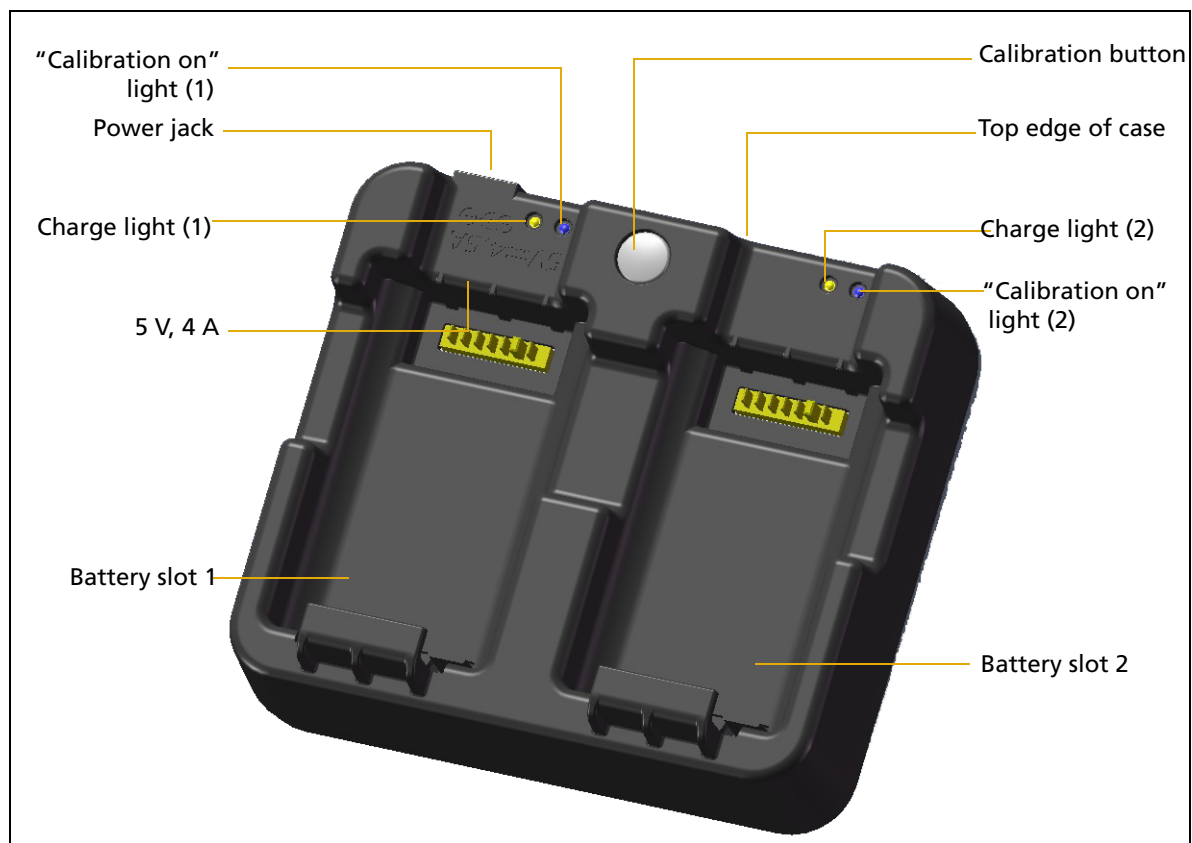

### Applying power

Plug in the charger to the supplied AC adapter to turn the unit on. The power input must be 5 V with at least 4 A of current capability. Each battery may take up to 2 A while charging.

### Charging the battery

- Simply slide a battery into either battery slot to begin charging. The adjacent charge indicator will illuminate yellow when charging is in progress. The charge indicator will change to green when charging is complete.
- Charger slots are completely independent so a battery may be inserted regardless of the state of the other battery slot.
- Charging may take 2-4 hours if the battery was normally discharged.
- Charging may take up to 5 hours with a completely drained battery which has been stored for several months without use.

- By design, Li-Ion batteries should not be charged above 40°C-45°C so a blinking charge light may mean the batteries are too hot for charging. Charging will resume after the batteries cool down. The charging time will be longer due to the batteries cool down when charging batteries above 40°C-45°C.
- If the charge indicator(s) are blinking and the batteries feel cool, it may indicate a problem with the battery or the charger. If the charge light is still blinking after trying several batteries which are not warm, there is a problem with the unit or the batteries themselves.

### **Conditioning / calibrating a battery**

- Battery calibration is necessary about once every 6 months or more often if you want. Calibration insures the reported battery charge remaining is accurate.
- Hold down the calibration button on the unit and then insert a battery while holding the calibration button to begin a battery calibration. Only the battery which was inserted while the button was depressed will begin calibration. During a battery calibration the battery will be charged, discharged completely, and then recharged before finishing. Calibration should complete in roughly 17 hours and the charger vents should not be covered during a calibration cycle.
- The blue calibration indicator light(s) will blink slowly (on 1.5 sec, off 2 sec) while a calibration is in progress and the charge light(s) may be on or off during the calibration cycle.
- When a calibration cycle is completed, the calibration light will stop blinking remain on until the corresponding battery is removed.
- The bottom case temperature may continue to climb up to approximately 43°C before temperature regulation is enabled to keep the case from getting warmer. As the battery voltage drops, the case will cool down and the automatic temperature limiting will no longer be necessary which minimizes the time it takes to discharge a battery.
- If the case temperature continues to get too hot internally even after temperature regulation is enabled, there is a secondary failsafe which will abort the calibration completely. If an abort occurs, the calibration light(s) will blink rapidly and battery charging will be re-enabled.

## Detaching the battery pack



**CAUTION** – Avoid touching the contacts on the battery pack.

1. If the instrument is turned on, press **[PWR]** to turn it off.
2. Turn the battery box release knob counterclockwise, open the battery box cover and then pull the battery pack out of the battery box.

## Attaching the battery pack

1. Clear any dust or other foreign particles from the battery contacts.
2. Turn the battery box release knob counterclockwise and then open the battery box cover.



3. Put the battery pack into the battery box. Connect the battery pack at the bottom with the connecting direction faced inside.
4. Close the battery box cover and then turn the knob clockwise until you hear a click sound.



**CAUTION** – If the battery pack is not attached securely, this could adversely affect the watertightness of the instrument.

## Setting up the tripod



**CAUTION** – The tips of the tripod ferrules are very sharp. When handling or carrying the tripod, take care to avoid injuring yourself on the ferrules.

**Note** – Do not carry the instrument while it is attached to a tripod.

 
1. Open the tripod legs far enough for the instrument to be stable.
2. Locate the tripod directly over the station point. To check the position of the tripod, look through the center hole in the tripod head.
3. Firmly press the tripod ferrules into the ground.
4. Level the top surface of the tripod head.
5. Securely fasten the thumb screws on the tripod legs.
6. Place the instrument on the tripod head.
7. Insert the tripod mounting screw into the center hole of the base plate of the instrument.
8. Tighten the tripod mounting screw.


## Centering the instrument

When you center the instrument, you align its central axis precisely over the station point. To center the instrument, you can use the optical plummet, the laser plummet, or a plumb bob. The plumb bob is sold separately.

### Centering with the optical plummet

**Note** – For high accuracy, check and adjust the optical plummet before you center the instrument.

1. Set up the instrument on the tripod. See above.
2. Look through the optical plummet and align the reticle with the station point. To do this, turn the leveling screws until the center mark  of the reticle is directly over the image of the station point.
3. While supporting the tripod head with one hand, loosen the tripod leg clamps and adjust the lengths of the legs until the air bubble is in the center of the circular level.
4. Tighten the tripod leg clamps.
5. Use the electronic level to level the instrument. See also [Leveling the instrument, page 31](#).

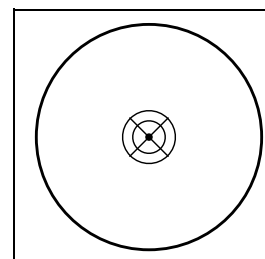

6. Look through the optical plummet to make sure that the image of the station point is still in the center of the reticle mark.
7. If the station point is off-center, do one of the following:
  - If the station point is slightly off-center, loosen the tripod mounting screw and then center the instrument on the tripod. Use only direct movement to center the instrument. Do not rotate it.  
  
When the instrument is centered, tighten the mounting screw.
  - If there is major displacement of the station point, repeat this procedure starting with Step 2.

### Centering with the laser plummet



---

**CAUTION** – Do **not** look at the laser directly.

---

**Note** – For high accuracy, check and adjust the laser plummet before you center the instrument.

1. Set up the instrument on the tripod. See [page 29](#).
2. Turn on the laser plummet.
3. Align the laser pointer to the station point. To do this, turn the leveling screws until the laser pointer is over the station point.
4. While supporting the tripod head with one hand, loosen the tripod leg clamps and adjust the lengths or the legs until the air bubble is the center of the circular level.
5. Tighten the tripod leg clamps.
6. Use the electronic level to level the instrument. See [Leveling the instrument, page 31](#).
7. Check that the laser pointer is over the station point.
8. If the station point is off-center, do one of the following:
  - If the station point is slightly off-center, loosen the tripod mounting screw and then center the instrument on the tripod. Use only direct movement to center the instrument. Do not rotate it.  
  
When the instrument is centered, tighten the mounting screw.
  - If there is major displacement of the station point, repeat this procedure starting with Step 2.



## Centering with a plumb bob

1. Set up the instrument on the tripod. See [page 29](#).
2. Hang the plumb line on the hook of the tripod mounting screw.
3. Adjust the length of the plumb line so that the tip of the plumb bob is at the height of the station point.
4. Loosen the tripod mounting screw slightly.
5. Using both hands to support the outer side of the tribrach, carefully slide the instrument about on the tripod head until the tip of the plumb bob is positioned over the exact center of the station point.


**Note** – To confirm that the instrument is precisely aligned, check its position from two directions at right-angles to each other.

## Leveling the instrument

When you level the instrument, use the electronic level to you make the vertical axis of the instrument exactly vertical. During leveling, always set the instrument in the Face 1 direction. See [Figure 3.1, page 40](#).

To level the instrument:

1. Move the bubble into the circle on the circular level and then turn on the power.
2. Rotate the alidade until the bottom edge of the keyboard panel is parallel to the two of the leveling screws (B and C).
3. Use leveling screws B and C to move the bubble into the center of the electronic level.
4. Rotate the alidade approximately 90°.
5. Use leveling screw A to move the bubble into the center of the electronic level.
6. Repeat Step 1 through Step 5 to center the bubble in both positions.
7. Rotate the alidade 180°.
8. If the bubble in the electronic level remains centered, the instrument is level. If the bubble moves off center, adjust the electronic level. For detailed instructions, see [Adjusting the electronic level, page 152](#).

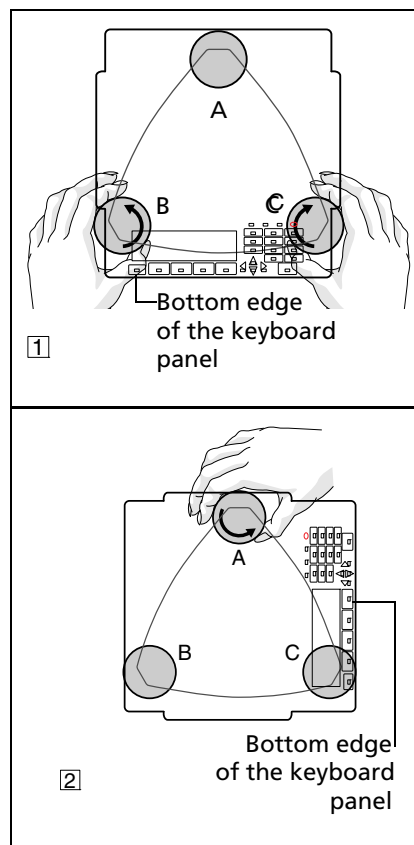


## Focusing the telescope




**WARNING** – Never look at the sun through the telescope. If you do, you may damage or lose your eyesight.

When you sight the instrument, you aim the telescope at the target, bring the target image into focus, and align the image with the center cross-hairs of the reticle.

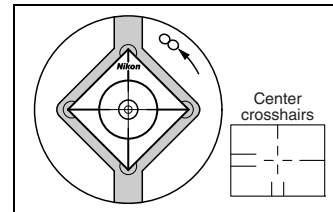

To sight the instrument:

1. Adjust the diopter:
  - a. Aim the telescope at a blank area, such as the sky or a piece of paper.
  - b. Looking through the eyepiece, rotate the diopter ring until the reticle cross-hairs are in sharp focus.
2. Eliminate parallax:
  - a. Aim the telescope at the target image.
  - b. Rotate the focusing ring until the target image is in sharp focus on the reticle cross-hairs.
  - c. Move your eye vertically and laterally to check whether the target image moves relative to the reticle cross-hairs.
    - If the target image does not move, there is no parallax.
    - If the target image does move, rotate the telescope focusing ring and repeat [Step 2c](#).
3. Rotate the tangent screw. The final turn of the tangent screw should be in a clockwise direction, to align the target accurately on the center cross-hairs.

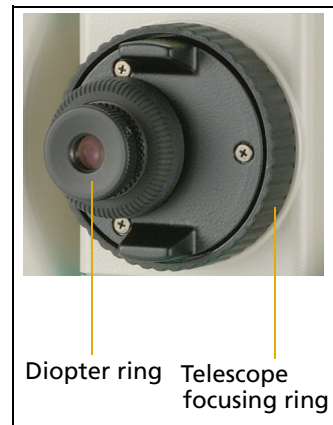

# Setting the measurement mode and preparing the target

The Focus 6 2" total station has two measurement modes: Prism mode (P*r*i*s*m) and Reflectorless mode (N*-*P*r*i*s*m). To change the mode at any time from any observation screen, hold down [MSR1] or [MSR2].

Set the measurement mode depending on the target that you want to measure, as shown here.

| Target                      | Target settings    |
|-----------------------------|--------------------|
| Prism, reflector sheet      | Prism mode         |
| Other, reflective materials | Reflectorless mode |

In some cases, you can measure to another target that is not appropriate to the set measurement mode.


**Note** – The Focus 6 2" total station is Laser Class 3R in the Reflectorless mode and Laser pointer function, and Laser Class 1 in the Prism mode. Do not sight the prism when the Laser Pointer is on.

## Measurement with a prism


As the Focus 6 2" total station is extremely sensitive, multiple reflections on the prism surface can sometimes cause a significant loss in accuracy.

To maintain the accuracy of your measurements:


- Use a prism with thin edges.

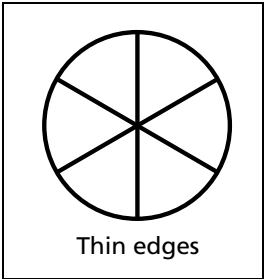

Do not use a prism with scratches, a dirty surface, a chipped center, or thick edges.

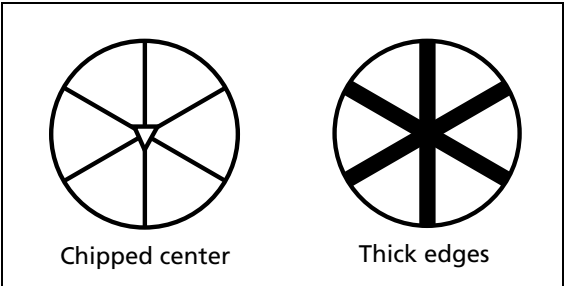

- When measuring a short distance, incline the prism slightly so that the EDM can ignore unnecessary reflections on the prism surface, as shown below.

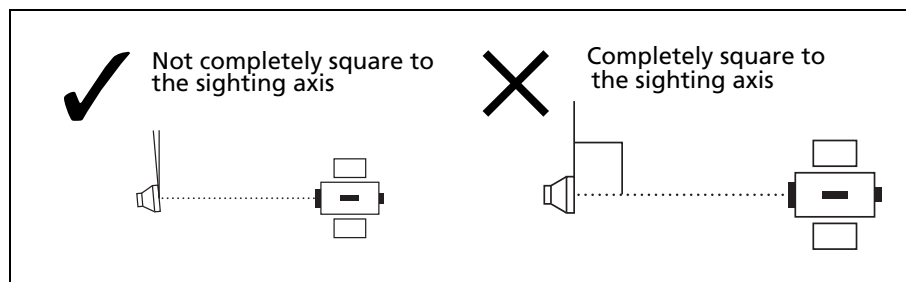

- Hold the prism securely in place and do not move while taking measurements.

In Prism mode, to avoid false measurements on objects other than the prism or reflector-sheet, targets that are less reflective than the prism or reflector sheet are not measured. Even if you start a measurement, measured values are not displayed. To measure less reflective objects, use the N-Prism (Reflectorless) mode.

### Measurement in reflectorless (N-Prism) mode

The Focus 6 2" total station enables reflectorless measurements up to 300 m (984 feet).

The intensity of the reflection from the target determines the distance the Focus 6 2" total station can measure in this mode. The color and condition of the target surface also affect the measurable distance, even if the targeted objects are the same. Some less-reflective targets may not be measured.

The following table describes some examples of targets and approximate measuring distances:

| Target                         | You can measure approximately...    |
|--------------------------------|-------------------------------------|
| Traffic signs, reflectors      | 500 meters (1640 feet)              |
| Paper (white), veneer (new)    | 300 meters (990 feet)               |
| wall (brightly painted), brick | 100 to 200 meters (330 to 660 feet) |

Measurable distances may be shorter or measurement intervals may be longer if either of the following conditions apply:

- the angle of the laser against the target is small
- the surface of the target is wet


In direct sunlight, the measurable distance may be shorter. In this case, try to throw a shadow on the target.

Targets with completely flat surfaces, such as mirrors, cannot be measured unless the beam and the target are perpendicular to each other.

Make sure there are no obstacles between the instrument and the target when taking measurements. When you need to take measurements across a road or a place where vehicles or other objects are frequently moving, take several measurements to a target for the best result.


## Preparing the reflector sheet

The reflector sheet can be used for measurements in Prism mode. Assemble the reflector sheet as shown below.

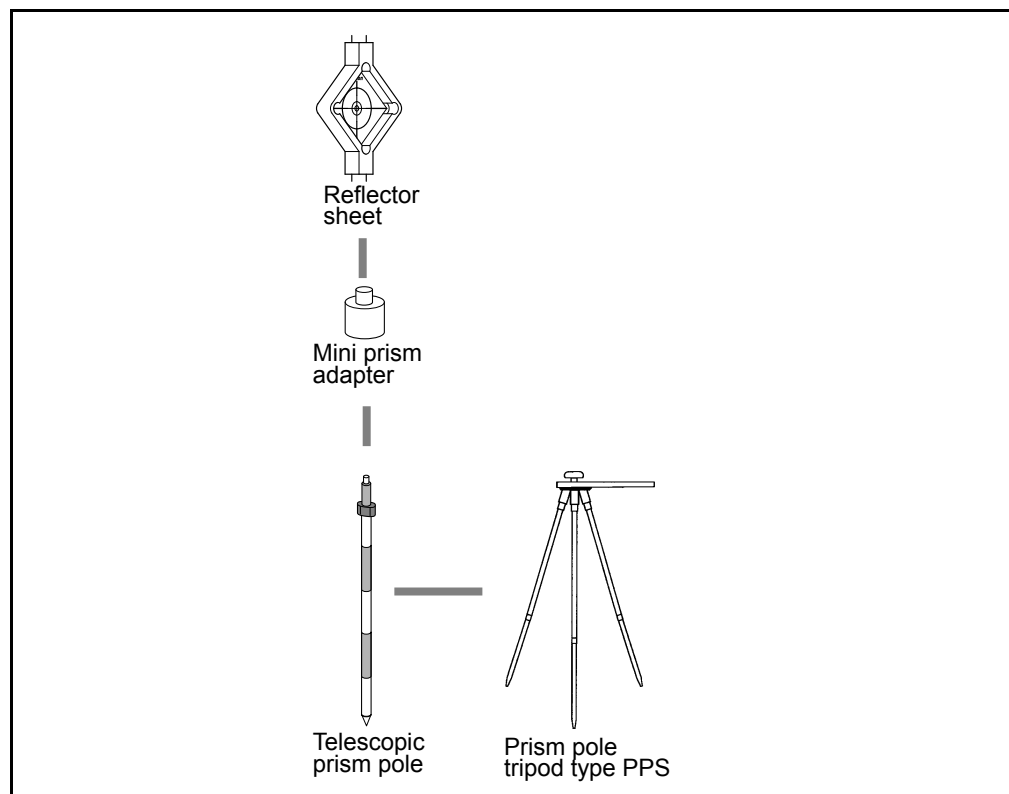

## Setting up the prism reflector

1. Assemble the prism reflector as shown below:

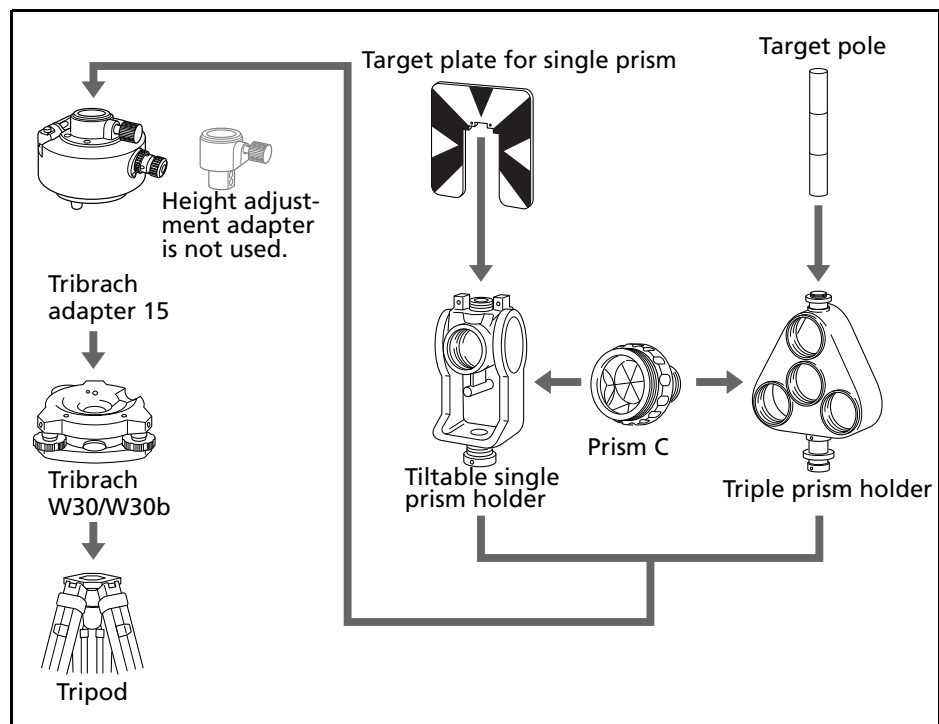


2. Adjust the height of the tribrach adaptor (see [page 37](#)).
3. If necessary, change the direction of the prism (see [page 37](#)).
4. Set the prism constant (see [page 37](#)).
5. If you are using a single prism holder, set the position of the target plate (see [page 37](#)).

Detailed instructions for [Step 2](#) through [Step 5](#) are provided on the following pages.

**Note** – You must use the Focus 6 2" total station with the W30 or W30b tribrach.

## Adjusting the height of the tribrach adapter

The tribrach adapter has a height adjustment adapter. To use the prism reflector with a Focus 6 2" total station, remove the height adjustment adapter as shown in the following figure. The height adjustment adapter is used with other Nikon total stations:

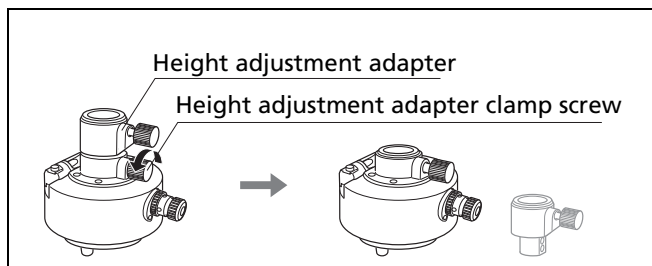


## Changing the direction of the prism

You can rotate the prism mounted on the tribrach adapter to face in any direction.

To change the direction of the prism:

1. Release the rotation clamp. To do this, turn the clamp lever counterclockwise.
2. Turn the upper plate of the tribrach adapter until the prism is facing in the required direction.
3. Fasten the rotation clamp. To do this, turn the clamp lever clockwise.

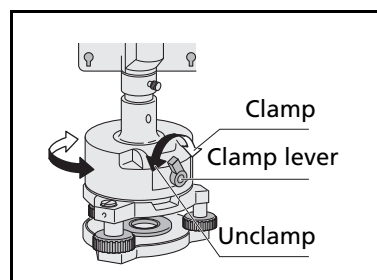

## Setting the prism constant


1. Attach the prism to the single prism holder or triple prism holder.



**Tip** – To use a triple prism holder as a single prism holder, attach the prism to the center thread of the prism holder.

2. Set the prism constant. To do this, hold down **[MSR1]** or **[MSR2]** for one second.

**Note** – The prism constant of a Nikon prism is always 0, whether it is attached to a single prism holder or a triple prism holder. If your prism constant is not 0 mm, then directly enter the prism constant value in the Const field. For example, if your prism constant is 30 mm, enter 30mm in the Const field on the instrument.

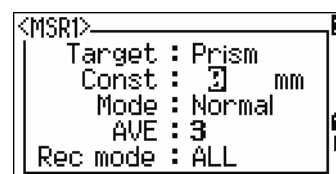


**Tip** – When you use the prism at a short distance, set the prism at a slight angle to the sighting axis, rather than completely square.

## Viewing and changing the measurement settings

Hold down [MSR1] or [MSR2] for one second.

- To move the cursor between the fields, press  $\uparrow$  or  $\downarrow$ .
- To change the value in the selected field, press  $\leftarrow$  or  $\rightarrow$ .

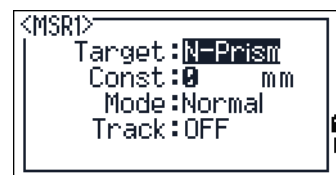

The available values are:

| Field                     | Values  |
|---------------------------|---|
| Target                    | Prism mode<br>N-Prism mode                              |
| Constant (prism constant) | -999 mm through 999 mm                                  |
| Mode                      | Precise<br>Normal                                       |
| Track                     | Track (continuous MSR) ON<br>Track (continuous MSR) OFF |



# Getting Started

**In this chapter:**

- [Parts of the instrument](#)
- [Instrument keyboard and display](#)
- [Turning on the instrument](#)
- [Turning off the instrument](#)
- [Regional configuration](#)
- [List available jobs or data](#)
- [Entering data](#)
- [Creating or opening a job](#)
- [Measuring distances](#)

After you set up the instrument, see [page 23](#), you can start using the Focus 6 2" total station.

This chapter describes the basic features of the instrument, how to turn it on, change the instrument settings, and start a job.

## Parts of the instrument

Figure 3.1 and Figure 3.2 show the main parts of the Focus 6 2" total station.

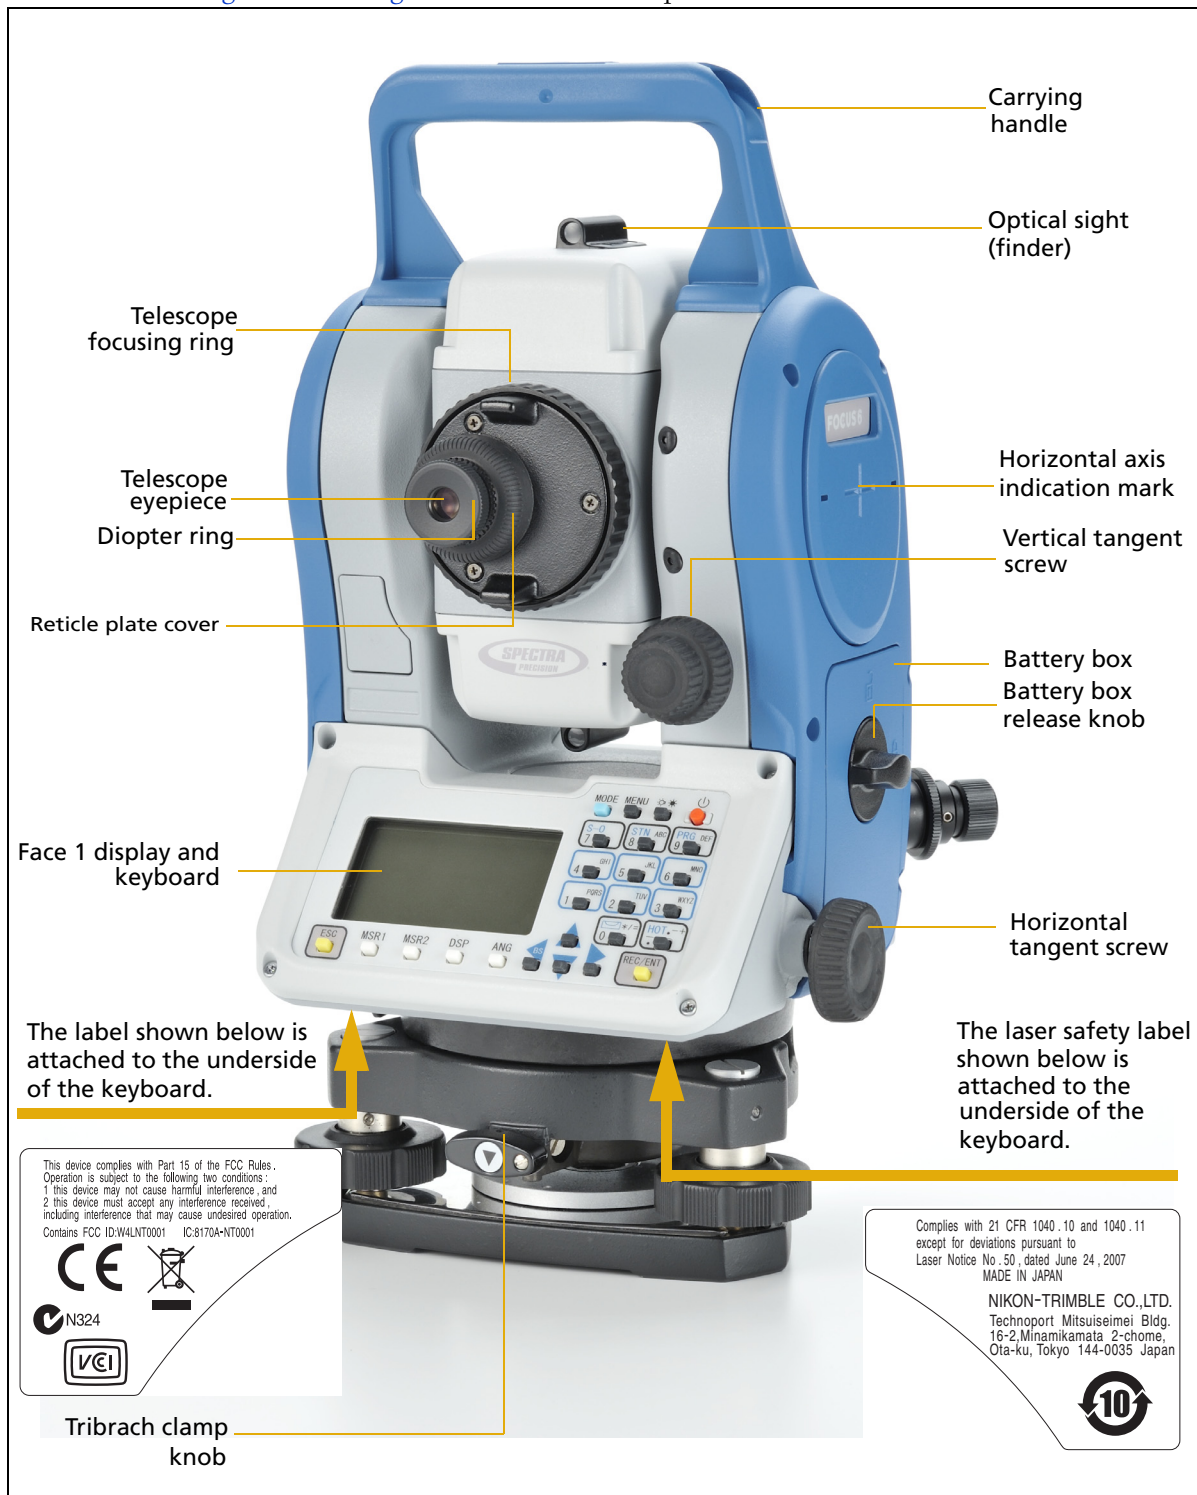


Figure 3.1 Back view of the Focus 6 2" total station (Face 1)


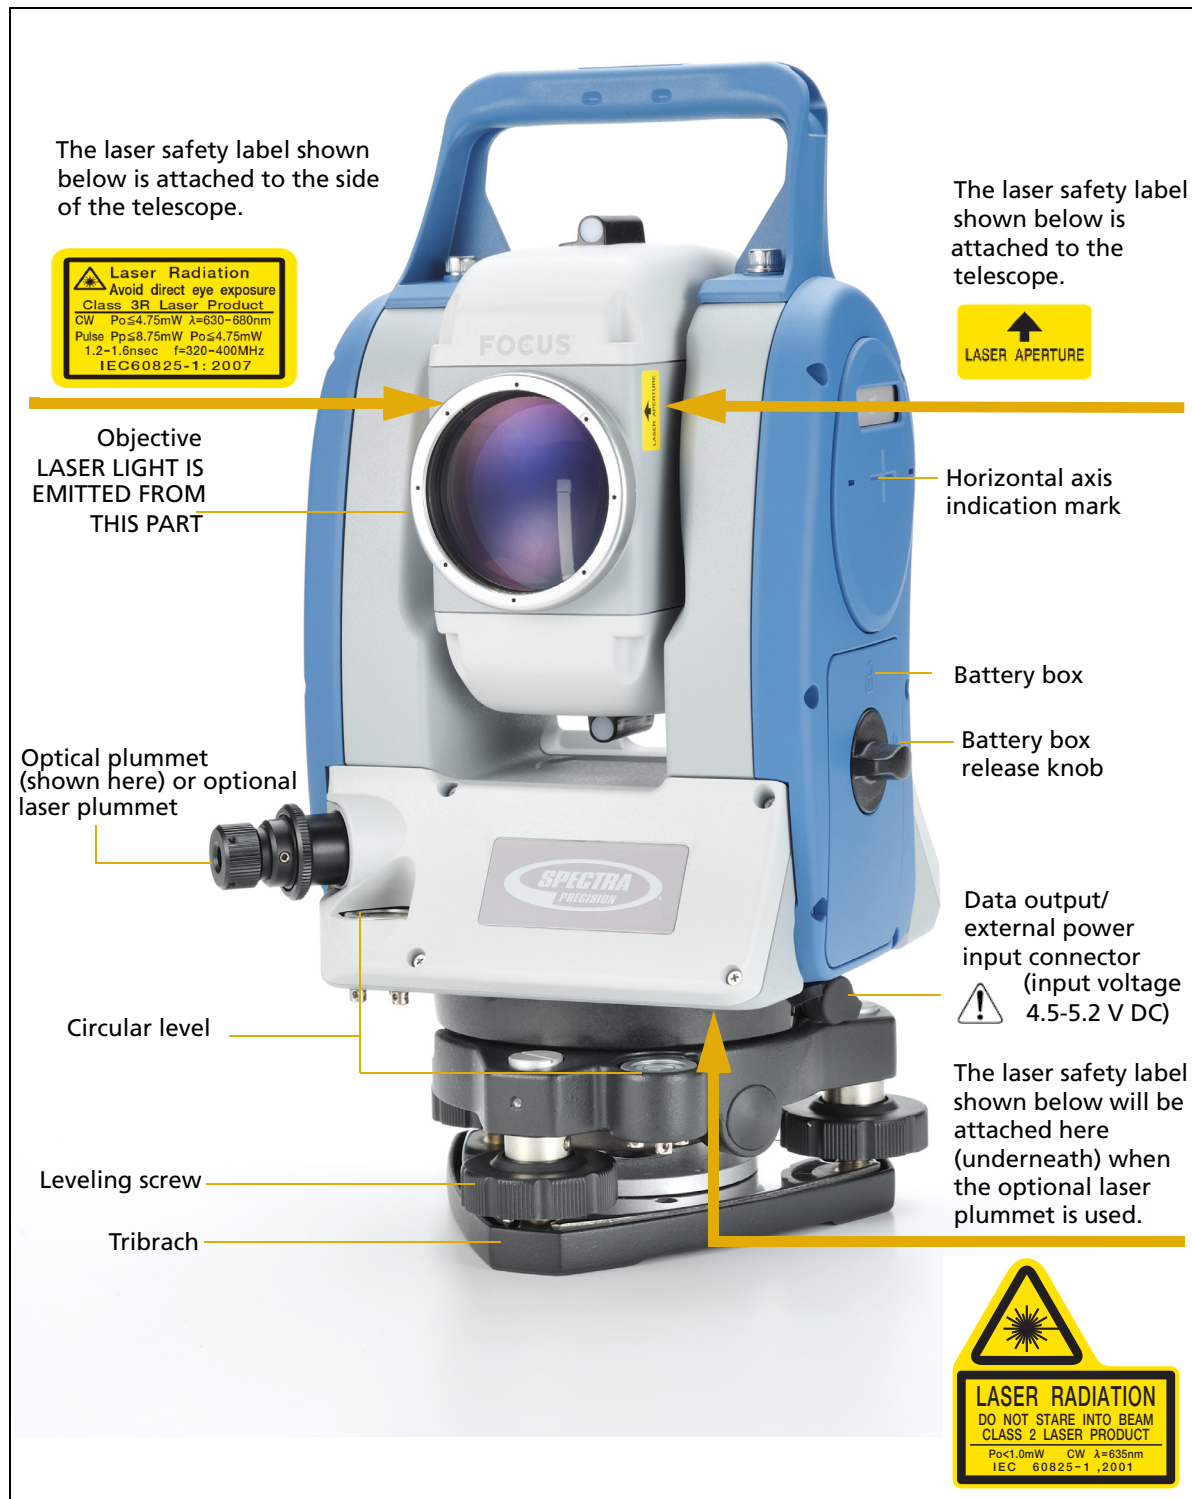


Figure 3.2 Front view of the Focus 6 2" total station (Face 2)






## Instrument keyboard and display

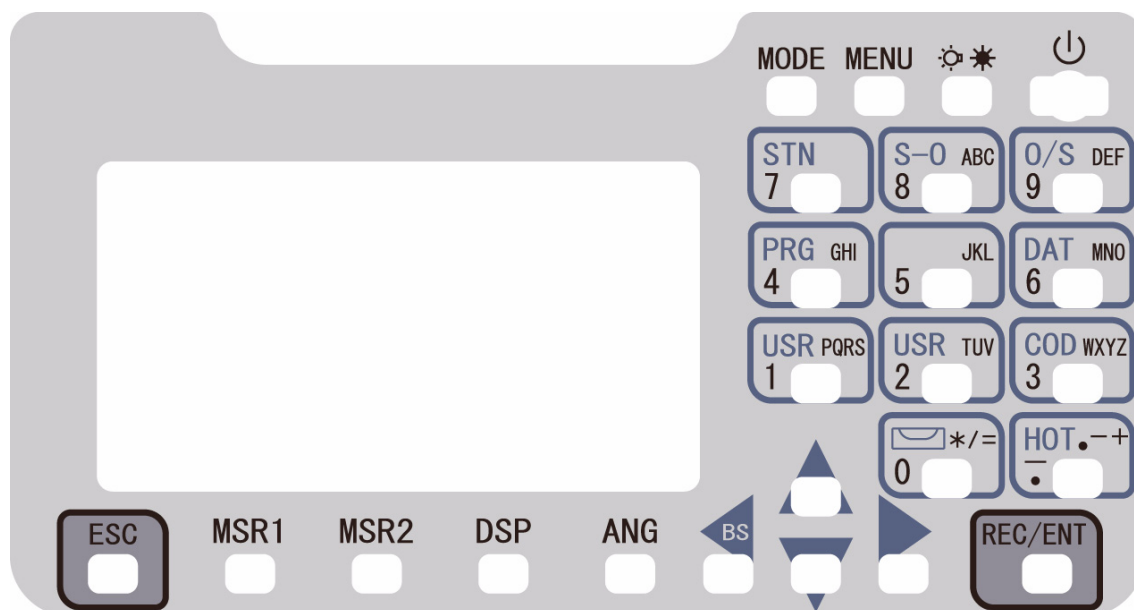





 











### Instrument keyboard

Use the buttons on the instrument keyboard to carry out the following functions::

The functions of the Nivo keys are as follows.


| Button  | Function  | See ...                  |
|---|---|--------------------------|
|          | Turns the instrument on or off.   | <a href="#">page 55</a>  |
|          | (Illumination button)<br>Provides access to the switch window.<br>Turns on/off the LCD backlight if held down for one second.   | <a href="#">page 46</a>  |
| MENU<br> | Displays the MENU screen.   | <a href="#">page 109</a> |
| MODE<br> | <ul style="list-style-type: none"> <li>Changes the input mode between alphanumeric and numeric if pressed when you are in a PT or CD field.</li> <li>Activates Qcode mode if pressed when you are In the Basic Measurement Screen (BMS).</li> </ul>   | <a href="#">page 49</a>  |
|          | <p>Records measured data, moves on to the next screen, or confirms and accepts the entered data in input mode.</p> <p>You have the option to record the measurement as a CP record instead of an SS record, if you hold this key down for one second in the Basic Measurement Screen (BMS).</p> <p>The instrument outputs the current measurement data (PT, HA, VA, and SD) on the COM port if you press this key in the BMS or in a Stakeout observation screen. (The Data Rec settings must be set to COM.)</p> | <a href="#">page 99</a>  |

| Button  | Function   | See ...                 |
|---|--|-------------------------|
|    | Returns to the previous screen.<br>In numeric or alphanumeric mode, deletes input.   |                         |
|    | Starts distance measurement, using the measure mode settings for the <b>MSR1</b> button.<br>Displays measurement mode settings, if held down for one second.             | <a href="#">page 64</a> |
|    | Starts distance measurement, using the measure mode settings for the <b>MSR2</b> key.<br>Displays measurement mode settings, if held down for one second.                | <a href="#">page 64</a> |
|    | Moves to the next available display screen.<br>Changes the fields that appear on the DSP1, DSP2, and DSP3 screens, if held down for one second.                          | <a href="#">page 47</a> |
|    | Displays the Angle menu.   | <a href="#">page 70</a> |
|    | Displays the Station Setup menu.<br>In numeric mode, enters 7. In alphanumeric mode, enters 7.   | <a href="#">page 82</a> |
|   | Displays the Stakeout menu.<br>Shows stakeout settings, if held down for one second.<br>In numeric mode, enters 8. In alphanumeric mode, enters A, B, C, or 8.           | <a href="#">page 71</a> |
|  | Displays the Offset Point Measurement menu.<br>In numeric mode, enters 9. In alphanumeric mode, enters D, E, F, or 9.  | <a href="#">page 89</a> |
|  | Displays the Programs menu, which contains additional measuring programs.<br>In numeric mode, enters 4. In alphanumeric mode, enters G, H, I, or 4.                      | <a href="#">page 51</a> |
|  | In numeric mode, enters 5. In alphanumeric mode, enters J, K, L, or 5.   | <a href="#">page 53</a> |
|  | Displays RAW, XYZ, or STN data, depending on your setting.<br>In numeric mode, enters 6. In alphanumeric mode, enters M, N, O, or 6.                                     | <a href="#">page 55</a> |
|  | Executes the function that is assigned to the <b>USR1</b> key.<br>In numeric mode, enters 1. In alphanumeric mode, enters P, Q, R, S, or 1.                              | <a href="#">page 54</a> |
|  | Executes the function that is assigned to the <b>USR2</b> key.<br>In numeric mode, enters 2. In alphanumeric mode, enters T, U, V, or 2.                                 |                         |
|  | Opens a window where you can enter a code. The default code value is the last code entered.<br>In numeric mode, enters 3. In alphanumeric mode, enters W, X, Y, Z, or 3. | <a href="#">page 50</a> |

| Button  | Function  | See ...                 |
|---|---|-------------------------|
|  | Displays the (HOT) menu, which includes Height of Target, Temp-Press, Target, Note recording, and Default PT settings.<br>In numeric mode, enters – (minus). In alphanumeric mode, enters . (period), – (minus), or + (plus). | <a href="#">page 51</a> |
|  | Displays the Bubble indicator.<br>In numeric mode, enters 0. In alphanumeric mode, enters *, /, =, a space, or 0.   | <a href="#">page 53</a> |


## Status bar

The status bar appears on the right of every screen. It contains icons that indicate the status of various system functions.

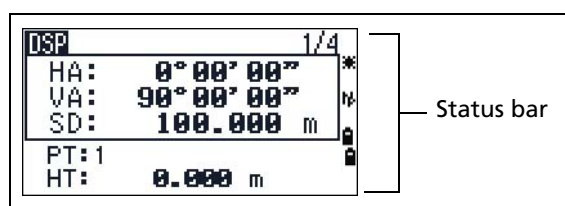

Laser-pointer indicator

 


The icon appears as you turn on the laser pointer. When the icon appears on the screen, the emitting power is laser class 3R.



If there is no icon, the laser pointer is off.



Input mode indicator

The input mode indicator appears only when you are entering points or coordinates. It shows the data input mode:


-  Input mode is numeric. Press a button on the number pad to enter the number printed on the button.
-  Input mode is alphabetic. Press a button on the number pad to enter the first letter printed beside the button. Press the button repeatedly to cycle through all the letters assigned to that button.  
For example, to enter the letter O in alphabetic mode, press  three times.

Battery indicator

Shows each voltage level of the right and left internal batteries individually. When the external battery is connected with the instrument, its voltage is shown.

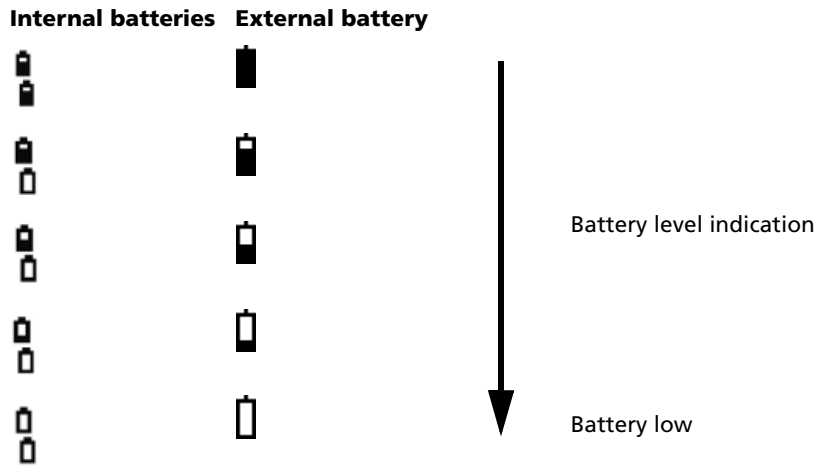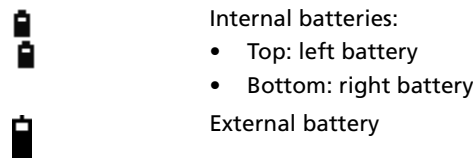

If the battery level is critically low, a message appears.

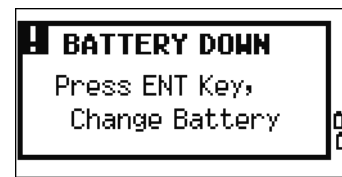

### EDM measurement status

When you are taking measurements, the EDM measurement status shows the mode that is being used.

When you display observation data, the EDM measurement status shows the mode that was used when the data was collected:



Reflectorless mode

If there is no icon, Prism mode is being used.

### Communication port status

(This is only available when the optional Bluetooth is installed. See [Optional Bluetooth function, page 144.](#))




Bluetooth enabled

## LCD backlight, laser pointer, beep sound, and contrast adjustment

Press the illumination key to open the 4-switch window and then press:

- ① to turn the LCD backlight on/off
- ② to turn the laser pointer on /off
- ③ to turn the beep sound on /off
- ④ to open the contrast adjustment window.

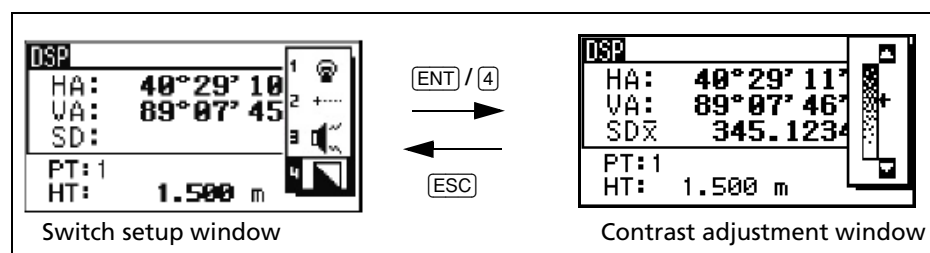

Do the following:

- To turn on/off each function, press **ENT** when the option 1, 2, 3 or 4 is selected or directly press the ①, ②, ③, or ④ key. Holding down the illumination key for one second also turns on/off the LCD backlight.
- To move the cursor up and down, press **▲** or **▼**.



- To adjust the contrast, in the contrast adjustment window, press  $\triangleright$  or  $\triangleleft$ .
- To close the window, press  $\text{ESC}$ .

### Switch 1: Adjusting the LCD backlight



LCD backlight is on



LCD backlight is off

### Switch 2: Turning on/off the laser pointer



Laser pointer is on



Laser pointer is off

The icon appears while turning on the laser pointer. When the icon is on the screen, the emitting power is Laser Class 3R.

### Switch 3: Turning on/off the sound



Sound is on



Sound is off

### $\text{DSP}$ button

Use the  $\text{DSP}$  button to change the current display screen or to change display settings.

### Switching between display screens

When several display screens are available:


- the  $\text{DSP}$  indicator appears at the top left of the screen
- the screen indicator (for example, 1/4) appears at the top right

|              |            |
|--------------|------------|
| $\text{DSP}$ | 1/4        |
| HA:          | 40°29' 11" |
| VA:          | 89°07' 46" |
| SD $\bar{x}$ | 345.678 m  |
| PT: 1        |            |
| HT:          | 1.500 m    |


To move to the next available screen, press  $\text{DSP}$ .

|              |            |
|--------------|------------|
| $\text{DSP}$ | 2/4        |
| HA:          | 40°29' 11" |
| VD:          | 0.802 m    |
| HD:          | 343.248 m  |
| PT: 1        |            |
| HT:          | 1.500 m    |

For example, if you are currently in the second display screen, press **[DSP]** to move to the third display screen. The screen indicator changes from 2/4 to 3/4.

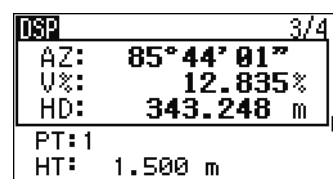

When the secondary distance unit is set, an additional screen is available. It shows the HD, VD, and SD values. See also [Others settings, page 129](#).

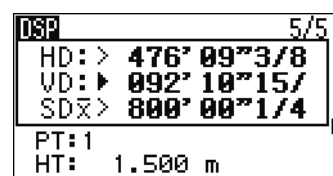

The smallest unit of display for distances measured in feet-and-inches is  $\frac{1}{16}$  inch. Smaller units are impractical in the field.


When the actual value is greater than 9999'11"15/16, the > symbol appears. If the actual distance is less than -9999'11"15/16, the ► (solid triangle) symbol appears. This does not affect calculations. The precise value is used internally in all cases.

### Customizing items in the Basic Measurement Screen (BMS)

To customize the items that are displayed on the DSP1, DSP2, and DSP3 screens:

1. Hold down **[DSP]** for one second.
2. Use the arrow buttons **[↑]**, **[↓]**, **[←]**, and **[→]** to highlight the item that you want to change:
3. Press the **[F1]** or **[F2]** softkey to scroll through the list of items that can be displayed for this item.

The items that you can choose from are HA, AZ, HL, VA, V%, SD, VD, HD, Z, and (none).

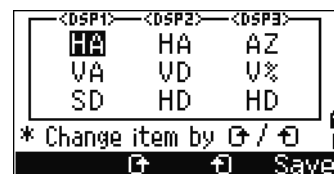

4. To save your changes, press the **[Save]** softkey.

Alternatively, highlight the last item for DSP3 and press **[ENT]**. The DSP screens show the items you have selected.

Except for the (none) item, you cannot display the same item on more than one line of the same screen.


The items displayed in the DSP1, DSP2, DSP3, and DSP4 screens are also used in the corresponding Layout screens (LO2, LO3, LO4, and LO5).

You can also customize the displayed items in Layout.

### Header characters

The following header characters appear in DSP screens:

- Colon (:) indicates that tilt correction is applied to the value.
- Hash symbol (#) indicates that tilt correction is off.

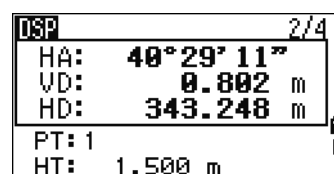


- Underscore ( \_ ) under the tilt correction character indicates that Sea Level Correction or Scale factor is applied.

### **MODE button**

The **MODE** button is on the top row of the Focus 6 2" keypad. Use it to change the keyboard mode for the current screen.


### **Changing the input mode while entering points or codes**

When the cursor is in a point (PT) or code (CD) field, press **MODE** to change the input mode between alphanumeric (A) and numeric (1).

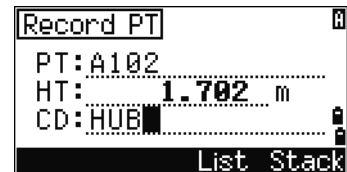


The input mode indicator in the status bar changes to show the current input mode.

When the cursor is in a height (HT) field, only numeric input mode is available. Pressing **MODE** has no effect when the cursor is in a HT field.

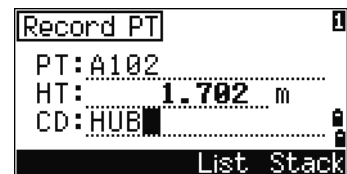

### **Quick code measurement mode**

1. To activate Quick code measurement mode, press **MODE** in the BMS.

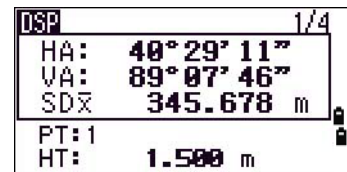


The PT field shows the default point name.

2. Press any numeric key ([0] through [9]) to start measuring and recording points.


A list of the numeric keys and their assigned feature codes appears on the right side of the screen.



For example, when you press [6], the code assigned to 6 is selected, and the instrument starts a measurement.

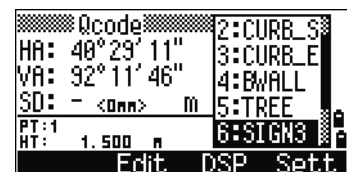

3. If you have set the record mode to Confirm (see [Viewing and changing the measurement settings, page 66](#)), the Record PT screen appears after each measurement.

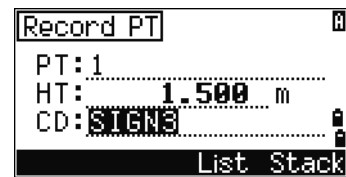

Do one of the following:

- To record the point, press **[ENT]**.
- To return to the BMS, press **[ESC]**.

**Note** – To assign a new feature code to a numeric key, press **[v]** or **[^]** to highlight the code that you want to change. Then press the **Edit** softkey. You can use the **DSP** softkey to change the values shown in the measurement box, in the same way as you use the **[DSP]** key in the Basic Measurement Screen (BMS).

4. To return to the BMS from the Qcode screen, press **[MODE]** or **[ESC]**.

### **[COD]** key

In the BMS, press **[COD]** to change the default feature code that will appear in the CD field when you record a point.

### Setting the default code

When you press **[COD]** in the BMS, a window for entering the feature code appears.

You can use the **List** and **Stack** softkeys to enter the code.



### Qcode observations


To enter the Quick code observation routine, press the **Qcode** softkey.

In this function, you can use the ten numeric keys to both select a feature code and shoot a point.



To change the measurement mode for the Quick code observation, press the **Sett** softkey.

In Quick code measurement, the Rec mode can only be set to Confirm or ALL.

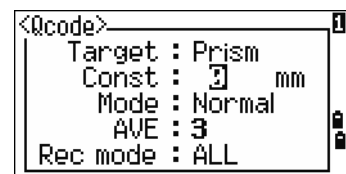


**HOT key**

The HOT key menu is available from any observation screen. To display the HOT key menu, press **HOT**.

**Changing the height of the target**


1. Press **HOT** to display the HOT menu.
2. Do one of the following:
  - Press **1**.
  - Select HT.
3. Press **ENT**.
4. Enter the target height or select the height from the HT stack.

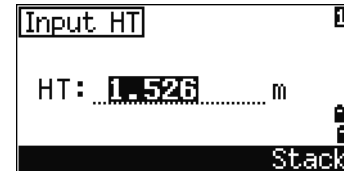


**Note** – To display the HT stack, press the **Stack** softkey. The HT stack stores the last 20 HT values entered.

**Setting the current temperature and pressure**

1. Press **HOT** to display the HOT menu.
2. Do one of the following:
  - Press **2**.
  - Select Temp-Press.
3. Press **ENT**.
4. Enter the ambient temperature and pressure. The ppm value is updated automatically.

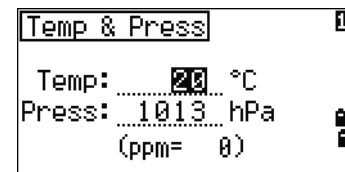**Selecting the target set**

A target set specifies settings for the target type, the prism constant, and height of target. When you change the selected target set, all three settings are changed. You can use this function to quickly switch between two types of target, such as a reflector sheet and a prism. You can prepare up to five target sets.

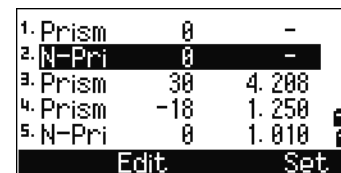

Press **HOT** to display the HOT menu. Then either press **3**, or select **Target** and press **ENT**. A list of the five target sets appears. To select a target set, either press the corresponding numeric key (**1** through **5**), or use **^** or **v** to highlight the target set in the list and press **ENT**.

To change the settings defined in a target set, highlight the target set in the list. Then press the **Edit** softkey.

Type Prism/N-Prism  
 Const -999 to 999 mm  
 HT -9.990 to 99.990 m



**Note** – HT can be left blank in the target set. If you leave it blank, the current HT value is always applied to the measurement. When a target set is selected, the Type and Const values are copied to both **[MSR1]** and **[MSR2]** settings, and to the measurements in Qcode. If you have specified a value for HT, this value is also copied to the current HT.

### Entering a field note

To enter a field note, press **[HOT]** to display the HOT menu. Then either press **[4]**, or select **Note** and press **[ENT]**.

This function can be used at any time on any observation screen.


Each note can be up to 50 characters.

The note is stored as a CO record in the raw data.



To display a list of previously used notes, press the **Stack** softkey. The stack stores the last 20 notes.

Use **[^]** or **[v]** to highlight a note in the list. Then press **[ENT]** to select the note.

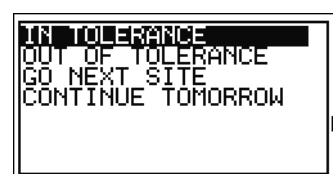


### Setting the default point name

To change the default point name, press **[HOT]** to display the HOT menu. Then press **[5]**, or select **Default PT** and press **[ENT]**.

This function is available from any observation screen.


Modify the default point name for the next record.



Press **[ENT]** to confirm the new default point name. The new point name is appears as the default PT name on the input screen.

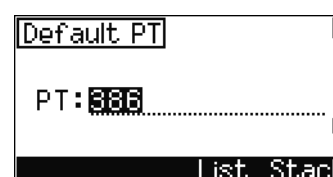



## Bubble indicator


 
The bubble indicator appears if the instrument goes out of level while the compensator is turned on. It also appears directly after the start up screen.

To display the bubble indicator in an observation screen at any other time, press .

The Focus 6 2" total station has a two-axis level compensation. To turn the leveling compensators on or off, press  or . When the levelling compensators are turned off, the text OFF appears on the screen.

If the instrument is more than  $\pm 3'30''$  out of level, the text OVER appears on the screen.



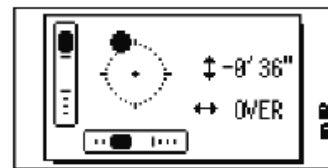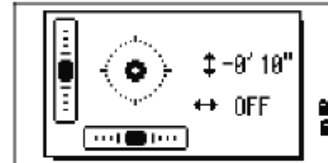


To return to the observation screen, press  or .





## Laser plummet (option)

### Laser plummet on / off



Do one of the following:


- To turn the laser plummet switch on, press  ON.
- To close the bubble indicator window, press .
- To turn the laser plummet switch off, press  OFF.
- To open the luminance adjustment window, press .
- To turn the laser plummet switch off and close the bubble indicator window, press .

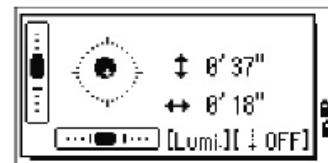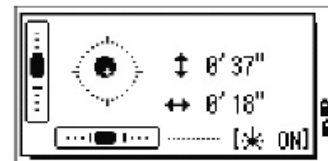

### Laser luminance adjustment

 Laser luminance can be set to 4 levels.

- To set the luminance brighter by one level, press  once.
- To set the luminance darker by one level, press  once.

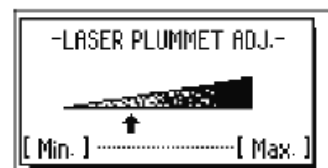

To return to the bubble indicator window, press  or .

**Note** – The current setting of leveling compensators is indicated by header characters (;, #, ., and #) after field labels (such as HA, VA, SD, and HD) in observation screens. For more information, see [Header characters, page 48](#).

## USR keys

If you use a function frequently in the field, you can assign it to the **USR1** or **USR2** key. Whenever you press a **USR** key, the function that is assigned to that key is activated directly.

The following functions can be assigned to the **USR** keys:

- Input HT
- BS Check
- Base XYZ
- Default PT
- Select Target
- Input Temp-Press
- Input Note
- The following menus, or a single function from one of these menus:
  - Cogo
  - O/S
  - PRG

By default, Input HT is assigned to **USR1**, and no function is assigned to **USR2**.

Hold down the **USR** key for one second to display the list of functions that can be assigned to the key. The currently assigned function is indicated by an asterisk (\*) beside the function name.




To change the function that assigned to the key, press **▲** or **▼** to highlight the function. Then press **ENT**.

If an item on the list has an arrow (→) beside it, this item is a menu. If you highlight a menu item and then press **ENT**, a sub-menu appears.

The first item on the sub-menu ends with the text **[MENU]**. If you select this item, the whole menu is assigned to the **USR** key.

To assign a specific function from the sub-menu, press **▲** or **▼** to highlight the function. Then press **ENT**.

Once you have assigned a function to a **USR** key, it is called directly whenever you press that **USR** key in the BMS.

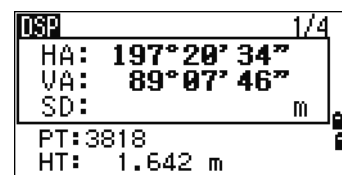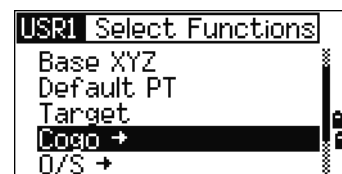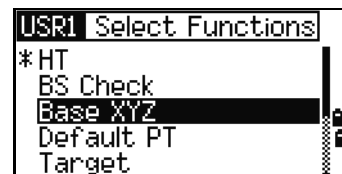



To change the type of data that is assigned to the [USR] keys in MENU > 1sec-Keys > [USR]. For more information, see [USR] key settings, page 148.

### [DAT] key

Use the [DAT] key to quickly access data in the current job from observation screens.




When you press [DAT] in the BMS or in observation screens in functions such as Stakeout, 2Pt RefLine, and Arc RefLine, the assigned data in the current job appears.

Hold down [DAT] for one second in the BMS or an observation screen to display the Select Format screen. Use this screen to change the type of data that is assigned to [DAT]. Press [1] or select DAT [MENU] to display the Data menu whenever you press [DAT].

When you select an option from this screen, the change is applied immediately, and the selected data type appears.

Press [ESC] to return to the previous observation screen.



To change the type of data that is assigned to [DAT], go to MENU > 1sec-Keys > [DAT]. For more information, see [DAT] key settings, page 149.

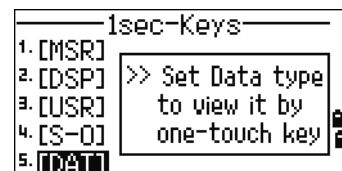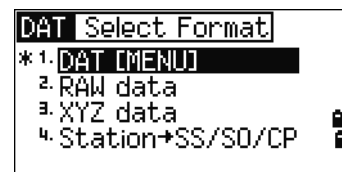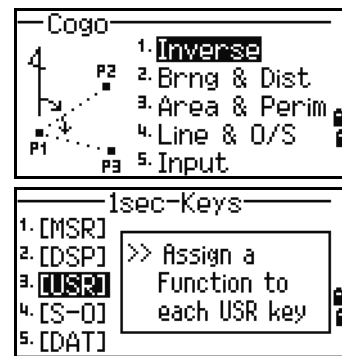

## Turning on the instrument

Press the [PWR] button. The start-up screen appears. It shows the model name, current temperature, pressure, date, and time. The display automatically changes to the electronic level after two seconds.

If you entered your name or your company's name in the Owner's detail field, the text from this field appears on the start-up screen. To set the Owner's detail field, press [MENU] and then select Settings / Other. See also Others settings, page 129.

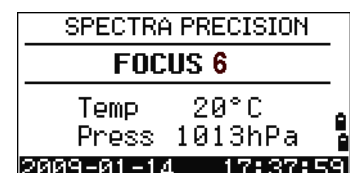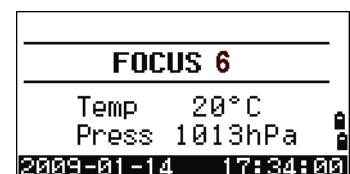

## Turning off the instrument

1. Press **PWR** and **ENT**.
2. Do one of the following:

| Press...                 | To...  |
|--------------------------|--|
| <b>ENT</b> again         | turn off the instrument  |
| the <b>Reset</b> softkey | reboot the software and re-start the instrument                |
|                          | access the Basic Measurement Screen (BMS) without an open job. |
| the <b>Sleep</b> softkey | put the instrument into power-saving mode                      |
| <b>ESC</b>               | cancel the power-off process and return to the previous screen |

## Sleep mode

To put the instrument into sleep mode, do one of the following:

- In the Press **ENT** → OFF screen, press the **Sleep** softkey.
- Enable the Power Save setting. See also [Power saving, page 128](#).



The instrument wakes up if any of the following events occur:

- You press a button
- The instrument receives a remote control command
- You rotate the alidade
- You tilt the telescope

## Regional configuration

To provide easier configuration for common regional settings, you can quickly configure the Focus 6 2" total station to a pre-set combination of default regional settings. The *Regional Configuration* screen appears only after the language configuration is complete and the instrument has rebooted.

1. Follow the steps in [Others settings, page 129](#), to select the required language.

Once the instrument has rebooted the *Regional Configuration* screen appears.

2. Press **^** or **v** to highlight the required regional settings and then press **ENT**.
3. If you do not want to change the current settings, press **ESC** and quit. The instrument continues to use the last settings that were configured.



The settings affected by the *Regional Configuration* screen are:

| Category      | Setting        | Europe    | International | United States |
|---------------|----------------|-----------|---------------|---------------|
| Angle         | VA zero        | Zenith    | Zenith        | Zenith        |
|               | Resolution     | 1"        | 1"            | 1"            |
|               | HA             | Azimuth   | Azimuth       | Azimuth       |
| Distance      | Scale          | 1.000000  | 1.000000      | 1.000000      |
|               | T-P corr.      | On        | On            | On            |
|               | Sea Level      | Off       | Off           | Off           |
|               | C&R corr.      | 0.132     | 0.132         | 0.132         |
| Coordinates   | Order          | ENZ       | ENZ           | NEZ           |
|               | Label          | ENZ       | ENZ           | NEZ           |
|               | AZ zero        | North     | North         | North         |
| Power Save    | Main Unit      | Off       | Off           | Off           |
|               | Sleep          | 5 minutes | 5 minutes     | 5 minutes     |
| Communication | Ext. Comm      | Nikon     | Nikon         | Nikon         |
|               | Baud           | 4800      | 4800          | 4800          |
|               | Length         | 8         | 8             | 8             |
|               | Parity         | None      | None          | None          |
|               | Stop bit       | 1         | 1             | 1             |
| Stakeout      | Add PT         | 1000      | 1000          | 1000          |
| Units         | Angle          | GON       | DEG           | DEG           |
|               | Distance       | meters    | meters        | US-ft         |
|               | Temp           | °C        | °C            | °F            |
|               | Press          | mm Hg     | mm Hg         | In Hg         |
| Rec           | Store DB       | RAW&XYZ   | RAW&XYZ       | RAW&XYZ       |
|               | Data Rec       | Internal  | Internal      | Internal      |
| Others        | XYZ disp       | Fast      | Fast          | Fast          |
|               | 2nd Unit       | None      | None          | None          |
|               | Split ST       | No        | No            | No            |
|               | CD Input       | <ABC>     | <ABC>         | <ABC>         |
|               | Owner's Detail | Blank     | Blank         | Blank         |

The default regional configuration pre-set is "Europe" settings.


## List available jobs or data

The Focus 6 2" total station lists available jobs or data when you do any of the following:

- view or edit data (Press **[MENU]** then select **Data**)
- open the Job Manager (Press **[MENU]** then select **Jobs**)
- search for points or codes

The current cursor position is shown in inverted colors (it appears as white text on a black background).

Press  $\uparrow$  to move the cursor one line up, or press  $\downarrow$  to move the cursor one line down.

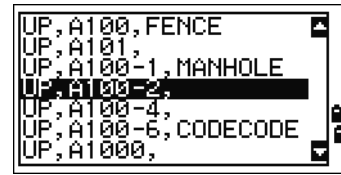

If the Page Up icon  $\blacktriangle$  appears, there are more pages before the current page. Press  $\leftarrow$  to move up one page.

If the Page Down icon  $\blacktriangledown$  appears, there are more pages after the current page. Press  $\rightarrow$  to move down one page.

To select an item from the list, move the cursor onto the item and press  $\boxed{\text{ENT}}$ .

## Entering data

You can enter the following into the Focus 6 2" total station:

- A point name or number, see [page 58](#)
- A code, see [page 61](#)

### Entering a point name or number

You can use numeric or alphanumeric names up to 20 characters long to identify points.

The default name for a new point is the last point name entered, with the last digit incremented. For example, if the last point name was A100, the default name for the next point is A101.

If the last character of the previous point name is alphabetic, the default point name is identical to the last point name.


When the cursor is in a PT (point) field, there are several ways to specify a point, or to enter coordinates. You can:

- Enter an existing point, see [page 59](#)
- Enter a new point, see [page 59](#)
- Press  $\boxed{\text{ENT}}$  without a point name, see [page 59](#)
- Specify a wildcard, see [page 59](#)
- Enter a point by recording an instant measurement, see [page 59](#)
- Enter a point from a point stack, see [page 60](#)
- Enter a point from the point list, see [page 61](#)

### Entering an existing point

When you enter a known point name or number, the coordinates of that point are briefly displayed. A short beep sounds before the next screen appears or the next field is selected.


To adjust the duration of the coordinate window display, press **MENU** then select **Settings** / **Others**. To leave the window open until you press **ENT**, set the *XYZ disp* field to +ENT. See also [page 124](#).

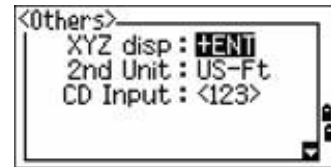

### Entering a new point

When you enter a new point name or number, a coordinate input screen appears. Enter the coordinates for the point in NE, NEZ, or elevation-only (Z) format.


To store the point in the current job, press **ENT** on the last line (the CD field).

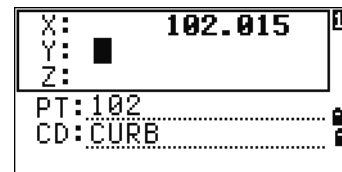

### Pressing **ENT** without a point name

To use a point without recording the coordinates, press **ENT** in a PT field, without entering a point name.

The input coordinates are used in the calculation but they are not saved in the database. The message **This PT will not be recorded** appears.

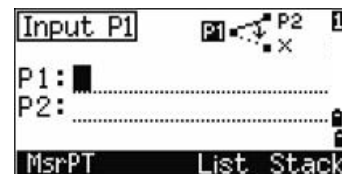


### Specifying a wildcard (\*)

If you include an asterisk ( for example, A100\*) when you enter a point or code name, a list of points that match the entered text appears.

Use **▲** or **▼** to move the cursor to the point that you want to use. Then press **ENT**.

If the Page Up **■** icon appears, you can use it to move up one page on the list. You can also use **◀**.


If the Page Down **■** icon appears, you can use it to move down one page. You can also use **▶**.

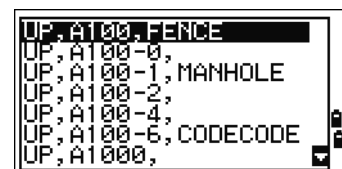

When you select a point from the list, its coordinates are displayed and a beep sounds.


### Entering a point by recording an instant measurement

1. Press the **MsrPT** softkey:  
An observation screen appears.
2. To start a measurement, press **MSR1** or **MSR2**.

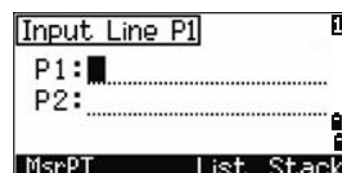


3. To change the height of the target, select the HT softkey.
4. When you have finished the measurement, press **ENT** to go to the point recording screen.
5. Enter the point or code name and then press **ENT**.

When you move the cursor to a field, the current or default value appears in inverted colors. (It appears as white text on a black background). This is the default Replace All input mode.

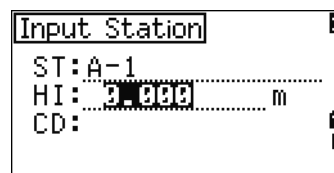


To change the input mode to Overwrite and highlight the first character, press **>**. To move the cursor to the end of the string, press **<**.

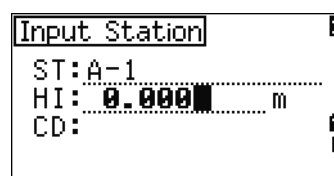


### Entering a point from the point stack

The point stack is a list of the last 20 point names used, in chronological order from last used to first used. To enter a point from the point stack:

1. Select the **Stack** softkey when the cursor is in the PT field. The stack appears.
2. Press **▲** or **▼** to move the cursor to the point that you want to use.
3. Press **ENT**.

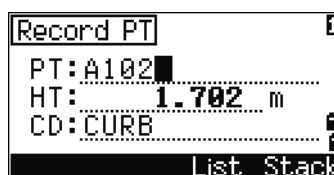


When you return to the point input screen, the selected point name is entered in the PT field, incremented by one. For example, if you selected the A101 point, A102 appears in the PT field.

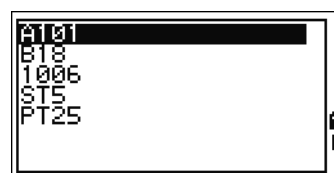

### Entering a point from the point list

1. Select the **List** softkey when the cursor is in the PT field. A list of existing points appears.
2. Press **▲** or **▼** to move the cursor to the point that you want to use.
3. Press **ENT**.

When you return to the point input screen, the selected point name is entered in the PT field. Add numeric or alphabetic characters if required.

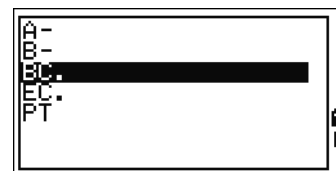

### Entering a code

The CD (Code) field defaults to the last code used. You can select a different code in the input point screen.


Codenames can be numeric or alphanumeric, and up to 16 characters long.

There are several ways to enter a code:

- Enter a code directly, see [page 61](#)
- Enter a code from the code stack, see [page 61](#)
- Enter a code from the code list, see [page 62](#)

### Entering a code directly

1. To change the input mode to alphanumeric or numeric, press **MODE**.
2. Use the keypad to enter the code.

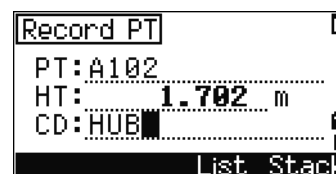


### Entering a code from the code stack

The code stack is a list of up to 20 recently used codes. When you reboot the Focus 6 2" total station, the code stack is cleared.

To enter a code from the code stack:

1. Select the **Stack** softkey when the cursor is in the CD field. The stack appears.
2. To move the cursor to the code that you want to use, press **▲** or **▼**.
3. Press **ENT**.

The selected code is copied to the CD field.

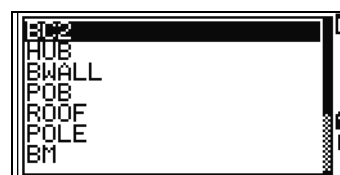


### Entering a code from the code list

1. Select the **List** softkey when the cursor is in the CD field. A list of existing codes appear.
2. Press **^** or **v** to highlight the feature code that you want to use.
3. Press **ENT**.

A layer has an arrow at the end of the code label. If you highlight a layer in the list and then press **ENT**, the codes and layers in that layer are displayed.


When you return to the input screen, the selected code is entered in the CD field.

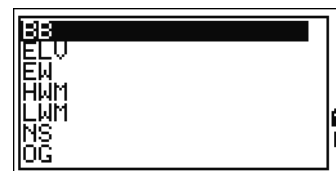

### Advanced feature: Searching for a code using the first character


Items are shown in alphabetic order. To find a code quickly when the code list appears, use the first-character search. For example, to see feature codes that begin with T, use the keypad to enter the letter T (press **T** twice).

After each button press, the input mode field displays the selected letter. For example, if you press **T**, **S** appears. If you quickly press **T** again, **T** appears. If you do not press the **T** button again, the letter T is selected.

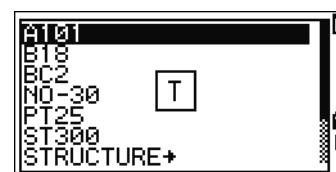


Once you select a letter, the cursor moves to the feature code beginning with that letter.

If there is no code beginning with that letter, the cursor moves to the next available letter.

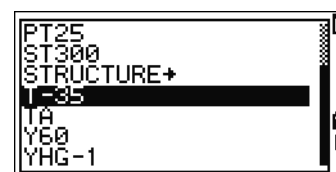

### Qcodes

Quick codes (Qcodes) let you shoot and record many points with feature codes in the field. You can register up to ten Quick codes. To register Qcodes, press the **Edit** softkey. For more information, see [Quick code measurement mode, page 49](#).

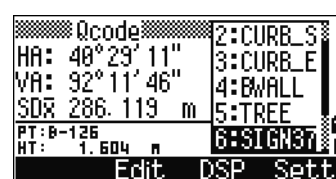

Press **MODE** to switch Qcodes on or off.

Press the **Edit** softkey to change the Qcode. You can edit the entire code, or just the number at the end of the code.

You can still use **DSP** to change the background displays.



Entering values in feet and inches


If US Survey Feet (US-Ft) or International Feet (I-Ft) is selected as the distance unit, you can enter and display distances, HIs, HTs, and coordinate values in decimal feet or in feet and inches. See also [Unit, page 128](#), and [Others settings, page 129](#).

To enter values in feet and inches in an input screen, enter the elements, separated by periods (.), in the following format:

<Feet> . <Inches> . <Numerator> . <Denominator> [ENT]  
(0–11) (0–15) (0–99)

The default denominator is 16. If the denominator is 16, you do not have to enter it, and it is not displayed on the screen.

For example, if you enter 2 . 08 . 5 [ENT], it appears as 2' 08" 5/ (2 feet, 8 and 5/16ths inches).

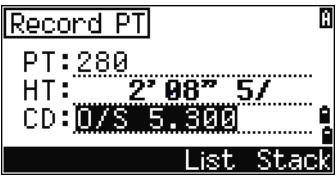

The following examples show how to enter various values:

| To enter... | Key in...  |
|-------------|--|
| 65' 5 3/8"  | [6][5][.][5][.][3][.][8][ENT]                      |
| 65'         | [6][5][ENT]  |
| 65' 5"      | [6][5][.][5][ENT]                                  |
| 65' 5 3/8"  | [6][5][.][5][.][6][ENT]                            |
| 5 3/8"      | [0][.][5][.][3][.][8][ENT] or [0][.][5][.][6][ENT] |

The numerator and denominator that you enter are automatically converted to the closest value from the following list: 0, 1/8, 1/4, 3/8, 1/2, 5/8, 3/4, 7/8, 1/16, 3/16, 5/16, 7/16, 9/16, 11/16, 13/16, 15/16.

If the denominator is 16, it is not shown on the screen.

Creating or opening a job

To record data on the Focus 6 2" total station, you must create or open a job.

**Note** – Before using the Focus 6 2" total station for the first time, check that you are using the required job settings.

Creating a new job

- 1. Press [MENU]. The MENU screen appears.
- 2. Press [1]. The Job Manager appears.

3. Select the **Cr eat** softkey. The Create Job screen appears.
4. Enter the job name.
5. To check the job settings, select the **Set t** softkey. You cannot change the settings for a job once you have created the job.
6. Press **ENT** in the last field of the Job Sett screen. The new job is created.





**Note** – You can have a maximum of only 32 jobs.

## Creating a control job

A control job, or common file, stores coordinate data that is used by several field jobs. To create a control job in the office:

1. Press **MENU**. The MENU screen appears.
2. Press **1** or select **Job**. The Job Manager appears.
3. Move the cursor to the job to use as the control job.
4. Select the **Ctrl** softkey.
5. Select the **Yes** softkey.

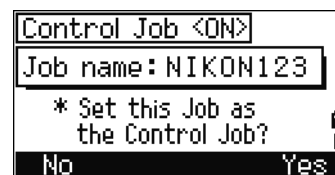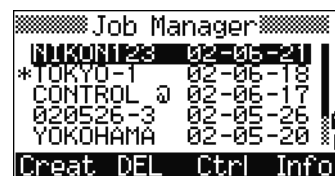

When you enter a point name or number, the system searches in the current job first. If the point is not found in the current job, the search is automatically extended to the control job. If the point is found in the control job, the selected point is copied to the current job as a UP record.

## Measuring distances



**WARNING** – Never look at the sun through the telescope. If you do, you may damage or lose your eyesight.



**WARNING** – Areas in which these lasers are used should be posted with an appropriate laser warning sign.



**WARNING** – Precautions should be taken to ensure that persons do not look directly, with or without an optical instrument, into the beam.



**WARNING** – The laser beam should be terminated at the end of its useful beam path and should in all cases be terminated if the hazardous beam path extends beyond the limit (**hazard distance**) of the area in which the presence and activities of personnel are monitored for reasons of protection from laser radiation.

The **hazard distance** is the distance from the laser at which beam irradiance or radiant exposure equals the maximum permissible value to which personnel may be exposed without being exposed to health risk.




**WARNING** – Laser beam path should be located well above or below eye level wherever practicable.



**WARNING** – **Do not** turn the class 3R laser beam to mirror like specular surfaces; for instance, prisms, metal surfaces or windows, even unintentionally. Special precautions should be taken to ensure eliminating such situations.

## Sighting a prism reflector

Sight the telescope until you see cross-hairs at the center of the prism reflector.

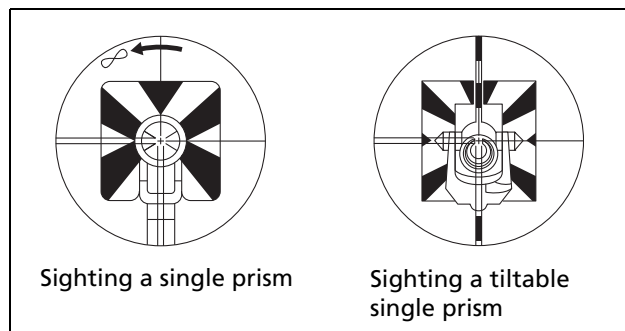

## Taking a distance measurement

To take a distance measurement, press **[MSR1]** or **[MSR2]** in the Basic Measurement Screen (BMS) or in any observation screen.

While the instrument is taking a measurement, the prism constant appears in a smaller font.


If the average count is set to 0, measurements are taken continuously until you press **[MSR1]**, **[MSR2]**, or **[ESC]**. Each time a measurement is taken, the distance is updated.

If the average count is set to a value from 1 to 99, the averaged distance appears after the last shot. The field name SD changes to SD $\bar{x}$  to indicate the averaged data.

If tracking is set to ON, measurements are taken continuously until you press **[MSR1]**, **[MSR2]**, or **[ESC]**. Each time a measurement is taken, the distance is updated.

|              |           |
|--------------|-----------|
| DSP          | 1/4       |
| HA:          | 40°29'11" |
| VA:          | 89°07'46" |
| SD $\bar{x}$ | 345.678 m |
| PT: 1        |           |
| HT:          | 1.500 m   |


To change the height of target (HT), temperature, or pressure, press **[HOT]**. See also **[HOT]** button, [page 51](#).

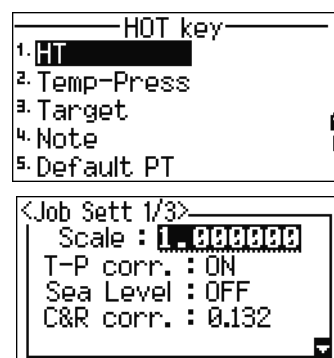

Settings that relate to corrections (T-P corr, Sea Level, C&R corr., and Map projection) are included in the job settings and are job-specific. To change any of these settings, you must create a new job. See also [Settings, page 124](#), and [Others settings, page 129](#).

## Viewing and changing the measurement settings


1. Hold down **[MSR1]** or **[MSR2]** for one second.
2. To move the cursor between the fields, press **[^]** or **[v]**.
3. To change the value in the selected field, press **[<]** or **[>]**.

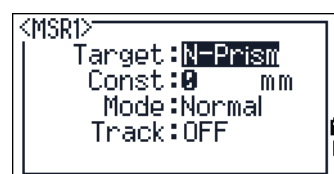


| Field                  | Values   |
|------------------------|--|
| Target                 | Prism<br>N-Prism   |
| Const (prism constant) | -999 mm through 999 mm   |
| Mode                   | Precise<br>Normal  |
| Ave (average count)    | 0 (continuous) through 99  |
| Rec mode               | <ul style="list-style-type: none"> <li>• MSR only</li> <li>• Confirm</li> <li>• All</li> </ul> |

## Target field


- If the measurement is started with the Target field set to Prism, there is a dash “-” in front of the prism constant.
- If the measurement is started with the Target field set to N-Prism, there is a right square bracket “]” in front of the prism constant.

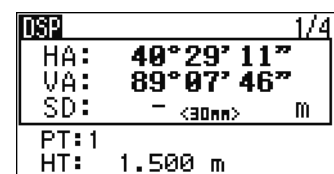

The symbol then continuously moves from left to right over the prism constant in the display.

When an N-prism measurement is taken, the  icon appears in the status bar (above the battery icon).

The Target setting is used by the Focus 6 2" total station to apply better cyclic-error adjustment in distance measurement. The target setting efficiently eliminates multipath reflection.

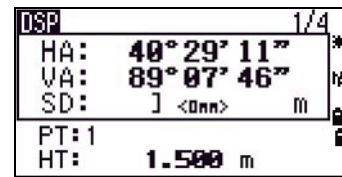

An incorrect Target setting may result in measurements outside the precision and intervals specified for the instrument.

If a prism target is aimed in N-prism mode, the warning message **Signal High! →Try Prism Mode** is displayed because of the excessive light reflection.

A measurement made immediately after changing the target setting may take longer than usual.



# Applications


**In this chapter:**

- HA reset and angle operations
- Station setup
- Stakeout
- Program key
- Recording measurement data
- Measuring offsets

This chapter describes the menu and display screens, and Focus 6 2" total station applications.

## HA reset and angle operations

To open the *Angle* menu, press **[ANG]** in the BMS. To select a command from this menu, either press the corresponding number key, or press **[←]** or **[→]** to highlight the command and then press **[ENT]**.

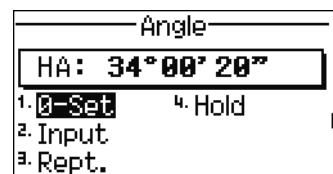

### Setting the horizontal angle to 0

To reset the horizontal angle to 0, press **[1]** or select **0-Set** in the Angle menu. The display returns to the Basic Measurement Screen (BMS).

### Entering the horizontal angle

To display the HA Input screen, press **[2]** or select **Input** in the Angle menu. Use the numeric keys to enter the horizontal angle. Then press **[ENT]**.

To enter 123°45'50", type **[1][2][3][.][4][5][5][0]**.


The displayed value is rounded to the minimum angle increment.



### Recording a foresight point after repeat angle measurement

1. To activate repeat angle measurement, press **[3]** or select **Rept.** in the Angle menu.


HR=0 appears.

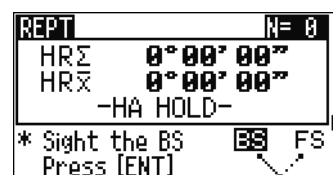

2. Sight the backsight and press **[ENT]**.


3. Sight the foresight and press **[ENT]**.

The horizontal angle is accumulated and the value is held again.

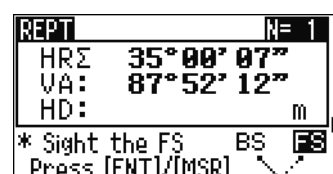


4. To end repeat angle measurement, press **[ESC]**.

5. When you have accumulated enough horizontal angle between the backsight and the foresight, press **[MSR1]** or **[MSR2]** to take a measurement to the foresight.

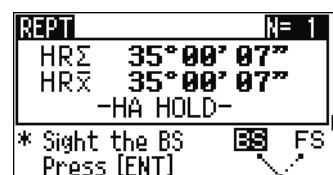

The averaged horizontal angle appears. This value is fixed until the process is finished or cancelled.

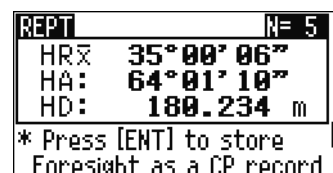

$$HR\bar{x} = HR\Sigma \div N$$

$$HA = BSAz + HR\bar{x} \text{ (normalized)}$$




HRx is not updated even if the instrument is moved.

6. Press **[ENT]** to store the foresight as a CP record. Check the PT, HT, and CD values. Then press **[ENT]** to record.

In repeat angle measurement, the HA is replaced by HRΣ. The number of repeat angles appears at the top of the screen (for example,  $N=5$ ).

Horizontal angles can be measured up to  $1999^{\circ}59'59''$ .

This function stores both raw and XYZ data as CP records, regardless of the Store DB setting.

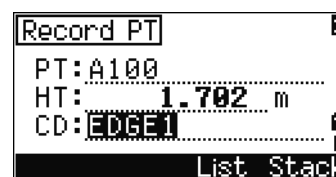


## Horizontal angle hold

To hold the horizontal angle to the current value, press **[5]** or select **Hold** in the Angle menu.

To set the horizontal angle to the displayed value, press **[ENT]** or the **Set** softkey.

To cancel the process and return to the Basic Measurement Screen (BMS), press **[ESC]** or the **Abort** softkey.


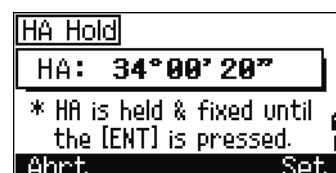


## Station setup

To open the Stn Setup menu, press **[STN]** in the BMS.


To select a command from this menu, press the corresponding number key. Alternatively, press **[<]** or **[>]** to highlight the command and then press **[ENT]**. Press **[^]** or **[v]** to move up or down one page.

The last function used is highlighted.

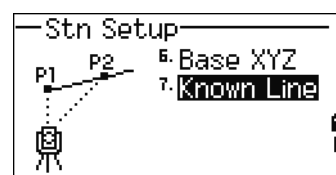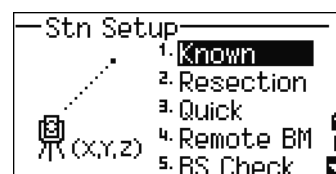

## Setting up a station with known coordinates or azimuth

1. Press **[1]** or select **Known** in the Stn Setup menu.
2. Enter a point name or number in the ST field.
  - If the input point number or name is an existing point, its coordinates are displayed and the cursor moves to the HI (Height of instrument) field.

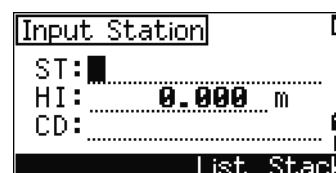

- If the point is new, a coordinate input screen appears. Enter the coordinates for the point. Press **ENT** after each field. When you press **ENT** in the CD field, the new point is stored.

|     |          |
|-----|----------|
| X:  | 4567.308 |
| Y:  | 200.146  |
| Z:  |          |
| PT: | A-123    |
| CD: | POT      |

- If the specified point has a code, the code appears in the CD field.

3. Enter the instrument height in the HI field and then press **ENT**.

|               |         |
|---------------|---------|
| Input Station |         |
| ST:           | A-123   |
| HI:           | 3.000 m |
| CD:           | POT     |


The Backsight screen appears.

4. Select an input method for defining the backsight point.

|           |           |
|-----------|-----------|
| Backsight |           |
| (XYZ)     | 1. Coord. |
|           | 2. Angle  |

- To sight the backsight by entering coordinates, see below.
- To sight the backsight by entering the azimuth and angle, see [page 73](#).

### Sighting the backsight by entering coordinates

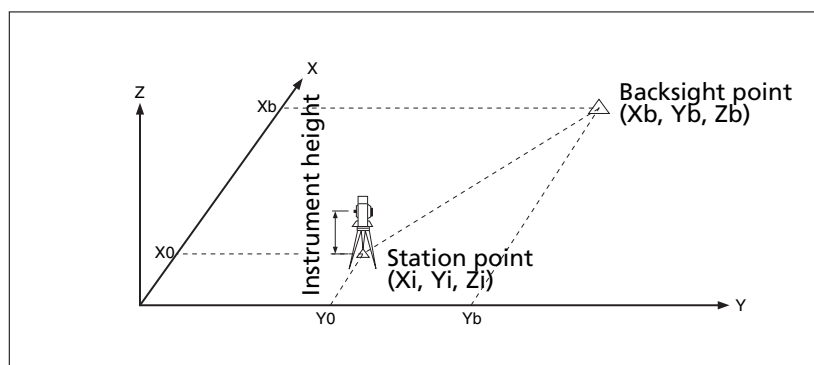


1. To enter coordinates for the backsight point (BS), press **1** or select **Coord** in the Backsight screen.
2. Enter the point name. If the point exists in the job, its coordinates are shown.
3. If you intend to take a distance measurement to the BS, enter the height of target in the HT field.

|                |         |
|----------------|---------|
| Input BS Point |         |
| BS:            |         |
| HT:            | 0.000 m |
| CD:            |         |
| List Stack     |         |



|                |         |
|----------------|---------|
| Input BS Point |         |
| BS:            | 462     |
| HT:            | 3.000 m |
| CD:            |         |
| Stack          |         |

4. Sight the BS. Press **[ENT]** to complete the setup.
  - To record a full shot (with HA, VA, and SD values) to the BS, press **[MSR1]** or **[MSR2]**.

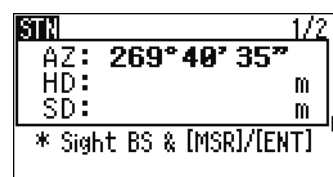


#### AZ Azimuth calculated by coordinates



- If you are measuring to a known coordinate BS, press **[DSP]** to display a QA screen. The QA screen shows the dHD and dVD values, which indicate the difference between the measured distance and the distance calculated from the known coordinates.
5. To record the station, press **[ENT]**.
  6. To finish the station setup after taking a distance measurement, press **[ENT]**. ST and F1 records are stored to the current job.

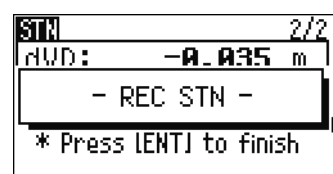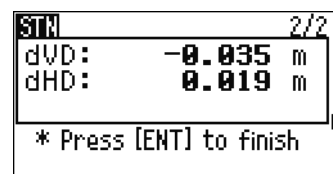

### Sighting the backsight by entering the azimuth angle

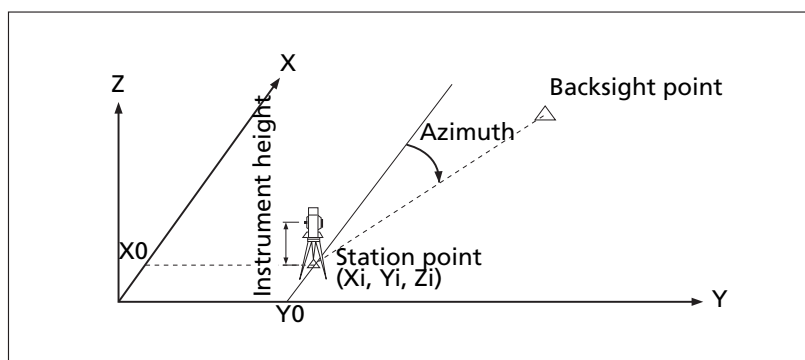

1. To enter the azimuth angle to the backsight point, press **[2]** or select **Angle** in the Backsight screen.
2. If there is no point name for the BS, press **[ENT]** on the BS field.

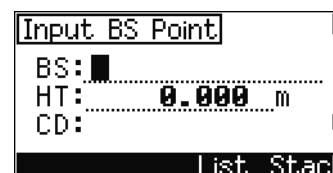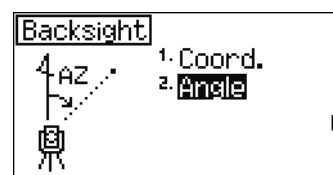

3. In the AZ field, enter the azimuth angle to the BS point.

If you press **[ENT]** without entering a value in the AZ field, the azimuth is automatically set to 0°00'00".


4. Sight the BS point and press **[ENT]**. ST and F1 records are stored in the job.

|                |         |
|----------------|---------|
| Input BS Angle |         |
| AZ:            | 269.403 |

|                          |            |
|--------------------------|------------|
| STN                      | 1/2        |
| AZ:                      | 269°40'35" |
| HD:                      | m          |
| SD:                      | m          |
| * Sight BS & [MSR]/[ENT] |            |

### Setting up a station using multiple point resection

A resection sets up the station using angle/distance measurements to known points.

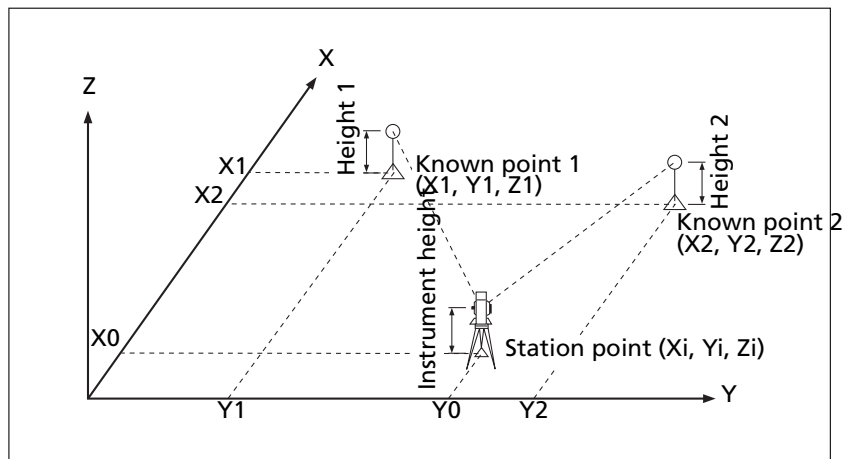

You can use a maximum of 10 points in a resection. Measurements can be distance and angle, or angle only. Calculation starts automatically when enough measurements are taken.








You can delete poor observations and recalculate if necessary. You can also select the BS point.

**Note** – If the angle between known point 1 and known point 2 (measured from the station point) is extremely acute or extremely oblique, the resulting solution will be less reliable geometrically. For geometric reliability, select known point locations (or station point locations) that are widely spaced.


1. To start the resection, press **[2]** or select **Resection** in the Stn Setup menu.
2. Enter the point name for the first observation point (PT1).
3. Enter the target height and press **[ENT]**.
4. Sight PT1 and press **[MSR1]** or **[MSR2]**.
5. To proceed to the next point, press **[ENT]**.
6. Enter the second point (PT2) and its height of target.
7. Measure to PT2 and press **[ENT]**.

When the instrument has enough data, it calculates the station (STN) coordinates.


- If more than the minimum required data is available, a standard deviation screen appears.
- To take measurements to strengthen geometry of the resection, press the **Add** softkey. For information about the **View** softkey, see [Advanced feature: Viewing and deleting a measurement in resection](#), page 76.

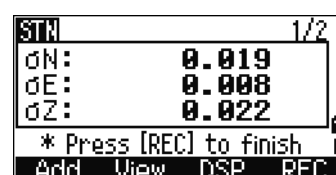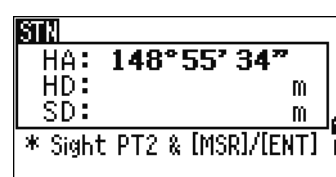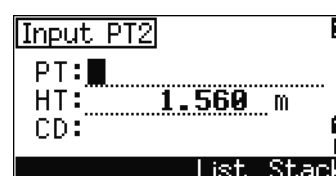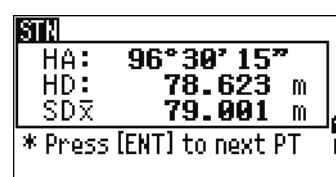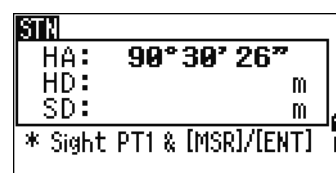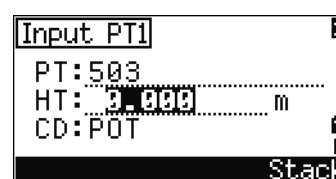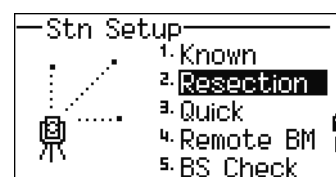

8. When the results are satisfactory, record the station. To do this, press **[ENT]** or the **REC** softkey.

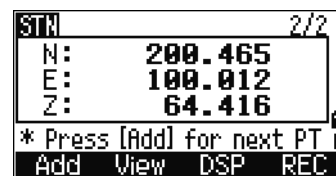


9. Enter the height of instrument, if required. Press **[ENT]**. The ST field defaults to the last recorded PT + 1.
10. To change the station name, move to the ST field and edit or replace the text.

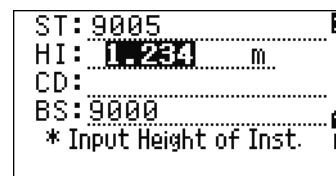


**Note** – If you have set *Split ST* to Yes, the ST field defaults to the last recorded ST value + 1. For more information, see [Others settings, page 129](#). BS defaults to the first observed point.


11. To change the BS, press the **Change** softkey.

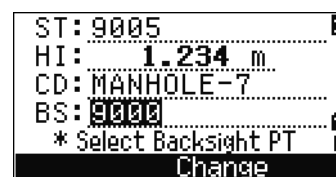

12. Select the BS point that you want to use and press **[ENT]**.

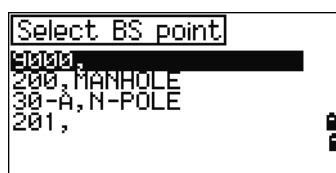

13. To finish the resection setup, move the cursor to the BS field and press **[ENT]**.

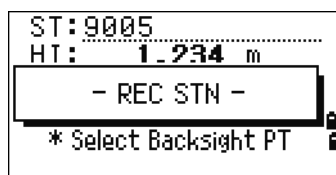

**Note** – The minimum data required for a resection is either three angle shots, or one angle shot and one distance shot. If you use a distance shot, the distance between the target points must be greater than the measured distance. Stn-Z is calculated from distance-measured data. If no distances are measured, then Stn-Z is calculated using angle-only measurements to points with 3D coordinates.

### Advanced feature: Viewing and deleting a measurement in resection

To check the measurements to each known point, press the **View** softkey on the calculated STN (sigma or coordinate) screen.



|     |   |
|-----|---|
| dHA | Distributed HA errors in each direction                     |
| dVD | VD errors between measured distance and calculated distance |
| dHD | HD errors between measured distance and calculated distance |

To delete a measurement (because of large sigma values, for example), highlight the measurement data or display the detail screen for the measurement. Then press the **DEL** softkey. The STN coordinates are automatically recalculated.

To continue resection observations, press the **Add** softkey. The input screen for the next PT appears.

## Setting up the station quickly without coordinates

The station point (ST) in this function defaults to a new point number. For the new point, MP (0, 0, 0) is stored as the coordinates. When the ST is manually changed to a known point name, the station is set up on the coordinates of the known point.

1. To enter Quick Station setup, press **[3]** or select **Quick** in the Stn Setup menu.

|    |  |
|----|--|
| ST | Station point (defaults to the last recorded PT + 1, or ST + 1, depending on the Split ST setting) |
| HI | Height of instrument   |
| BS | Backsight point (blank)  |
| AZ | Backsight azimuth (defaults to zero)   |





2. No default PT is assigned to the BS. Leave this field blank, or enter a BS point name.
3. The backsight azimuth (AZ) defaults to zero, but you can change this.
4. To complete the station setup, sight the BS and press **[ENT]**.

When you press **[ENT]** in the AZ field, both HA and AZ are reset to the value you have entered.

**Note** – Even if both ST and BS are known points, this function does not calculate the backsight angle (AZ) automatically. To calculate the AZ between two known points (ST and BS), use Station Setup > Known. For more information, see [Setting up a station with known coordinates or azimuth, page 71](#).

## Determining station elevation


1. Press **[4]** or select Remote BM in the Stn Setup menu.
2. Enter the BM point and press **[ENT]**. When the point is found, it appears briefly. The cursor then moves to the HT field.
3. Enter the HT and press **[ENT]**.
4. Sight the BM point and press **[MSR1]** or **[MSR2]**.

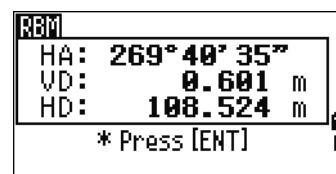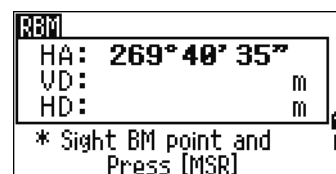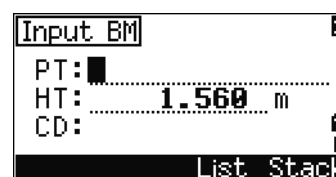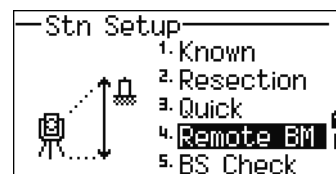

The updated station coordinates are displayed.  
You can change the HI in this screen.

5. To record the updated STN, press **[ENT]**.

**Note** – When the HI is changed, the Z coordinate is updated before the station is recorded. You must complete a station setup before you use the Remote Benchmark function.

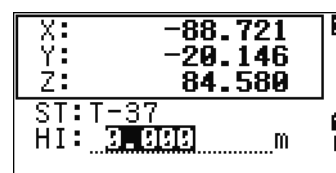




## Checking and resetting the backsight direction

You must complete a station setup before you use the BS check function.


This function always refers to the backsight point from the last ST record stored in the current open job.

1. To enter the backsight (BS) check function, press **[5]** or select **BS Check** in the Stn Setup menu.

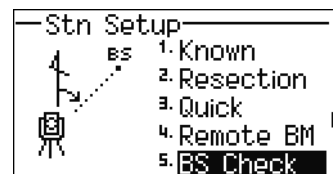

HA Current HA reading

BS The HA to the BS in the last station setup. Enter station coordinates for observations without recording data.

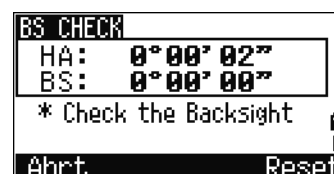

2. Do one of the following:
  - To reset the horizontal angle to the HA set in the last station setup sight the BS and press the **Reset** softkey or press **[ENT]**.
  - To cancel the process and return to the BMS, press the **Abt** softkey or press **[ESC]**.


## Base XYZ function

Base XYZ does not store a ST record, so the BS Check cannot check the backsight when you enter a station using Base XYZ.


To store raw data, use one of the other functions in the Stn Setup menu. This function does not store an ST record in the job.

You can use this function without an open job. If there is an open job when you use this function, a CO record is stored to indicate that the instrument's base coordinates have changed.

1. To enter the Base XYZ function, press **[6]** or select **Base XYZ** in the Stn Setup menu.

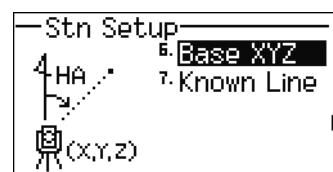

The current instrument XYZ values are shown as the default.

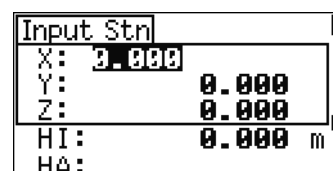

2. Enter the new instrument XYZ values and press **[ENT]**.
3. Do one of the following:
  - To reset the horizontal angle, enter a value in the HA field and press **[ENT]**.
  - If you do not need to reset the HA, leave the HA field blank and press **[ENT]**.

The display returns to the BMS.

|           |         |
|-----------|---------|
| Input Stn |         |
| X:        | 500.000 |
| Y:        | 600.000 |
| Z:        | 0.000   |
| HI:       | 1.836 m |
| HA:       |         |

## Two-point resection along a known line

1. To enter the Known Line function, press **[7]** or select **Known Line** in the Stn Setup menu.

|               |    |
|---------------|----|
| Stn Setup     |    |
| P1            | P2 |
| 5. Base XYZ   |    |
| 7. Known Line |    |

2. Enter a known point as P1.

If you enter a new point name, a coordinate input screen appears.

|            |         |
|------------|---------|
| Input P1   |         |
| P1:        |         |
| HT:        | 0.000 m |
| CD:        |         |
| List Stack |         |

Sight P1 and press **[MSR1]** or **[MSR2]** to take a measurement. Press **[ENT]**.

|                          |           |
|--------------------------|-----------|
| STN                      |           |
| HA:                      | 96°30'15" |
| HD:                      | 78.623 m  |
| SD:                      | 79.001 m  |
| * Press [ENT] to next PT |           |

3. Choose how you want to define a known line:

- To define the line by entering P2 coordinates, press **[1]** or select **By Coord.**
- To define the line by entering the azimuth, press **[2]** or select **By Angle**.

|          |              |
|----------|--------------|
| Input P2 |              |
| 4. AZ    | 1. By Coord. |
| P2       | 2. By Angle  |

4. If you select **By Angle**, the azimuth input screen appears. Enter the angle value and press **[ENT]**.

|                         |         |
|-------------------------|---------|
| Input Angle             |         |
| AZ:                     | 269.403 |
| * Azimuth of P1-P2 Line |         |


A measurement screen appears.

5. Sight P2 and press **[MSR1]** or **[MSR2]** to take a measurement. Press **[ENT]**.


|                           |            |
|---------------------------|------------|
| STN                       |            |
| HA:                       | 148°55'34" |
| HD:                       | m          |
| SD:                       | m          |
| * Sight PT2 & Press [MSR] |            |

After the measurement to P2 is completed, the coordinates of the station are calculated.

6. To record the station, press **[ENT]** or the **REC** softkey.



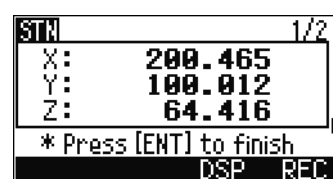


7. To check your measurement, press the **DSP** softkey. If you defined the line by entering its azimuth, HD and VD between P1 and P2 are displayed.

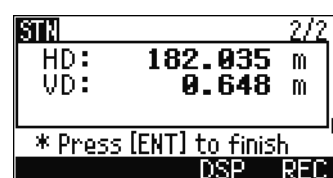

If you defined the line by entering the P2 coordinates, the difference of HD (dHD) and VD (dZ) between your measurement data and input coordinate data are displayed.


8. Enter the station name, the height of instrument (HI), and a feature code (CD) if required. The station name defaults to the last recorded PT + 1, or last recorded ST + 1, depending on the Split ST setting.
9. Backsight (BS) defaults to the first point (P1). To change it, highlight the BS field and then press the **Change** softkey.
10. To finish the setup and record the station, press **[ENT]** in the BS field.

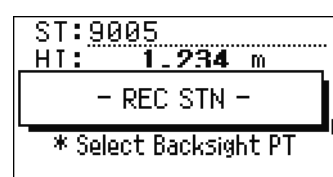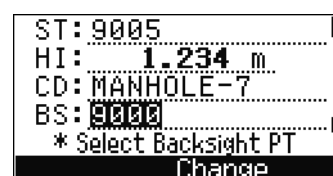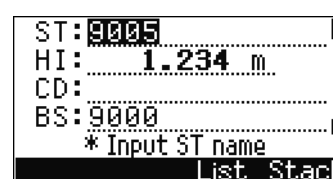


### Sample records

CO, Temperature:20C Pressure:1013hPa Prism:0 ...  
 ST,9005, ,265, ,1.2350,150.40300,150.40300  
 F1,265,1.6040,79.0010,90.30150,89.35260,  
 F1,200,1.4590,50.2300,269.4035,93.50110,  
 CO, P1-P2 HD=122.0350 VD=0.5600

## Stakeout

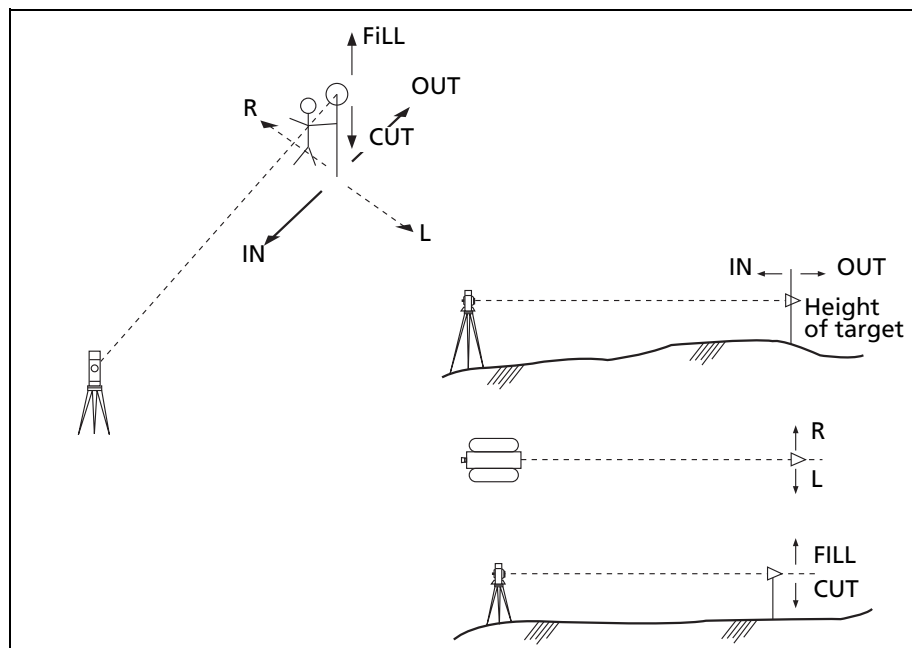


To display the Stakeout menu, press **[S-O]**.

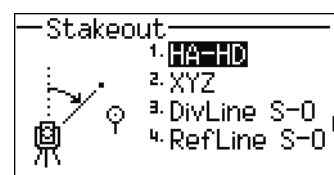

### Specifying the stakeout point by angle and distance

1. To display the input screen for the distance and angle to the target, press **[1]** or select **HA-HD** in the Stakeout menu.
2. Enter the values and press **[ENT]**.


HD      Horizontal distance from station point to stakeout point  
 dVD    Vertical distance from station point to stakeout point  
 HA      Horizontal angle to stakeout point

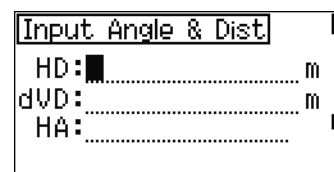


**Note** – If you press **[ENT]** without entering HA, the current HA is used.

3. Rotate the instrument until the dHA is close to 0°00'00".
4. Sight the target and press [MSR1] or [MSR2].

When the measurement is completed, the differences between the target position and the stakeout point are displayed.

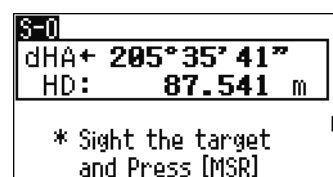

|          |  |
|----------|--|
| dHA      | Difference in horizontal angle to the target point |
| R/L      | Right/Left (Lateral error)                         |
| IN/OUT   | In/Out (Longitudinal error)                        |
| CUT/FILL | Cut/Fill   |

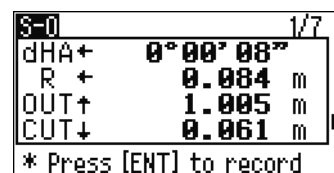

Once a measurement is taken, the Cut/Fill value and Z coordinate are updated as the VA is changed.

If you press [HOT] in any observation screen, the HOT key menu appears. You can use this menu at any time to change HT and T-P.



### Using [DSP] to switch between display screens

Press [DSP] to switch between the Stakeout display screens. The following screens are available:

|                 |                 |                 |                 |
|-----------------|-----------------|-----------------|-----------------|
| <b>S-01</b><br> | <b>S-02</b><br> | <b>S-03</b><br> | <b>S-04</b><br> |
| <b>S-05</b><br> | <b>S-06</b><br> | <b>S-07</b><br> | <b>S-08</b><br> |

The S-08 screen is only available if the secondary distance unit is set. For more information, see [Others settings, page 129](#).



Every time you press [DSP], the next screen appears. If you press [DSP] in the last screen (S-07, or S-08 if the secondary distance unit is set), the S-01 screen appears.

To customize the S-02, S-03, and S-04 screens, hold down [DSP] for one second. For more information, see [Customizing items in the Basic Measurement Screen \(BMS\), page 48](#).

To record the stakeout point, press **[ENT]**. PT defaults to the last recorded PT+1.


Press **[ENT]** to record the point.

After recording the point, it returns to the observation screen. You can continue observation, or press **[ESC]** to input another angle and distance for stakeout.

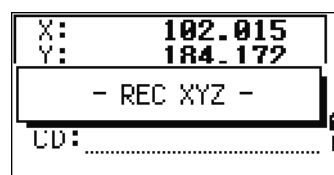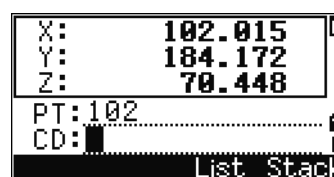


## Specifying the stakeout point by coordinates

1. To start a stakeout by coordinates, press **[2]** or select XYZ in the Stakeout menu.

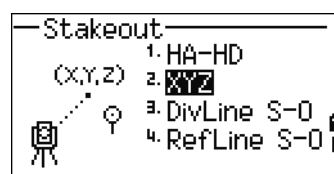

2. Enter the point name that you want to stake and press **[ENT]**.

You can also specify the point by code or radius from the instrument.

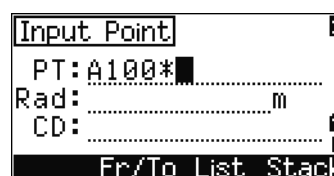


If several points are found, they are displayed in a list. Use **[↑]** or **[↓]** to move up and down the list. Use **[←]** or **[→]** to move up or down one page.



3. Highlight a point in the list and press **[ENT]**.

The delta angle and the distance to the target are shown.

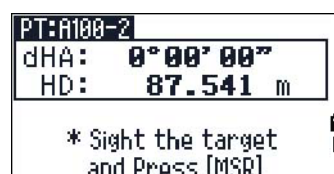


4. Rotate the instrument until the dHA is close to 0°00'00". Press **[MSR1]** or **[MSR2]**.

dHA            Difference in horizontal angle to the target point

HD             Distance to the target point

5. Ask the rodman to adjust the target position. When the target is on the intended position, the displayed errors become 0.000 m (or 0.000 ft).

|          |  |
|----------|--|
| dHA      | Difference in horizontal angle to the target point |
| R/L      | Right/Left (Lateral error)                         |
| IN/OUT   | In/Out (Longitudinal error)                        |
| CUT/FILL | Cut/Fill   |

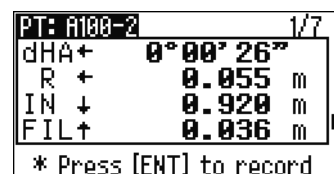


PT: A100-2 1/7  
dHA+ 0°00'26"  
R+ 0.055 m  
IN+ 0.920 m  
FIL+ 0.036 m  
\* Press [ENT] to record

To switch between display screens, press [DSP]. This function works as in the angle-distance stakeout, except that the screen counter (for example, S-01/8) is not displayed. For more information, see [Using \[DSP\] to switch between display screens, page 83](#).

Once a measurement is taken, the Cut/Fill value and Z coordinate are updated as the VA is changed.


6. To record the point, press [ENT]. PT defaults to the specified PT + 1000.

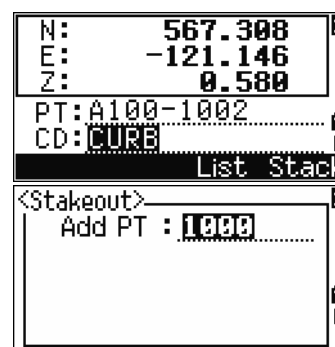

N: 567.308  
E: -121.146  
Z: 0.580  
PT: A100-1002  
CD: CURB  
List Stack  
<Stakeout>  
Add PT : 1000


Use the Add Constant field in MENU > Settings > Stakeout to specify an integer that is added to the point number being staked to generate a new number for recording the staked point. The default value is 1000. For example, when you stake out PT3 with an Add Constant of 1000, the default number for SO record is 1003. For more information, see [Stakeout, page 128](#).

After recording the point, the display returns to the observation screen. When you press [ESC], the display returns to the PT/CD/R input screen. If you entered the stakeout point using a single point name, the PT defaults to the last PT + 1.

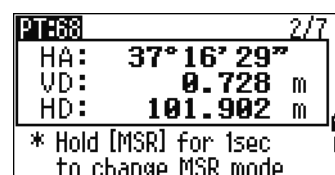

PT: 00 2/7  
HA: 37°16'29"  
VD: 0.728 m  
HD: 101.902 m  
\* Hold [MSR] for 1sec to change MSR mode

If you selected a point from the list, the display returns to the list, unless all points have been selected. Press [ESC] to return to the point input screen.

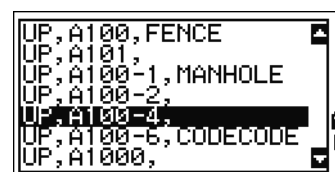

UP, A100, FENCE  
UP, A101  
UP, A100-1, MANHOLE  
UP, A100-2  
UP, A100-4  
UP, A100-6, CODECODE  
UP, A1000

### Advanced feature: Specifying a stakeout list by range input

1. To input points by range, press the **Fr/To** softkey in the PT field.
2. Enter the start point (Fr) and the end point (To). The range between Fr and To must be less than 1001 points.

If existing points are found between Fr and To, a point list appears.

To highlight a point, press **▲** or **▼**. To go to the stakeout observation screen, press **ENT**.

If you have assigned a control job, and additional points are found in the control job, the **Ctrl** softkey appears under the list.

### DivLine S-0

This function divides the line between the instrument and the first target by an input span number. It then guides you to stake out the points, one by one.

1. Press **3** or select **DivLine S-0** in the Stakeout menu.
2. Set up the baseline. To do this, sight the target on the line (the end point) and press **[MSR1]** or **[MSR2]**.
3. Enter the total stake number in the Span total field.



The observation screen for the first stake (from the instrument) appears.


4. Sight the prism and press **[MSR1]** or **[MSR2]**.
5. Use **[^]** or **[v]** to change the guide point. You can calculate and guide up to double the number of the stakes.
6. To record the point as an SO record, press **[ENT]**.

```
LineS-0 <1/4>
HD: 10.065 m
L + 0.156 m
In + 0.340 m
* [↓] = Go to next nail
  [↑] = Back to prev nail
```

```
LineS-0 <2/4>
HD: 20.130 m
L + 0.150 m
Out + 10.405 m
* [↓] → Go to next nail
  [↑] → Back to prev nail
```

```
X: 102.015
Y: 184.172
Z: 70.448
PT: 102
CD: CURB
List Stack
```

For example, if you measure to the end point at 100 m from the instrument and set the span total to 2, the following four points are calculated and can be staked:

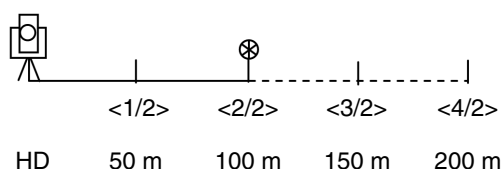

## RefLine S-0

This function allows you to stake out a point based on the Sta, O/S, and dZ to a specified line.

1. Press **[4]** or select **RefLine S-0** in the Stakeout menu.

```
—Stakeout—
1. HA-HD
2. XYZ
3. DivLine S-0
4. RefLine S-0
```

2. Enter the first point (P1) of the line.

```
Input Line P1
P1: 
P2: 
MsrPT List Stack
```

If you press **[ENT]** without entering a PT name, you can enter temporary coordinates which are not recorded in the job.

Alternatively, press the **MSR** softkey to measure a point.

```
N: 200.308
E: -100.552
Z: 69.520
* This PT will not
  be recorded
```

3. Enter the second point (P2) of the line.

4. Enter offsets to the line.

Press **[ENT]** in a blank field to enter the value 0.0000.

- Sta Distance from P1 along the line  
 O/S Distance perpendicular to the line  
 (+) Right side of the P1-P2 line  
 (-) Left side of the P1-P2 line  
 dZ Difference in height from the line

5. Rotate the instrument until the dHA is close to 0°00'00".  
 6. Sight the target and press **[MSR1]** or **[MSR2]**.

When a distance measurement is taken, the difference from the design point appears.

7. To record the point as an SO record, press **[ENT]**.

### Using **[DSP]** to switch between display screens


You can use **[DSP]** to switch between display screens. This function works as in the angle-distance stakeout. For more information, see [Using \*\*\[DSP\]\*\* to switch between display screens, page 83](#).

## Program key


To display the Programs menu, press **[PRG]**.

### Measuring distance and offset values along a specified line

1. Press **[1]** or select 2Pt RefLine in the Programs menu.

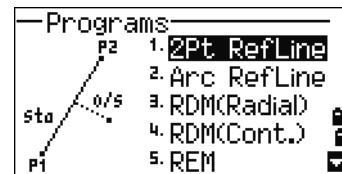

2. Enter the first point for the reference line.  
Alternatively (to enter the point by measuring), press the **MsrPT** softkey.

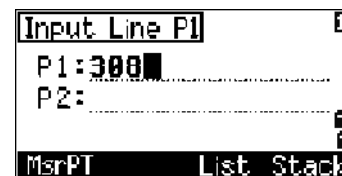


### Direct Measurement screen


Press the **MsrPT** softkey to display a direct measurement screen.

Sight the target and press **[MSR1]** or **[MSR2]**. The Record PT screen appears.



If you press **[ESC]** in the Record PT screen, the measured point is used but not recorded in the job.

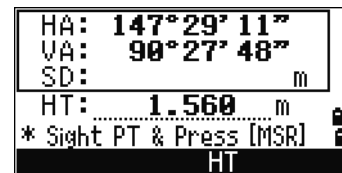

3. Enter the second point for the reference line.

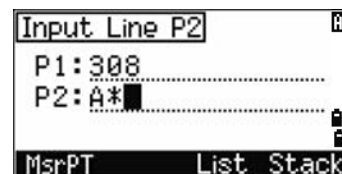

4. Enter an asterisk (\*) in the PT field to perform a wildcard search. A list of matching points appears. Highlight a point in the list and then press **[ENT]**.

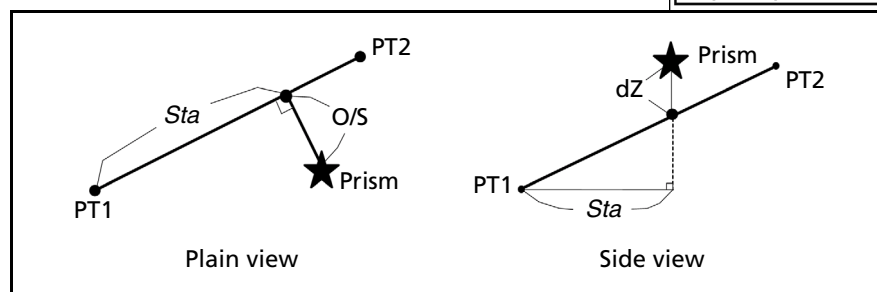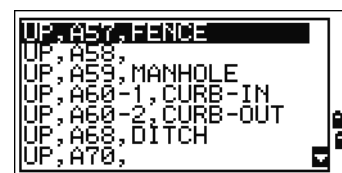

5. Sight the prism or reflective sheet and press **[MSR1]** or **[MSR2]**.

**Sta** Horizontal distance from P1 to the measure point along the P1-P2 line

**O/S** Horizontal offset from the P1-P2 line to the measured point

**dZ** Vertical offset from the P1-P2 line to the measured point

```

REF 1/4
Sta:  -0.214 m
O/S:   3.502 m
dZ:    0.020 m
* Press [ENT] to record

```

### Using **[DSP]** to switch between display screens

Press **[DSP]** to switch between the Stakeout display screens. The following screens are available:

#### REF1

```

Sta
O/S
dZ

```

#### REF2

```

X
Y
Z

```

#### REF3

```

HA
VA
SD

```

#### REF4

```

HA
VD
HD

```

#### REF5

```

HD
VD
SD

```

The REF5 screen is only available if the secondary distance unit is set. For more information, see [Others settings, page 129](#).

Every time you press **[DSP]**, the next screen appears. If you press **[DSP]** in the last screen (REF4 or REF5), the REF1 screen appears.

To store the point and its offset distance information, press **[ENT]**.

Enter the point name and feature code.

You can also use this screen to change the HT value.

```

Record PT 1
PT: A102
HT: 1.702 m
CD: HUB
List Stack

```

### Sample records




CO, 2pt-Ref Pt:16 & Pt:13 Az:311.2932

CO, Sta= -12.6876 Offset= 1.3721 dZ= 0.0971


SS,17,1.0000,6.9202,18.4700,80.3120,15:48:48,2REF-LINE

## Measuring distance and offset values on the arc-curve




1. Press **[2]** or select **Arc RefLine** in the Programs menu.
2. Enter the start of the curve point (P1) and the azimuth of its tangent line (AZ1).
3. To enter P1 by direct measurement, press the MSR softkey.
4. Choose a method to define the arc.

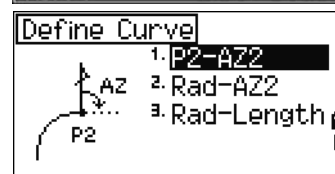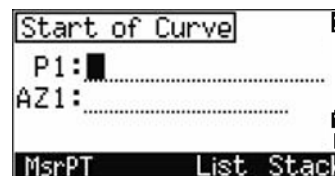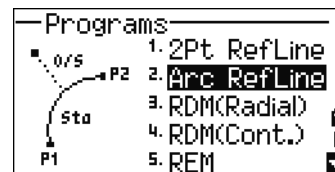

P2 can be any point on the tangent line that is to exit the curve.

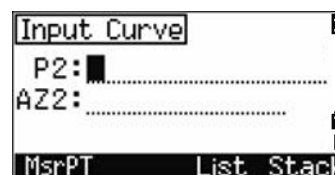

5. In the radius (Rad) field, enter a positive value for a clockwise curve. Enter a negative value for a counterclockwise curve.

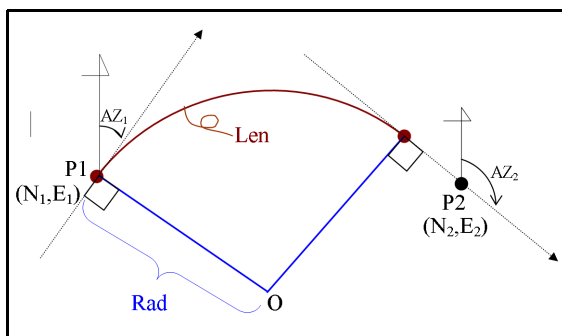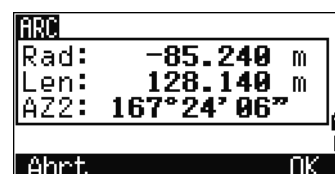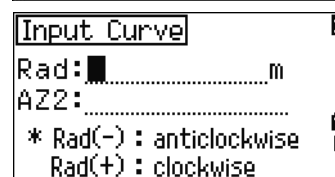

When all factors have been entered, the instrument calculates the curve.

If the curve length (Len) is too large for a circle of the given radius, it is shortened.

| To ...                         | Press ... |
|--------------------------------|-----------|
| switch between display screens | [DSP]     |
| change HT                      | [HOT]     |
| record points                  | [ENT]     |

```

ARC 1/4
Sta:  -0.214 m
O/S:  3.502 m
dZ:   0.020 m
* Press [ENT] to record

```

### Using [DSP] to switch between display screens

Press [DSP] to switch between the Stakeout display screens. The following screens are available:

|  |   |  |  |
|--|---|--|--|
| <b>ARC1</b><br><div>Sta<br/>O/S<br/>dZ</div> | <b>ARC2</b><br><div>X<br/>Y<br/>Z</div> | <b>ARC3</b><br><div>HA<br/>VA<br/>SD</div> | <b>ARC4</b><br><div>HA<br/>VD<br/>HD</div> |
| <b>ARC5</b><br><div>HD<br/>VD<br/>SD</div>   |   |  |  |

The ARC5 screen is only available if the secondary distance unit is set. For more information, see [Others settings, page 129](#).

Every time you press [DSP], the next screen appears. If you press [DSP] in the last screen (ARC4 or ARC5), the ARC1 screen appears.

To record the point, press [ENT] on any observation screen. The arc is stored in comment records.

```

Record PT 1
PT: 208
HT: 1.702 m
CD: HUB
List Stack

```

### Sample records


```

CO,Arc P1:583 AZ1=0.0000 P2:102
CO, AZ2=311.2932 Radius=50.0000 Length=125.6637
CO, Sta= -12.6876 Offset= 1.3721 dZ= 0.0971
SS,17,1.0000,6.9202,18.4700,80.3120,15:48:48,2REF-LINE

```

## Remote distance measurement



This function measures the horizontal distance, vertical distance, and slope distance between two points.

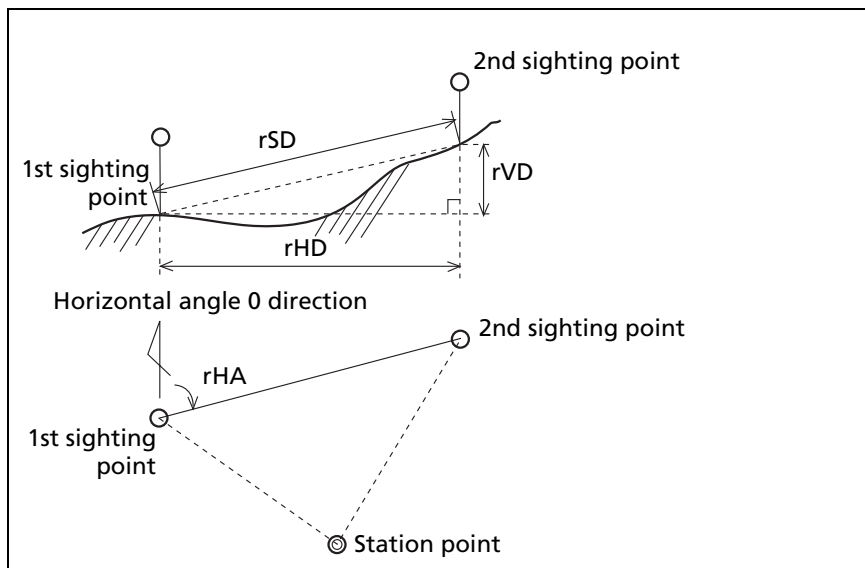


- rSD      Slope distance between two points
- rHD      Horizontal distance between two points
- rVD      Vertical distance between two points
- rV%      Percentage of grade ( $rVD/rHD \times 100\%$ )
- rGD      Vertical grade ( $rHD/rVD$ ) :1
- rAZ      Azimuth from first point to second point

## Measuring between the current and the first point measured

- To enter the RDM (Radial) function, press **[3]** or select RDM(Radial) in the Programs menu.
- Sight the first point and press **[MSR1]** or **[MSR2]**.

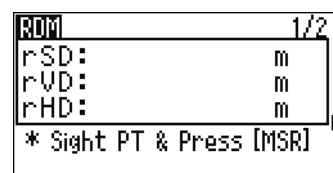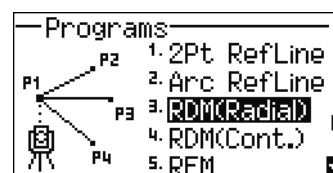

The distance from the station point to the first point appears.

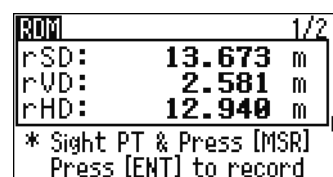


3. Sight the second point and press **[MSR1]** or **[MSR2]**. The distances between the first and second point are displayed.


rSD      Slope distance between two points  
 rVD      Vertical distance between two points  
 rHD      Horizontal distance between two points

4. To change display screens, press **[DSP]**.


rAZ      Azimuth from first point to second point  
 rV%      Percentage of grade (rVD/rHD) × 100%  
 rGD      Vertical grade (rHD/rVD) :1

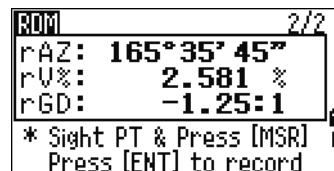

5. To record the distance and angle information as a comment record, press **[ENT]** in the 1/2 or 2/2 observation screen.

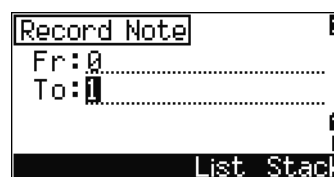


Default point numbers are displayed. You can change these point numbers. To record a note, press **[ENT]** in the To field.

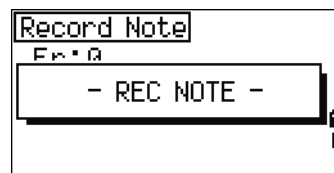


**Note** – Data that you save in RDM functions is stored in RM records. For more information, see [RM records, page 133](#). When you download data in Nikon RAW format, they are output as comment (CO) records.

### Measuring between the current point and the immediately preceding point


1. To enter the RDM (Continuous) function, press **[4]** or select **RDM(Cont.)** in the Programs menu.
2. Follow the procedure as for a radial RDM measurement. For more information, see [Measuring between the current and the first point measured, page 93](#).

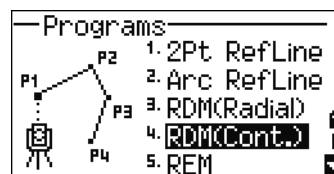






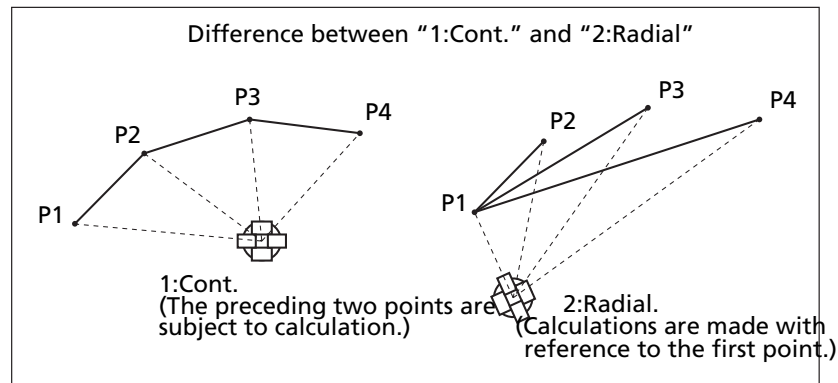

## Measuring remote elevation

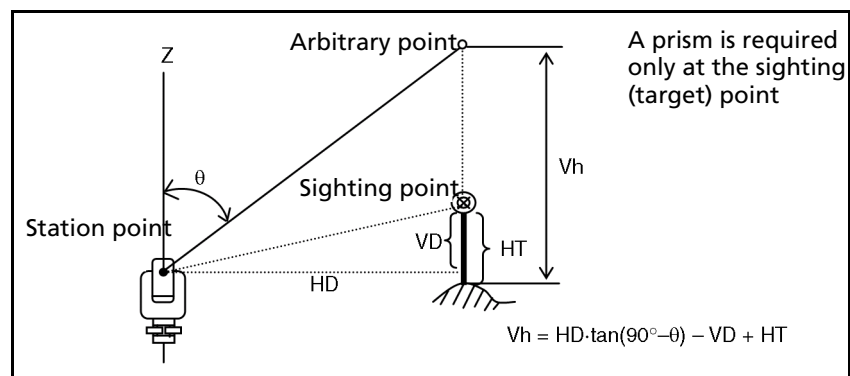

1. To enter the Remote Elevation Measurement function, press **[5]** or select **REM** in the Programs menu.
2. Enter the height of target.
3. Sight the target point and press **[MSR1]** or **[MSR2]**.

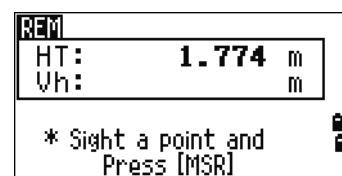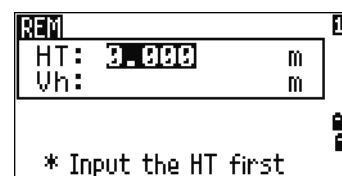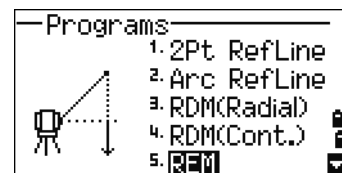


- Loosen the vertical clamp, and turn the telescope to aim at an arbitrary point.

The difference in elevation ( $V_h$ ) appears.

**Note** – You can use an REM measurement to update the height of target. Take a measurement to the prism, sight the bottom of the prism pole, and press [ENT].

|   |         |
|---|---------|
| REM   |         |
| HT:   | 1.774 m |
| Vh:   | 2.075 m |
| * Press [ENT] to update<br>Height of Target |         |

## Measuring distance and offset values on the vertical plane

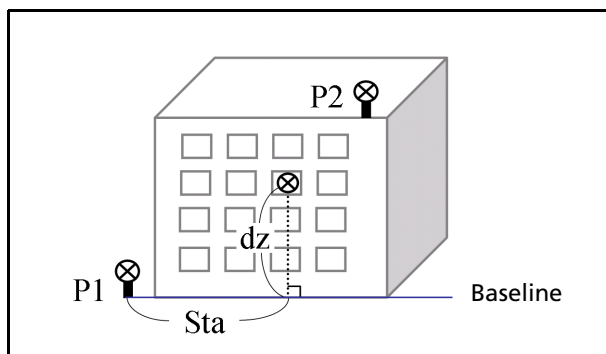

- To enter the 2-Pt Reference Plane function, press [6] or select U-Plane in the Programs menu.

|            |            |
|------------|------------|
| Programs   |            |
| 5. U-Plane | 7. S-Plane |
| P1 P2      |            |

- Enter two points to define the plane.

To enter the point by direct measurement, press the MsrPT softkey.

|                |            |
|----------------|------------|
| Input Plane P1 |            |
| P1:            |            |
| P2:            |            |
| MsrPT          | List Stack |

When you press the MSR softkey, a temporary observation screen appears.

- Press [MSR1] or [MSR2]. The Record PT screen appears.

|                          |            |
|--------------------------|------------|
| HA:                      | 147°29'11" |
| VA:                      | 90°27'48"  |
| SD:                      | m          |
| HT:                      | 1.555 m    |
| * Sight PT & Press [MSR] |            |
| HT                       |            |

- Enter a value in the PT and CD fields. Press [ENT].

|            |          |
|------------|----------|
| N:         | 567.308  |
| E:         | -121.146 |
| Z:         | 0.580    |
| PT:        | 56       |
| CD:        | CURB     |
| List Stack |          |

5. Enter the second point on the vertical plane. Press **[ENT]**.

Once the plane is defined, the calculated Sta and dZ values are updated as you move the telescope. No distance measurement is required.

**Sta** Horizontal distance from P1 to the target point along the baseline  
**dZ** Vertical distance from P1 to the target point

Input Plane P2

P1: 56  
P2: [blank]

MsrPT List Stack

V-PLN 1/3

Sta: 55.261 m  
dZ: -3.047 m

\* Sta: Distance from P1 along the P1-P2 Line

### Using **[DSP]** to switch between display screens

Press **[DSP]** to switch between the plane display screens. The following screens are available:

| PLN1      | PLN2        | PLN3     |
|-----------|-------------|----------|
| Sta<br>dZ | X<br>Y<br>Z | HA<br>VA |

Every time you press **[DSP]**, the next screen appears. If you press **[DSP]** in the last screen (PLN3), the PLN1 screen appears.

To record the point, press **[ENT]** on any screen (V-PLN1/3 to V-PLN3/3).

Enter PT and CD. Then press **[ENT]**.

#### Sample records

CO, Vertical Ref Plane Pt1: 516-A1 Pt2: 530


CO, Sta=68.021 dz=17.459

SS, 30123-A48, 1.5480, 16.4020, 40.4720, 89.0730, 14:22:47,


HA: 40°29'11"  
VA: 89°07'46"  
SD: 79.402 m  
PT: 70  
CD: KERB

List Stack


## Measuring distance and offset values on the slope

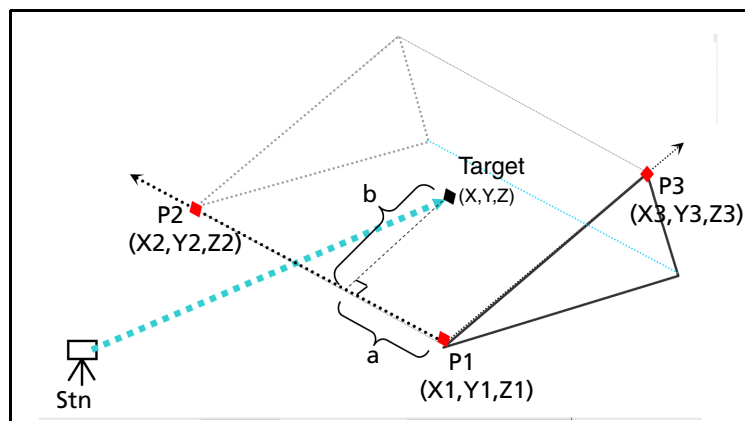


1. To enter the 3-Pt Reference Plane function, press **[7]** or select **S-Plane** in the Programs menu.

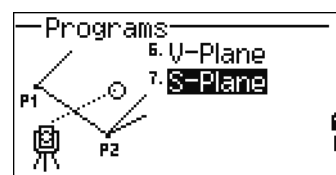

2. Enter three points to define the slope plane. To enter the point by direct measurement, press the **MSR** softkey.

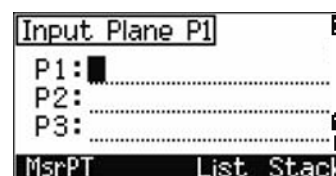


If you press **[ENT]** in a blank field, an input screen for temporary coordinates appears. These coordinates will not be stored.

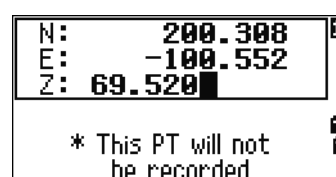

When you have entered the temporary coordinates, **<Keyed-in XYZ>** appears instead of the PT name.




**Note** – If the plane is defined by two points (by selecting **2Pt**), the vertical plane is the same as the plane used in the **V-Pln** function, but the indicating factors are **Sta** and **dZ**, not **a** and **b**. For more information, see [Measuring distance and offset values on the vertical plane](#), page 96.

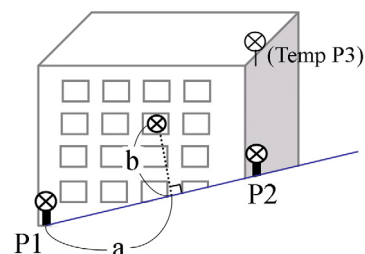


Once the plane is defined, the calculated a and b values are updated as you move the telescope. No distance measurement is required.

- a Distance between P1 and the point that is perpendicular to the target point along the P1-P2 line
- b Length of the perpendicular line from the target point to the P1-P2 line

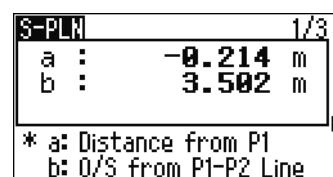

### Using **[DSP]** to switch between display screens


Press **[DSP]** to switch between the plane display screens. The following screens are available:

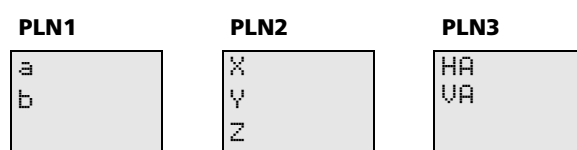

Every time you press **[DSP]**, the next screen appears. If you press **[DSP]** in the last screen (PLN3), the PLN1 screen appears.

To record the point, press **[ENT]** on any screen (S-PLN1/3 to S-PLN3/3).

Enter PT and CD. Then press **[ENT]**.

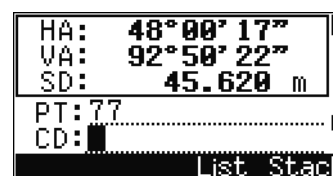

#### Sample records

CO,3ptPlane P1:1062 P2:2902 P3:1547

CO,a=31.497 b=14.239

SS,30123-A49,1.6110,0.0000,234.3210,86.0955,16:07:18,

## Recording measurement data

### Recording data from any observation screen

To record points on observation screens, press **[ENT]**.

PT defaults to the last recorded PT + 1.

You can enter the PT name from the point list or the point stack. For more information, see [Entering a point from the point list, page 61](#), and [Entering a point from the point stack, page 60](#).





You can also use the code list or the code stack. For more information, see [Entering a code from the code list, page 62](#), and [Entering a code from the code stack, page 61](#).

To record the point, press **[ENT]** on the last field.

When recording sideshots, stakeout records and control shots from the Rept function, you can choose to store raw data only, XYZ data only, or both. For more information, see [Recording, page 129](#).


**Note** – If HA or VA is moved after you take a measurement but before you press **[ENT]**, the angle recorded is the angle shown when **[ENT]** is pressed. In an angle-only record, SD is always recorded as 0.0000. If the point name that you want to record already exists in the job, an error message appears. Depending on the type of existing record, you can overwrite the old record with the new data. For more information, see [Recording Data, page 189](#).

Hold down **[ENT]** for one second to record the measurement as a CP record.

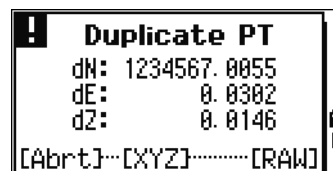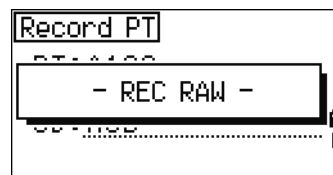


## Outputting data to the COM port

If you press **[ENT]** while the **[COM]** icon appears in an observation screen, a line of data is output to the COM port.

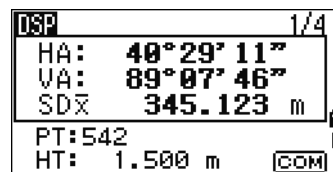

**Note** – If **[COM]** appears, data is **not** stored to the job when you press **[ENT]**.

The format of the output data is defined by the setting of the Ext.Comm field in **MENU > Settings > Comm**. For more information, see [Communications, page 128](#).

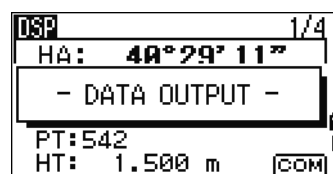

**Note** – To output data on the COM port when you press **[ENT]**, set the Data Rec field in **MENU > Settings > Rec to COM**. For more information, see [Recording, page 129](#).



### Sample output records through COM port

When the Ext.Comm field is set to NIKON:

TR PN: PT8 SD:000066626 HA:003856010 VA:008048500 HT:0000061757

(TR PN: point name SD HA VA HT; when ACK is returned, PN is incremented.)


When the Ext.Comm field is set to SET:

0006662 0804806 0394324 97  
(SD VA HA Chk-SUM)


## Measuring offsets

### Measuring taped offsets



1. To enter the taped offset function, press **[1]** or select **Tape** in the Offset menu.

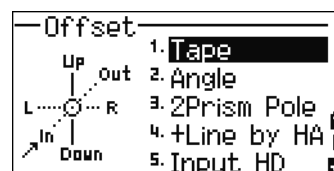

If you have not taken a distance measurement before entering this function, a temporary measurement screen appears.

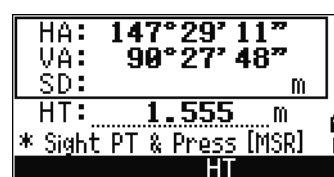


2. Sight the target and press **[MSR1]** or **[MSR2]**.
3. Enter offset distances from the measured point. Use **[^]** or **[v]** to move to the appropriate offset field.

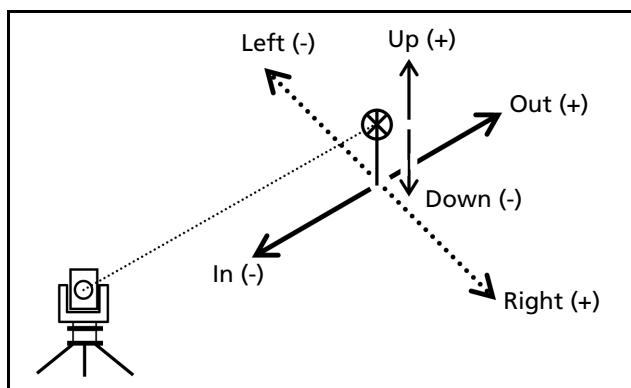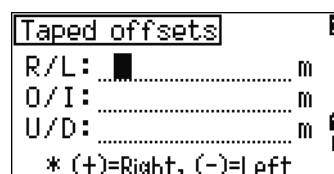

You can enter any combination of taped offset distances to specify the point.


4. To go to the recording PT screen, press **[ENT]** in the last field.

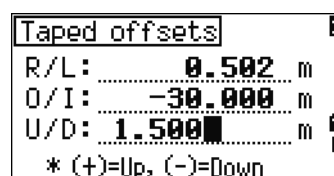

The calculated coordinates are shown.


5. Enter a PT (and CD) value.
6. Press **[ENT]** to record the point.

Raw data is also recalculated, based on the taped offset value.

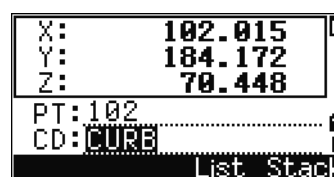



## Measuring angle offsets

1. To enter the angle offset function, press **[2]** or select **Angle** in the Offset menu.

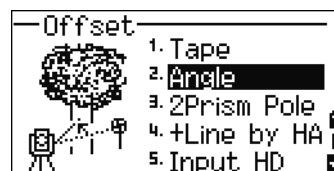

If you have not taken a distance measurement before entering this function, a temporary measurement screen appears.

2. Sight the target and press **[MSR1]** or **[MSR2]**.
3. To take the angle offset, rotate the alidade and telescope. The measured distance (HD) remains unchanged.
4. To record the offset point, press **[ENT]** or the **OK** softkey.

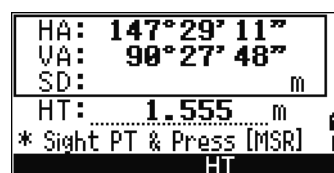
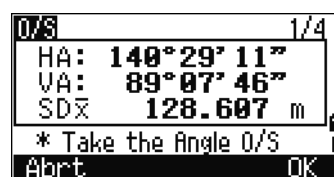



The XYZ data is also recalculated, based on the new angle.

**Note** – You can record an angle offset in the Basic Measurement Screen (BMS). After taking a distance measurement, rotate the alidade and/or telescope. Then press **[O/S]** to record the measured distance with the updated angle value. If you use this method, the dimension of the angle offset is not stored as a CO record. To store the CO record, use the O/S function.


## Two-prism pole

1. To enter the two-prism pole function, press **[3]** or select **2Prism Pole** in the Offset menu.
2. Sight the first prism and press **[MSR1]** or **[MSR2]**.

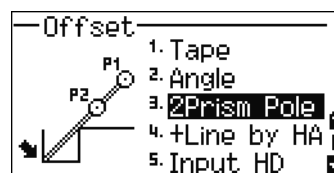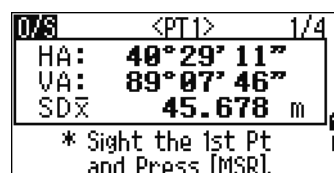





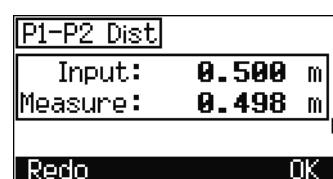
3. Sight the second prism and press **[MSR1]** or **[MSR2]**.

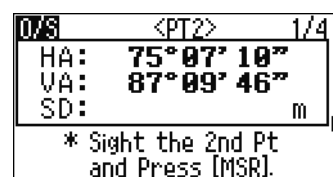

4. Enter the distance between the second prism and the target point. Alternatively, if you do not need QA information, you can leave the distance between the first and the second prism blank.

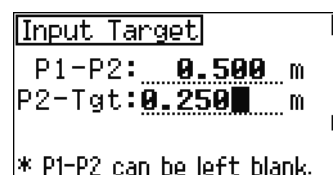

5. If you do enter a P1-P2 distance, the QA screen appears. Compare the entered value and the measured distance to check the accuracy of the observation.



6. To record the point, press **[ENT]** or the **OK** softkey.


### Sample records

SS,14,0.0000,38.9200,271.0350,89.2630,11:04:15,DITCH  
CO,2Prism O/S: P1-P2= 0.5090( 0.5060) P2-Tgt= 0.5020


**Note** – In this sample data, 0.5090 is the measured value. 0.5060 is the entered value.

## Extending a line by horizontal angle offset


1. To enter the line extension (by HA) function, press **[4]** or select **+Line by HA** in the Offset menu.

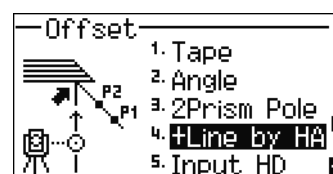


2. Sight the first prism (or target) and press **[MSR1]** or **[MSR2]**.

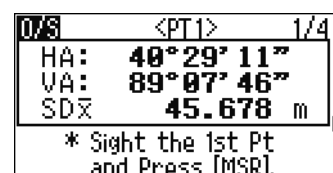

The display moves to the next screen.

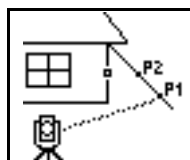


3. Sight the second prism (or target) and press [MSR1] or [MSR2].

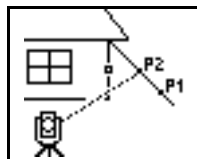

|                                     |           |     |
|-------------------------------------|-----------|-----|
| 0/8                                 | <PT2>     | 1/4 |
| HA:                                 | 75°07'10" |     |
| VA:                                 | 87°09'46" |     |
| SD:                                 |           | m   |
| * Sight the 2nd Pt and Press [MSR]. |           |     |

4. Sight the alternative place on the same vertical line as the required target point.

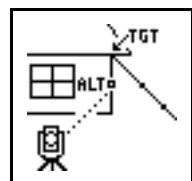

|                                    |           |     |
|------------------------------------|-----------|-----|
| 0/8                                | <ALT>     | 1/4 |
| HA:                                | 52°46'09" |     |
| VA:                                | 87°09'46" |     |
| SD:                                |           | m   |
| * Take a HA offset and Press [ENT] |           |     |

5. To calculate the coordinates and the raw data of the target point, press [ENT].
6. To record the point, enter a PT (and CD) value and press [ENT]. The height of target is fixed to 0.0000 for the offset point.

|            |           |   |
|------------|-----------|---|
| HA:        | 40°29'11" |   |
| VA:        | 89°07'46" |   |
| SD:        | 79.402    | m |
| PT:        | 70        |   |
| CD:        | KERB      |   |
| List Stack |           |   |

#### Sample records



SS, 40, 0.0000, 48.3304, 169.20370, 82.02470, 10:52:37  
 CO, PT1, 0.0000, 48.3020, 169.19165, 83.58565  
 CO, PT2, 0.0000, 48.3155, 168.54250, 85.42440  
 CO, O/S MSR:40 0.0000 0.0000 169.20370 87.02340

**Note** – The calculated point (TGT) is stored as a SS record. Measurements to the first and second target (P1 and P2) are stored as comment records (PT1 and PT2). The last record records the angle measurement to the ALT (vertically offset point from the actual target point).


## Entering a horizontal distance after an angle-only shot

This function is useful when the instrument is very close to the point and it is difficult to take a measurement using the EDM.

1. To enter the Input HD function, press **[5]** or select **Input HD** in the Offset menu.

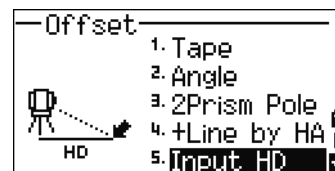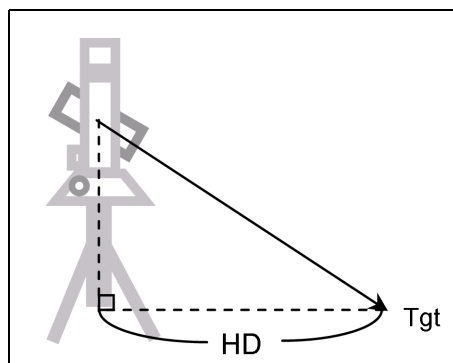

2. Turn the telescope in the direction of the point that you want to store.
3. Enter the HD. Usually this is the taped distance from the instrument point.
4. Enter a PT (and CD) value and press **[ENT]**.  
The target point is calculated and recorded as an SS record.

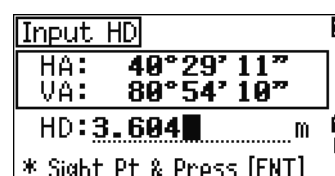


### Sample records


SS,158,0.0000,77.0518,62.08380,108.06510,11:51:48,  
CO, Input HD:76.1243

## Calculating a corner point

1. To enter the corner point function, press **[6]** or select **Corner** in the Offset menu.
2. Take a distance measurement to the first prism (or target) on the wall. Press **[MSR1]** or **[MSR2]**.

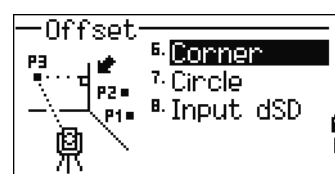


3. Sight a second point on the same wall with the first point measurement. Press **[MSR1]** or **[MSR2]**.

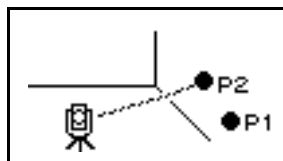

```

0/S      <PT1>      1/4
HA:  40°29' 11"
VA:  89°07' 46"
SDx  45.678 m
* Sight the 1st Pt
  and Press [MSR].
  
```

4. Sight the first point on the second wall. Press **[MSR1]** or **[MSR2]**.

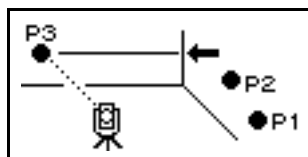

```


0/S      <PT2>      1/4
HA:  75°07' 10"
VA:  87°09' 46"
SD:  m
* Sight the 2nd Pt
  and Press [MSR].
  
```

5. If the two walls are at right angles, press the **Calc** softkey to calculate the corner point by three points.

```

0/S      <PT3>      1/4
HA:  94°01' 32"
VA:  87°09' 46"
SD:  m
* Sight the 3rd Pt
  and Press [MSR].
  
```

6. If you take a measurement to a fourth point, the corner point can be calculated as the intersection of two walls (P1-P2 and P3-P4). The default elevation is given by P4.

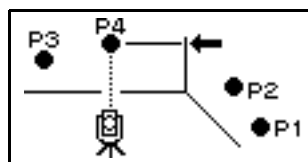

```

0/S      <PT4>      1/4
HA:  128°50' 37"
VA:  87°09' 46"
SD:  m
MSR1 MSR2 DSP Calc
  
```

7. Enter a PT (and CD) value. The height of target (HT) defaults to the value used in the last measurement.
8. To record the corner point, press **[ENT]**.

```

Record PT      1
PT: A102
HT:  1.702 m
CD: HUB
List Stack
  
```

#### Sample records

SS, 58, 0.0000, 48.3304, 169.19165, 82.02470, 10:52:37, FLOOR2

CO, PT1, 1.0080, 48.3020, 169.19165, 83.58565

CO, PT2, 1.0080, 48.3155, 128.54250, 85.42440

CO, O/S MSR:40 0.0000 0.0000 169.20370 87.02340


The calculated corner point is stored as an SS record.

The next three or four comment records are measured points. For example:


CO, Point name (fixed to PT1, PT2 etc.), HT, SD, HA, VA.

## Measuring circle offsets


1. To enter the circle center calculation function, press **[7]** or select **Circle** in the Offset menu.

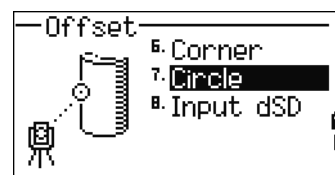

If you have not taken a measurement to the circle before entering this function, a temporary measurement screen appears.


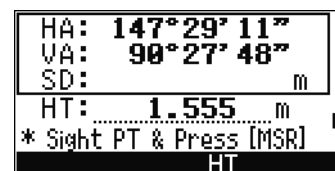


2. Sight any point on the surface of the circle and press **[MSR1]** or **[MSR2]**.

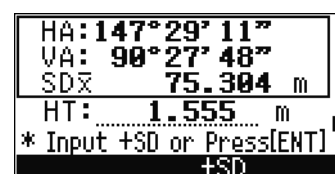

**Note** – If you use a prism attached to the surface of the circle for the distance measurement, press the **+SD** softkey to eliminate the offset error (from the attached point to the measured surface of the prism) before you press **[ENT]**.


3. Sight one edge of the circle and press **[ENT]**.

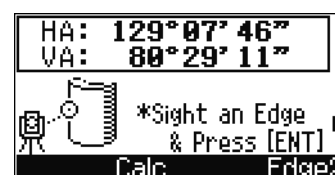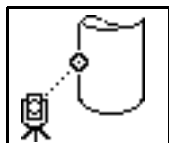


**Note** – If you have taken a distance measurement to the center of the circle, press the **Calc** softkey to calculate the offset using one edge angle observation.

4. Sight the other edge of the circle and press **[ENT]**.

The instrument calculates and records the center of the circle.

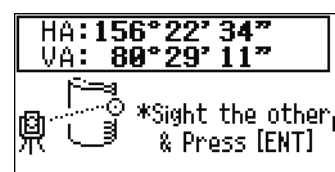

It also calculates the coordinates of the center point and the radius of the circle.

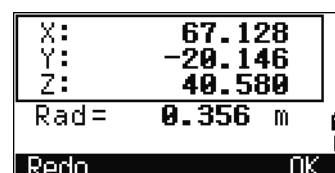

5. To record the point, press **[ENT]** or the **OK** softkey.

### Sample records

SS,71,1.5000,37.0518,32.08380,81.06510,11:51:48,

CO, PT1, 0.0000, 0.0000,47.05350, 83.58560

CO, PT2, 0.0000, 0.0000, 29.53010, 83.58560

CO,O/S MSR:71 1.5555 36.5418 38.28360 81.06510


CO,Radius of circle 0.356

CO,Input +SD:0.0020

The calculated point (center of the circle) is stored as an SS record.


The following one or two comment records are angle-measured points. For example, CO, Point name (fixed to PT1/ PT2), HT(0.0000), SD(0.0000), HA, VA.

If you press the  $\pm$ SD softkey before you sight Edge1, the input value is recorded at the end.

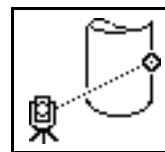


### Extending the slope distance


1. To enter the function for extending the slope distance, press  $\boxed{8}$  or select **Input dSD** in the Offset menu.

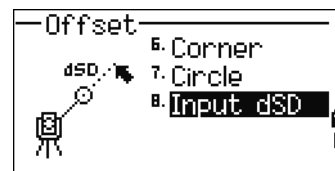

If you have not taken a distance measurement before entering this function, a temporary measurement screen appears.

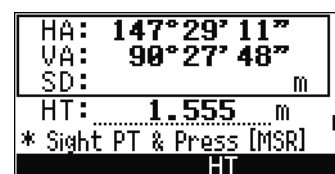

2. Enter the slope distance that you need to add or subtract. You can enter any value from -99.990 through +99.990 m (-328.000 through +328.000 ft).
3. To record the point, press  $\boxed{ENT}$ .

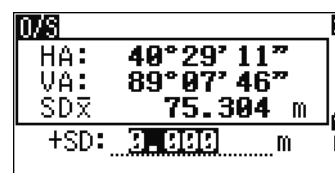

#### Sample records

SS,83,1.5000,77.0518,62.08380,81.06510,11:51:48,  
CO,O/S MSR:83 1.5555 76.5518 62.08380 81.06510

# Menu Key

## In this chapter:

- Introduction
- Job Manager
- Cogo
- Settings
- Data
- Communication
- 1sec-Keys
- Calibration
- Time

Use the MENU screen to access functions and settings.

To display the MENU screen, press the **MENU** key.

## Introduction

Use the MENU screen to access important functions and settings.

To display the MENU screen, press the **[MENU]** key.



## Job Manager

Use the job manager to open, create, delete, and manage jobs. To open the Job Manager, press **[1]** or select **Job** on the MENU screen.

If there are jobs stored on the instrument, the job list appears, showing all the stored jobs. The newest job appears at the top of the list.


If there are no jobs stored, the Create Job screen appears. See [Creating a new job](#), page 111.



## Opening an existing job

The job list shows all the jobs stored on the instrument, in descending date order.

The following symbols may be used to provide extra information about jobs:

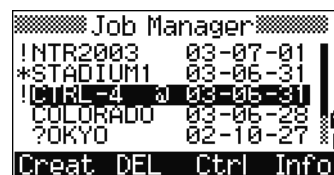

| Symbol | Meaning  |
|--------|--|
| *      | Current job.   |
| @      | Control job.   |
| !      | Some of the job settings are different from the current job.   |
| ?      | Job was created in an older DB. Older files cannot be opened in version 1.10 or later of the software. |




Press **[↑]** or **[↓]** to move up or down the job list. Press **[ENT]** to open the highlighted job.

When you open a job, all job settings are automatically changed to match those used in the open job.



## Creating a new job


1. Press the **Cr eat** softkey in the job list.
2. Enter a job name of up to eight characters. Press **[ENT]**.
3. Do one of the following:
  - To check the job settings, press the **Set t** softkey.
  - To create a new job using the current job settings, press **[ENT]** or the **OK** softkey.

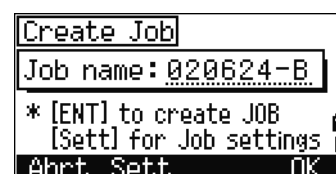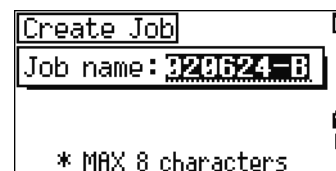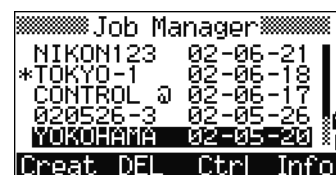


## Job settings

The following settings are set when a job is created, and cannot be changed. This ensures that the data in a job is correctly stored in the database, and that all necessary corrections are applied when you store each record

|                |                      |
|----------------|----------------------|
| Scale Factor   | 0.999600 to 1.000400 |
| T-P correction | ON/OFF               |
| Sea Level      | ON/OFF               |
| C&R correction | OFF/0.132/0.200      |

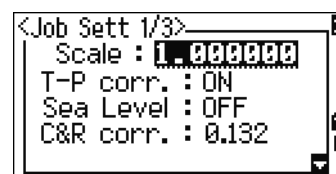


|               |                  |
|---------------|------------------|
| Angle unit    | DEG/GON/MIL      |
| Distance unit | Metre/US-Ft/I-Ft |
| Temp unit     | °C/°F            |
| Press unit    | hPa/mmHg/inHg    |

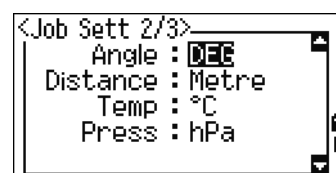

**Note** – If you select US-Ft or I-Ft, an additional settings screen appears. Use this screen to specify whether to display values in Decimal-Ft or Ft-Inch.



|         |                        |
|---------|------------------------|
| VA zero | Zenith/Horizon/Compass |
| AZ zero | North/South            |
| Order   | NEZ/ENZ                |
| HA      | Azimuth/0 to BS        |

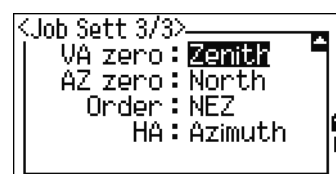

To move between fields, press  $\uparrow$  or  $\downarrow$ . Alternatively, to move to the next field, press  $\text{ENT}$ .

To change the setting in the selected field, press  $\leftarrow$  or  $\rightarrow$ .

To confirm the job settings and create the job, press  $\text{ENT}$  in the last field (HA).


These settings are separate from other temporary settings.

## Deleting a job




**Tip** – There is no undelete function in the Job Manager. Before you press  $\text{ENT}$  or select  $\text{DEL}$ , make sure that the selected job is the one that you want to delete.

1. In the job list, highlight the job that you want to delete.

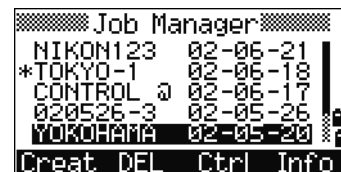


2. Press the  $\text{DEL}$  softkey. A confirmation screen appears.

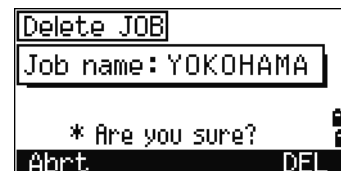

3. Do one of the following:

- To delete the selected job, press  $\text{ENT}$  or the  $\text{DEL}$  softkey.
- To cancel the deletion and return to the previous screen, press  $\text{ESC}$  or the  $\text{Abt}$  softkey.

After you delete a job, the display returns to the job list.

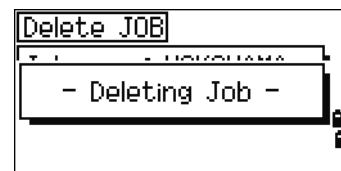


## Setting the control job

If you search for a point when a control job is specified, and the system cannot find the point in the current job, the control job is also searched. If the point is found in the control job, it is copied to the current job as a UP record.

A control job has the same format as a standard job. You can open and modify it like any other job, and you can use it to record any measured data.

To set the control job:

1. Highlight the job that you want to use.
2. Press the  $\text{Ctrl}$  softkey.


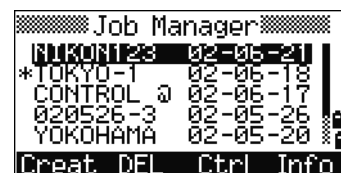


A confirmation screen appears.

3. Do one of the following:


- To set the selected job as the control job, press **[ENT]** or the **Yes** softkey.
- To cancel the process, press **[ESC]** or the **No** softkey.

**Note** – If a control job is already assigned, the newly assigned control job replaces it as the control job. To clear the control job selected, highlight the current control job in the job list and press the **Ctrl 1** softkey. Then press **[ENT]** or the **Yes** softkey to confirm.

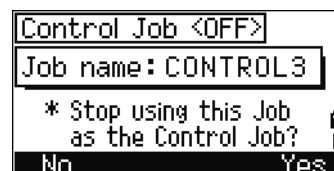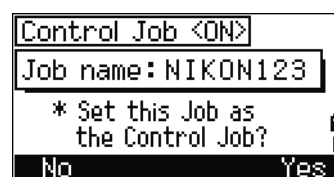

## Displaying job Information

To display job information, highlight the job name and then press the **Info** softkey.

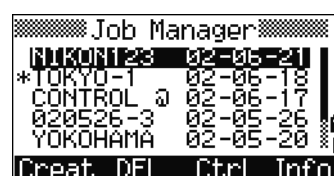

The Information screen shows the number of records in the job, the free space, and the date when the job was created. Free space indicates how many points can be stored in the job.


To return to the job list, press any key.



## Cogo

Use the Cogo menu to perform coordinate geometry (COGO) calculations. You can access this menu at any time from any observation or PT input screen.

To open the Cogo menu, press [2] or select **Cogo** on the MENU screen.

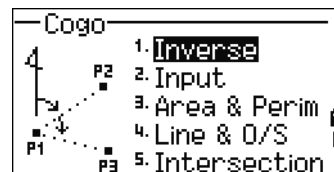

### Calculating angle and distance between two coordinates


To open the Inverse menu, press [1] or select **Inverse** in the Cogo menu.

#### PT-PT inverse

PT-PT calculates the distance and the angle between two input points.


To calculate a PT-PT inverse:

1. Press [1] or select **PT-PT** in the Inverse menu.

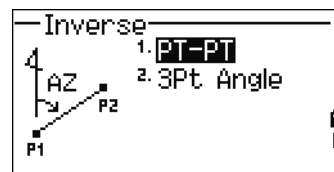


2. Enter the first point number or name. Press [ENT].


**Note** – If you press [ENT] without entering a point name, a coordinate input screen appears, and you can enter coordinates. These coordinates are **not** stored to the database. If you want to store the point, specify a new point name.

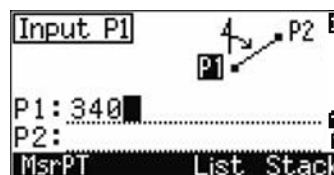


3. Type the second point number/name and press [ENT]. The MsrPT softkey allows you to shoot the point on the spot to use it in the calculation.

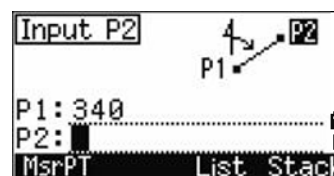

The azimuth, horizontal distance, and vertical distance from the first point to the second point are displayed.

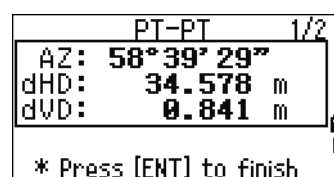

4. Do one of the following:
  - To return to the PT input screen, press [ESC].
  - To return to the COGO menu, press [ENT].

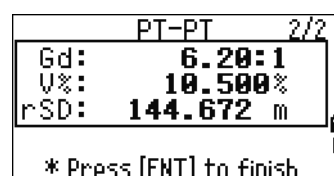

- To change the contents of the result screen, press [DSP].

Gd      Grade (HD/VD)  
 V%      100/Gd  
 rSD      Slope distance PT1 to PT2

### 3Pt angle

The 3Pt Angle function calculates the angle between two lines defined by three points.

To calculate a 3Pt angle:







1. Press [2] or select 3Pt Angle in the Inverse menu.  
 P1 is the base point. Two lines are to be defined by P2 and P3, both from P1.
2. Enter the point name, or use the MSR softkey to take a measurement to the point.
3. Enter the second point (P2) to define the baseline (P1-P2). The angle (dHA) is measured from the baseline.
4. Enter the third point (P3) to define the second line (P1-P3).

**Note** – When you press the MSR softkey, a temporary measuring screen appears. Sight the target and press [MSR1] or [MSR2] to take a measurement.

**Note** – After the measurement, a recording point screen appears. To store the measured point, enter the PT, HT, and CD values and press [ENT]. To use the point without recording it, press [ESC].

When you have entered three points, the instrument calculates the angle and distances.

5. Do one of the following:
  - To return to the Inverse menu, press [ENT].
  - To return to the Input BasePt screen, press [ESC].

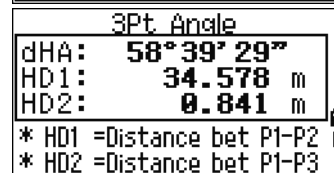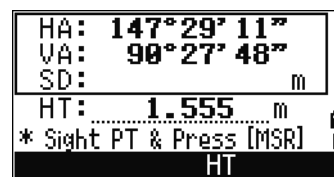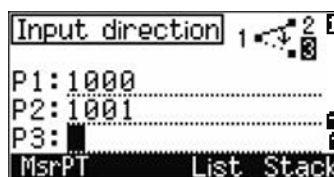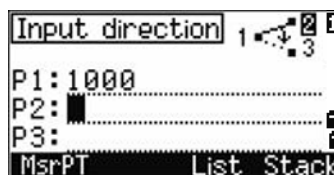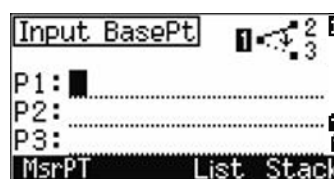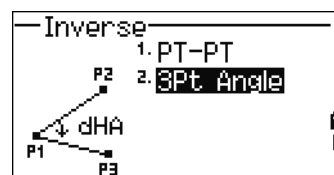

## Calculating and manually inputting coordinates

To enter the Input menu, press **[2]** or select **Input** in the Cogo menu. There are three functions in this menu for recording new coordinate points.

### Azimuth+HD input

To calculate a coordinate by an angle and distance input from the base point (P1), press **[1]** or select **AZ+HD** in the Input menu.

Enter the base point (P1). Type the point name and press **[ENT]**.

Enter the azimuth, horizontal distance, and vertical distance. Then press **[ENT]**.

To enter 123°45'45", type 123.4545 and press **[ENT]**.

If you do not enter a value in the dVD field, the value 0.000 is used.

A recording point screen with the calculated coordinates appears. PT defaults to the last recorded PT + 1.








Press **[ENT]** to store the point.

### Traverse

To open the Traverse (2Pt Angle) function, press **[2]** or select **Traverse** in the Input menu.

Traverse function calculates a new point based on the two defined points and angle, horizontal and vertical distances from the line defined by those two points.

To enter P1 and P2, enter point names or take measurements to targets.

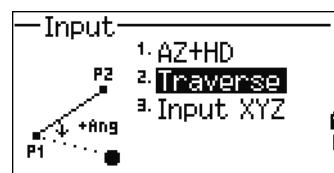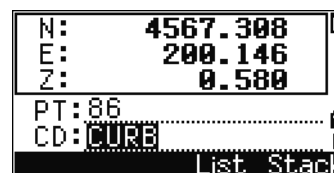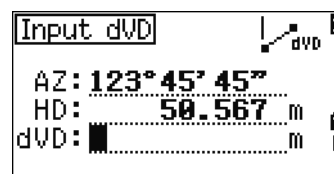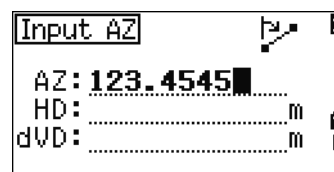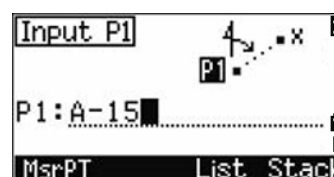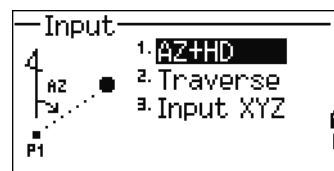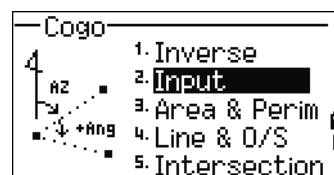

Enter the plus-minus angle, horizontal distance, and vertical distance from the baseline defined by P1-P2.

If you do not enter a value in the dVD field, the value 0.000 is used.

When you press **ENT** in the dVD field, a new point is calculated. The PT name defaults to the last recorded PT + 1.

To record the new point and return to the point input screen, press **ENT**.

P1 (base PT) defaults to the previously recorded PT. P2 defaults to the previous P1.

**Note** – To continuously calculate a new point, enter +Ang, HD, and dVD from the previous bearing line. This is a convenient way to enter Traverse points.

## Entering coordinates

To manually enter the XYZ coordinates, press **3** or select **Input XYZ** in the Input menu.

The PT name defaults to the last recorded PT + 1.

Enter the coordinates using the numeric keys. To move to the next field, press **ENT** or **v** in a field

To store the point as an MP record and return to the point input screen, press **ENT** in the Z field. The default PT is incremented to the next value.

**Note** – You can record NE, NEZ, or Z-only data to the database.

## Calculating area and perimeter

To calculate an area or perimeter, press **3** or select **Area & Perim** in the Cogo menu.

To take a measurement, enter the first point and press **ENT**, or press the **MSR** softkey.

In the upper right corner of the screen, a counter indicates how many points you have entered.

To input point numbers consecutively, use the Fr/To softkey. For more information, see [Advanced feature: Entering a range of points](#), page 118.

If you enter a new point name, you can enter new coordinates and record the point. If you do not want to record the point, press [ENT] without entering a value in the PT field. An XY coordinate input screen appears.

Continue to enter points until you have defined all the points in the lot. Then, press [v] to calculate the area and perimeter.

**Note** – The first and last points that you enter are joined to close the area. You must enter the points in the order in which they define the lot. You can enter up to 99 points.

Press [ENT] to store the calculated values as a comment record, or press [ESC] to return to the Cogo menu.

If you chose to store the area, enter a name to identify the area and then press [ENT].

**Note** – When you download data in Nikon RAW format, area (AR) records are output as comment (CO) records.

### Advanced feature: Entering a range of points

To quickly enter a sequential range of points, use the range input function. To access this function, press the Fr/To softkey in the No. 01 or No. 02 input screens.

Enter the start point name in the Fr field and the end point name in the To field. You can include letters and hyphens in the point names, but the last character must be numeric.

Press [ENT] in To field to start searching for matching points. The counter shows the number of matching points found.



When the search is complete, you are returned to the Input PT screen.

Press the  $\text{Calc}$  softkey to calculate the area and perimeter, or enter point names in the PT field.

Press  $\text{ESC}$  to return to the Input PT screen with the preceding point name.

|  |                 |
|--|-----------------|
| Input PT                                       | No. 01 1        |
| PT: <input type="text"/>                       |                 |
| * Press [Calc] to calculate Area and Perimeter |                 |
| MsrPT  | Calc List Stack |


## Calculating coordinates from line and offset

To enter the Line & offset function, press  $\text{4}$  or select **Line & O/S** in the Cogo menu.

Enter the base point (P1).

|                          |                         |
|--------------------------|-------------------------|
| Input P1                 | P1 <input type="text"/> |
| P1: P10                  |                         |
| AZ: <input type="text"/> |                         |
| P2: <input type="text"/> |                         |
| MsrPT                    | List Stack              |

Specify the azimuth bearing. To do this, enter a value in the AZ or P2 field. P2 is a second point on the line.

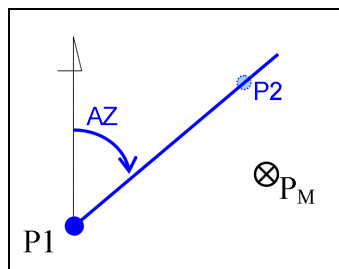


|                          |                         |
|--------------------------|-------------------------|
| Input AZ or P2           | P1 <input type="text"/> |
| P1: P10                  |                         |
| AZ: <input type="text"/> |                         |
| P2: <input type="text"/> |                         |

Enter the horizontal distance along the baseline (Sta), the horizontal distance perpendicular to the line (O/S), and the vertical distance (dVD).

|                           |                          |
|---------------------------|--------------------------|
| Line & Offset             | dVD <input type="text"/> |
| Sta: 50.550               | m                        |
| O/S: 7.250                | m                        |
| dVD: <input type="text"/> | m                        |
| * dVD based on P1-Z       |                          |

**Note** – A negative value in the Sta field means the opposite direction along the defined bearing line. A negative value in the O/S field is for the left-hand side of the bearing line.

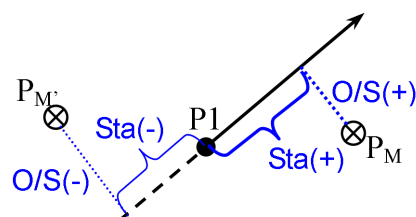


To calculate the coordinates of the point (PM), press  $\text{ENT}$  in the dVD field. You can change the Z coordinate here.

|             |  |
|-------------|--|
| X: 4567.308 |  |
| Y: 200.146  |  |
| Z: 0.5800   |  |
| PT: 86      |  |
| CD: CURB    |  |

To record the point, press **[ENT]** in the CD field.

The coordinates are stored as a CC record. Line definition information and Sta, O/S, and dVD values are stored in comment (CO) records.

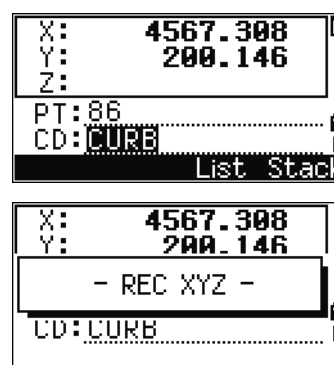


## Calculating coordinates using intersection functions

To enter the Intersection menu, press **[3]** or select **Intersection** in the Cogo menu. There are four functions in this menu for calculating coordinates.


### Calculating a bearing-bearing intersection

A bearing-bearing intersection is the intersection point of two lines.


1. To calculate a bearing-bearing intersection, press **[1]** or select **Brng-Brng** in the Intersection menu.

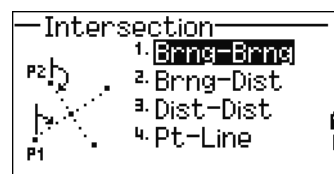

2. Enter the first point name and press **[ENT]**. Alternatively, to measure directly to the point, press the **MSR** softkey.

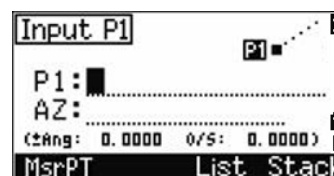


3. Define the first line by azimuth.

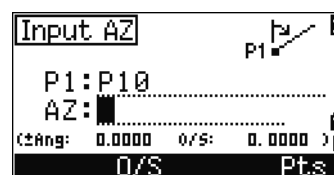


4. To define the line by two points, press the **Pts** softkey. The Fr field defaults to the P1 point, but you can change the selected point. In the To field, enter or measure to the second point.


For more information about the **O/S** softkey, see [Advanced feature: Entering angle and distance offsets, page 124](#).

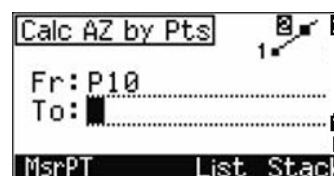

5. Do one of the following:

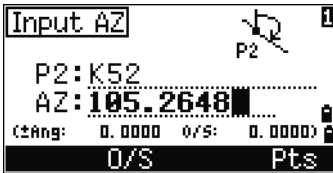- To return to the previous screen, press **[ESC]**. The calculated value appears in the AZ field.
  - To go to the next screen, press **[ENT]**.
6. Define the second line by two points or by P2 and AZ.
 
  7. To calculate the coordinates of the intersection point, press **[ENT]** in the AZ field.
 

The calculated coordinates are displayed. You can input a Z coordinate if necessary.

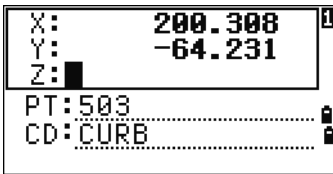
  8. Enter a value in the PT field and in the CD field.
  9. To record the point, press **[ENT]**.


### Sample records

CO,Int BB P1:P10 AZ:330.54175-90.00000  
 CO, P2:408 AZ:100.0000+0.0000  
 CC,A123,,4567.3080,200.1467,-1.2056,POT




### Calculating a bearing-distance intersection

1. Press **[2]** or select **Brng-Dist** in the Intersection menu.
 




Brng-Dist calculates the intersection point formed by one line and one distance (radius).

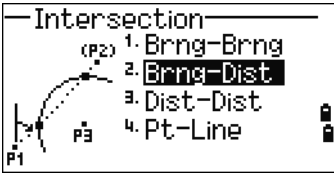
2. Enter a point on the line.
 

The line can be defined by two points or by a point and an azimuth.

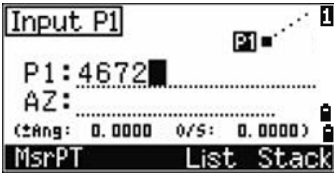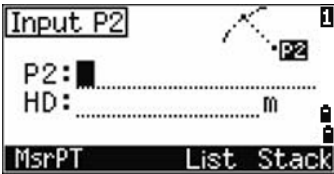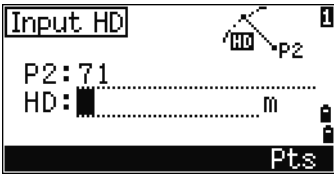
3. Enter the second point (P2) as the center of the circle.
 
4. Enter the distance from P2.
  - To define the distance (HD) by two points, press the **Pt↔** softkey.

- To calculate the coordinates of the intersection point, press **[ENT]** in the HD field.
5. If there are two results, the first solution appears graphically relative to the P1-P2 line. To display the second solution, press **[<]** or **[>]**.
  6. To record the point, press **[ENT]** when the required solution appears.
  7. Enter a Z coordinate if necessary.
  8. To move to the PT and CD fields, press **[ENT]**.

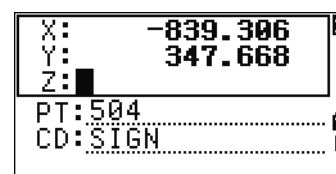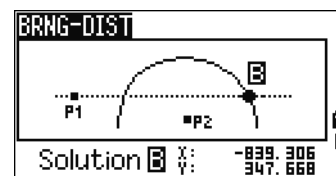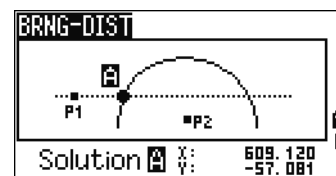

### Sample records




CO,Int BD P1:4672 AZ:330.54175+0.00000

CO, P2:71 HD:100.0000

CC,504,,,-839.3065,347.6682,,SIGN

### Calculating a distance-distance intersection

1. Press **[3]** or select **Dist-Dist** in the Intersection menu.
2. Enter the first point name and press **[ENT]**, or press the **MSR** softkey to measure directly to the point.
3. Enter the distance from P1 and press **[ENT]**.
4. To define the distance (HD) by two points, press the **Pt=** softkey.
5. Enter P2 and the distance from P2 (HD).
6. To calculate the coordinates of the intersection point, press **[ENT]** in the HD field.
7. Press **[<]** or **[>]** to display the second solution.
8. To record the point, press **[ENT]** when the required solution appears.

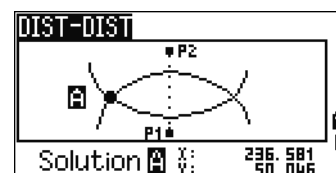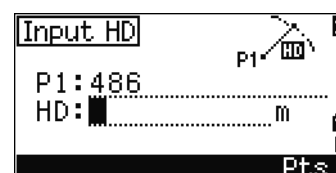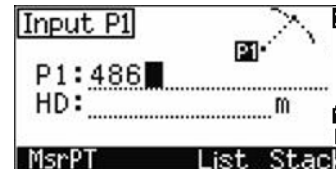

- Enter a Z coordinate if necessary. Press **[ENT]** to move to the PT and CD fields.

|     |         |   |
|-----|---------|---|
| X:  | 236.581 | 1 |
| Y:  | 50.046  |   |
| Z:  |         |   |
| PT: | 505     |   |
| CD: |         |   |

#### Sample records

CO,Int DD P1:486 HD:330.6020  
 CO, P2:7 HD:100.0000  
 CC,505,,236.5817,50.0461,0.0000,

### Calculating a point-line intersection

- Press **[4]** or select **Pt-Line** in the Intersection menu.
- Enter the first point name and press **[ENT]**, or press the **MSR** softkey to measure directly to the point.

|                            |            |   |
|----------------------------|------------|---|
| Input P1                   |            | 1 |
| P1:                        | 38         |   |
| AZ:                        |            |   |
| (±Ang: 0.0000 O/S: 0.0000) |            |   |
| MSRPT                      | List Stack |   |

- Enter the azimuth, or press the **Pt** softkey to enter another point name on the line.

|                            |     |   |
|----------------------------|-----|---|
| Input AZ                   |     | 1 |
| P1:                        | 38  |   |
| AZ:                        | 90  |   |
| (±Ang: 0.0000 O/S: 0.0000) |     |   |
| O/S                        | Pts |   |

- Enter the perpendicular point to the line, or press the **MSR** softkey to take a measurement to the point.
- To calculate the coordinates of the intersection point, press **[ENT]**.

|          |            |   |
|----------|------------|---|
| Input P2 |            | 1 |
| P2:      | 506        |   |
|          |            |   |
| MSRPT    | List Stack |   |

If P1 and P2 are 3D points, the Z coordinate of the perpendicular point is calculated relative to the P1-P2 slope.

- Enter PT and CD then press **[ENT]** to record the point.


|     |          |   |
|-----|----------|---|
| X:  | 4567.308 | 1 |
| Y:  | 200.146  |   |
| Z:  | -1.205   |   |
| PT: | A-123    |   |
| CD: | POT      |   |

#### Sample records



CO,Int PtLine P1:38 AZ:90.00000+0.00000  
 CO, P2:506  
 CC,A-123,,4567.3080,200.1467,-1.2056,POT

### Advanced feature: Entering angle and distance offsets


To display the offset input screen, press the O/S softkey.

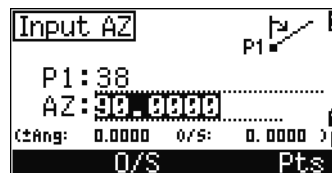

In the Ang field, enter a positive value to rotate the line clockwise. Enter a negative value to rotate the line counterclockwise.

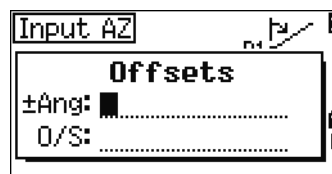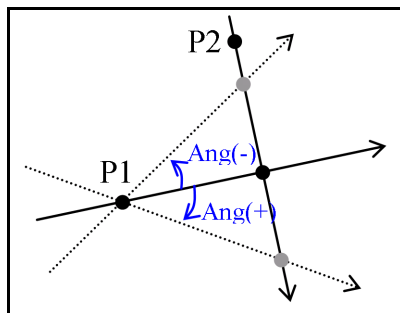

In the O/S field, enter a positive value to specify an offset to the right. Enter a negative value to specify an offset to the left.


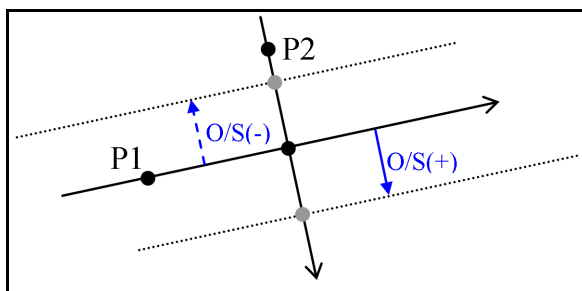


## Settings

To display the Settings menu, press [2] or select **Settings** on the MENU screen.

Use this menu to configure the initial job settings.


**Note** – Some job settings, specified in the following sections, cannot be changed once a job is created. If any of these settings are changed while a job is open, a confirmation screen appears, asking you to create a new job with the new settings, or to work with those settings without recording any data. For more information, see [Settings, page 190](#).

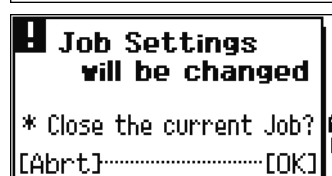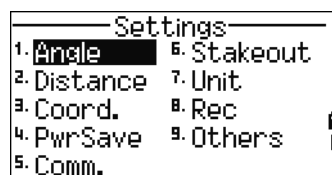

## Angle

To open the Angle menu, press **[1]** or select **Angle** in the Settings menu.

VA zero      Zenith/Horizon/Compass

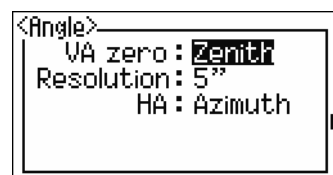

**Note** – The VA job setting cannot be changed once a job is created.

Resolution    1"/5"/10" or 0.2 mgon/1 mgon/2 mgon

HA             0 to BS/Azimuth

**Note** – The HA job setting cannot be changed once a job is created. When this field is set to Azimuth, the horizontal angle (HA) that appears and recorded is in Azimuth value. When this field is set to 0 to BS, HA is in HA zero to BS value.

## Distance


To open the Distance menu, press **[2]** or select **Distance** in the Settings menu

Scale          Numeric value between 0.999600 and 1.000400

T-P corr.      ON/OFF

Sea Level     ON/OFF

C&R corr.    OFF/0.132/0.200

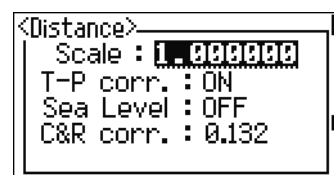

**Note** – The Scale, T-P corr., Sea Level, and C&R corr. job settings cannot be changed once a job is created.

## Temperature and pressure corrections

$$K = 278.23 - \left( \frac{0.29527}{1 + \left( \frac{T}{273.16} \right)} \times P \right)$$

$$SD' = \left( 1 + \frac{K}{1000000} \right) \times SD$$

|     |                           |
|-----|---------------------------|
| SD  | Slope dist. (before adj.) |
| SD' | Slope dist. (after adj.)  |
| K   | Compensation coefficient  |
| P   | Pressure (hPa)            |
| T   | Temperature (°C)          |

### Sea level correction

$$HD' = \frac{HD \times R_e}{R_e - Z_{STN}}$$


|                  |                                |
|------------------|--------------------------------|
| HD               | Horizontal dist. (before adj.) |
| HD'              | Horizontal dist. (after adj.)  |
| Z <sub>STN</sub> | Instrument-Z                   |
| R <sub>e</sub>   | 6370 km                        |

### Curvature and refraction correction

Because the surface of the earth is curved, the vertical difference (VD and Z) at the measurement point, as referenced to the horizontal plane, inevitably includes some error. This error is called **curvature error**. Also, because the density of the air



surrounding the earth decreases with altitude, light is refracted at different rates at different altitudes. The error caused by this change in refraction is called **refraction error**.

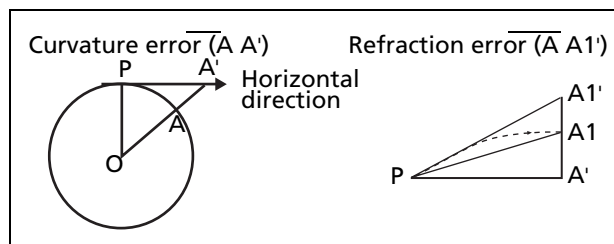

|     |                                |
|-----|--------------------------------|
| HD  | Horizontal dist. (before adj.) |
| HD' | Horizontal dist. (after adj.)  |
| VD  | Vertical dist. (before adj.)   |
| VD' | Vertical dist. (after adj.)    |
| SD  | Slope distance                 |
| VA  | Vertical angle                 |
| Re  | 6370 km                        |
| k   | C&R constant (0.132 or 0.200)  |


$$HD' = HD \frac{SD^2 \sin(2VA)}{2R_e} \left(1 - \frac{k}{2}\right)$$

$$VD' = VD + \frac{HD^2}{2R_e} (1 - k)$$

## Coordinate

To open the Coordinate menu, press **[3]** or select **Coord.** in the Settings menu.

|       |                  |
|-------|------------------|
| Order | NEZ/ENZ          |
| Label | XYZ/YXZ/NEZ(ENZ) |
| AZ    | North/South      |

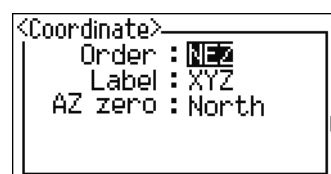


**Note** – The Order and AZ job settings cannot be changed once a job is created.

## Power saving

To open the Power Save menu, press [4] or select **Power Save** in the Settings menu.

Main Unit    OFF/5min/10min/30min  
Sleep        OFF/1min/3min/5min

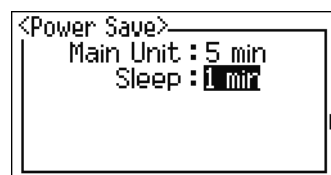


## Communications

To open the Communication menu, press [5] or select **Comm.** in the Settings menu.

Ext.Comm    NIKON/SET  
Port        Serial/Bluetooth (\*)  
Baud        1200/2400/4800/9600/19200/38400 bps  
Length      7/8  
Parity      EVEN/ODD/NONE  
Stop bit    1/2

(\*)Port selection field appears only when the optional Bluetooth is on-board.

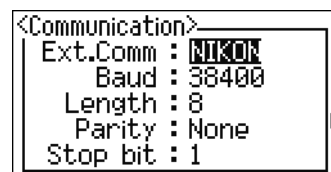


## Stakeout

Press [6] or select **Stakeout** in the Settings menu to open the Stakeout menu.

Add PT     Integer between 1 and 999,999


**Note** – This field sets the default point number to record observed data in stakeout.

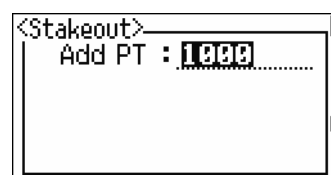

## Unit

To open the Unit menu, press [7] or select **Unit** in the Settings menu.

Angle       DEG (Degree)  
              GON (GON)  
              MIL (Mil/6400)  
Distance    Meter/US-Ft/I-F

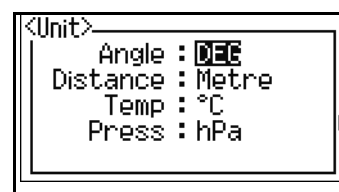

**Note** – If you select US-Ft or I-Ft, an additional settings screen appears. Use this screen to specify whether to display values in Decimal-Ft or Ft-Inch.

Temp      °C (Celsius)  
             °F (Fahrenheit)  
Press      hPa/mmHg/inHg



**Note** – The Angle, Distance, Temp, and Press job settings cannot be changed once a job is created.

## Recording

To open the Rec menu, press [8] or select **Angle** in the Settings menu.

Store DB    RAW/XYZ/RAW+XYZ  
              This setting determines whether raw and/or coordinate data is stored when you record SS, CP, or SO records in the Basic Measurement Screen (BMS) or Stakeout screen.

Data Rec    Internal/COM  
              Set this field to COM to output data on the COM port when you press [ENT] in the BMS or a Stakeout screen. The data is not stored to the job file. For more information, see [Outputting data to the COM port, page 100](#)




## Others settings

To open the Others menu, press [9] or select **Others** in the Settings menu.

XYZ disp    Fast/Norm/Slow/+ENT  
              Defines speed to move to the next screen after showing XYZ of the input PT


2nd Unit    None/Meter/US-Ft/I-Ft  
              When the Secondary unit is set to a unit, an extra display screen is available in the BMS, stakeout observation screens, and 2-pt reference line screens. The extra screen shows the HD, VD, and SD in the secondary unit.

**Note** – If you select US-Ft or I-Ft, an additional settings screen appears. Use this screen to specify whether to display values in Decimal-Ft or Ft-Inch.

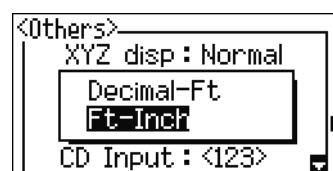


**Split ST** No/Yes  
Select Yes to separate the point numbers of station points from other record type point numbers

**Note** – If you set the *Split ST* field to Yes, an additional setting screen appears. Use this screen to specify the starting *ST* number.

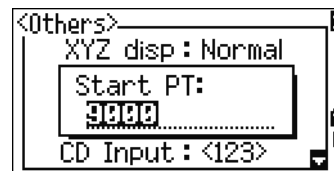

**CD Input** ABC/123  
Sets the default input mode when a CD field appears.


**Language** Select a language from the list.  
Press [←] / [→] to open the select language screen.

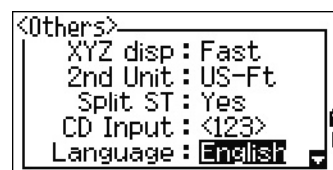

Press [↑] / [↓] to move the cursor to the desired language, and press [ENT] to select it.



Reboot confirmation screen appears.  
Press [ENT] and re-start the instrument, and the selected language will be available.

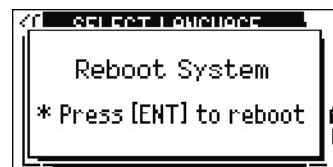

**Owner's Detail** Up to 20 characters.  
Enter your name or the name of your company. If you enter a value in this field, it appears at start-up.



**Tip** – To provide easier configuration for common regional settings, you can quickly configure the Nikon total station to a pre-set combination of default regional settings. For more information, see [Regional configuration, page 56](#).



**Tip** – The Nikon total station supports up to 3 languages on the instrument. For more information on changing the language settings, see [page 130](#).

## Data

Use the Data menu to view or edit records. To display the Data menu, press **[4]** on the MENU screen.



### Viewing records

**Note** – You can view data at any time, even in an observation screen or while entering points.


### Viewing raw data

To show the raw data records in a list, press **[1]** on the Data menu screen.

When you first view the raw data, the last four raw records in the current job are displayed. Use **[^]** or **[v]** to scroll through the records.

To see detailed information for the selected records, press **[ENT]**.

To return to the record list, press **[ESC]**.

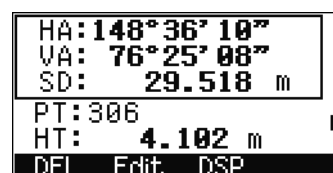

### SS, CP, F1 records

Raw SS, CP and F1 records contain PT, HT, CD, HA, VA, and SD fields.

SS records are sideshots (topo shots). All shots from the Basic Measurement Screen (BMS) are stored as SS records.

CP records are shots taken in the Angle or Repeat menus, or in the BMS. For more information, see [Recording a foresight point after repeat angle measurement, page 70](#), and [Recording data from any observation screen, page 99](#).

When the Store DB setting is set to RAW+XYZ, press **[DSP]** to switch between the first screen (showing HA, VA, SD, PT, and HT) and the second screen (showing X, Y, Z, PT, and CD).

Coordinates are not available in F1 records.

When you take more than one measurement to the same point and choose to overwrite the XYZ data, the old raw record becomes raw data only. As a result, only one SS(RAW) record keeps its corresponding SS(XYZ) record. Other SS(RAW) records to the same point no longer have coordinates available.

### ST records

ST (station) records contain ST, HI, BS, and AZ fields.

Press **[DSP]** to switch between the first screen (showing ST, HI, BS, and AZ) and the second screen (showing X, Y, Z, PT, and CD).

When you assign a new ST point name in **MENU > Stn Setup > Quick**, the coordinates of the station is recorded as (0, 0, 0).

### SO records

SO records are stakeout shots. These are shots recorded in stakeout functions.


When the Store DB setting is set to RAW+XYZ, press **[DSP]** to switch between the first screen (showing HA, VA, SD, PT, and HT), the second screen (showing X, Y, Z, PT, and CD), and the third screen (showing dX, dY, dZ, PT, and CD).

The dX, dY, and dZ fields store the difference between the stakeout shot's actual position and its planned position. These fields are downloaded as comment records in Nikon RAW format.

### CO records


A CO record is a comment added to the job from the system.

For example, when you change the Stn-Z using the Remote Benchmark function, or you reset the horizontal angle using the BSCheck function, the system writes a comment record.

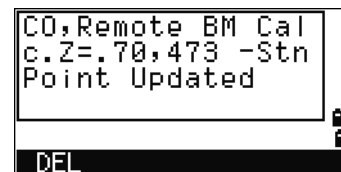

```
CO, Remote BM Cal
c.Z=.70,473 -Stn
Point Updated
DEL
```


When you input a Stn-XYZ by Base-XYZ function, the recorded station appears as a comment record.

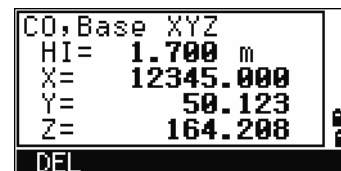

```
CO, Base XYZ
HI= 1.700 m
X= 12345.000
Y= 50.123
Z= 164.208
DEL
```

### SY records

When you complete a station setup, a SY record is stored. This record contains the Temperature, Pressure, and Prism Constant values.

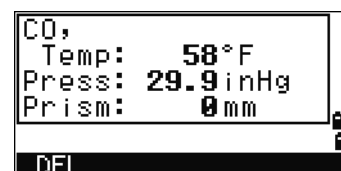

```
CO,
Temp: 58°F
Press: 29.9 inHg
Prism: 0 mm
DEL
```


## RM records

When you record measurements in RDM (Cont) or RDM (Rad), they are labeled as RM records.

Each RM record consists of two screens.


Press **[DSP]** to switch between the first screen (showing From, To, rHD, and rVD) and the second screen (showing rAZ, rSD, rV%, and rGD).

When you download data in Nikon RAW format, RM records are output as comment (CO) records.

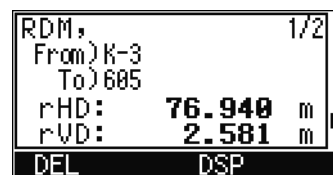

```

RDM, 1/2
From) K-3
To) 605
rHD: 76.940 m
rVD: 2.581 m
DEL DSP
  
```

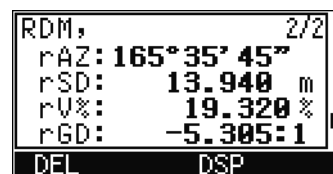

```

RDM, 2/2
rAZ: 165°35'45"
rSD: 13.940 m
rV%: 19.320 %
rGD: -5.305:1
DEL DSP
  
```

## AR records

An AR record stores an area and perimeter calculation.

When you download data in Nikon RAW format, AR records are output as comment (CO) records.



```

Name: SITE35-A
Area : 158.660 m²
Perim : 339.209 m
DEL
  
```

## View coordinate data


When you press **[2]** or select **XYZ data** in the Data menu, coordinate data appears in a list, with the newest record at the bottom of the screen. Use **[▲]** or **[▼]** to scroll through the records. Use **[←]** or **[→]** to move up or down one page.

Press **[ENT]** to see more detailed information about the selected record.



```

XYZ
MP, 54, KERB
UP, 2001,
UP, 2002,
UP, 2003, MANHOLE
UP, 2004,
DEL Edit Srch Input
  
```

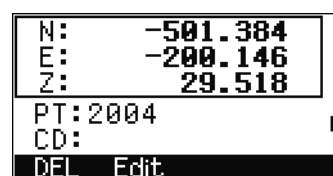

```

N: -501.384
E: -200.146
Z: 29.518
PT: 2004
CD:
DEL Edit
  
```

**Note** – The header (XYZ, YXZ, NEZ, or ENZ) depends on the Coord. Label setting in **MENU > Settings > Coord.** For more information, see [Coordinate](#), page 127.

## UP, MP, CC, and RE records

All coordinate records contain PT, CD, X, Y, and Z fields.

UP records are uploaded point coordinates. MP records are manually input point coordinates. CC records are points calculated in Cogo, and RE records are points calculated in Resection.

When the Store data setting is set to RAW+XYZ or to XYZ, shots in the BMS (SS records), in various O/S functions (SS records), in 2Pt-RefLine and Arc-RefLine in PRG (SS records) and in some Stakeout functions (SO records) store coordinate records as well. The format of the data is the same as other coordinate records.

### View records by station

To view records by station, press **[3]** or select ST→SS/SO/CP in the Data menu.




A list of all stations appears.


Use **[↑]** or **[↓]** to highlight the station name that you want to view. Use **[←]** or **[→]** to move up or down one page.



To view detailed information about the selected station, press **[ENT]**.

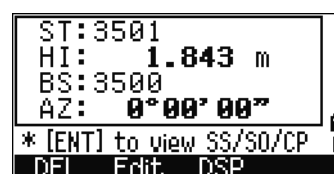

To display all the observation data from the selected station in chronological order, press **[ENT]** again.

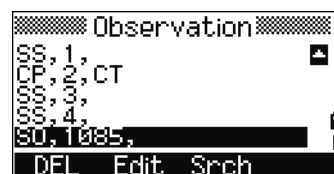

**Note** – Detailed data is as for raw data. For detailed information about each point type and format, see [Viewing raw data, page 131](#).

## Deleting records

### Deleting raw records

In the RAW screen, use **[↑]** or **[↓]** to highlight the record that you want to delete. Then press the **DEL** softkey.




A confirmation screen appears. To delete the selected record, press **[ENT]** or the **Yes** softkey.





**Note** – If the Store DB setting is set to Both, the system also deletes the corresponding coordinate data when you delete an SS, SO, or CP record. You can also delete raw data by pressing the **DEL** softkey in the detailed display screen for the record.

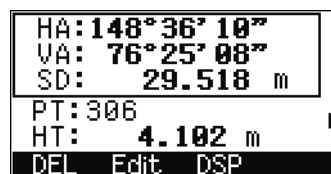


### Deleting coordinate records

In the XYZ screen, use **[^]** or **[v]** to highlight the record that you want to delete. Then press the **DEL** softkey.




A confirmation screen appears.

To delete the selected record, press **[ENT]** or the **Yes** softkey.

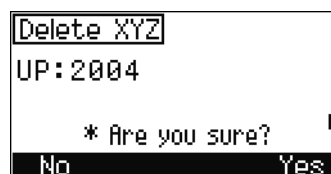


To cancel the deletion of data, press **[ESC]** or the **No** softkey.

**Note** – You can also delete coordinate data by pressing the **DEL** softkey in the detailed display screen for the record.

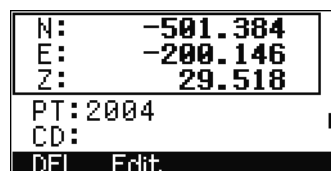

**Note** – If the record that you want to delete is referred by an ST record, a confirmation message appears.

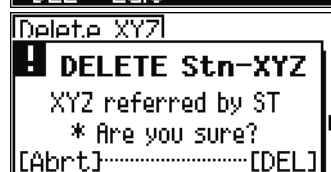


### Deleting station records

In the Station screen, use **[^]** or **[v]** to highlight the record that you want to delete. Then press the **DEL** softkey.




A confirmation screen appears.

Press **[ENT]** or the **Yes** softkey to delete the selected record.

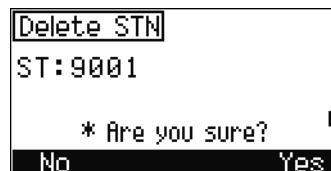


A reconfirmation screen appears. Press the **DEL** softkey to confirm deletion.

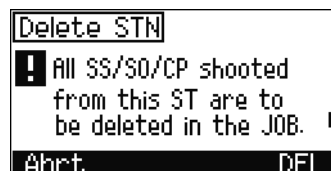

There is no undelete function on the instrument. Before you press the **DEL** softkey, make sure that you have selected the correct station record. You cannot press **[ENT]** in this screen.

All observations from the station that you selected are deleted.

**Note** – When you delete a *ST* record in the raw data view or the station data view, all the observation data from the station is also deleted.

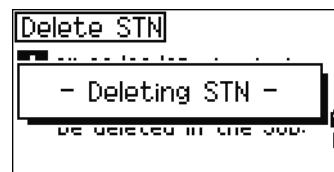

## Editing records


For any point record, you can edit the point name (PT), feature code (CD), height of target (HT), height of instrument (HI), backsight point (BS), and backsight azimuth (AZ).

**Note** – You cannot edit the *CD* field for *SO* or *F1* records.

**Note** – You cannot edit the *HA*, *VA*, or *SD* values.


## Editing raw records

- Do one of the following:
  - In the RAW screen, highlight the record that you want to edit. Then press the **Edit** softkey.
  - In the detailed data screen, press the **Edit** softkey.

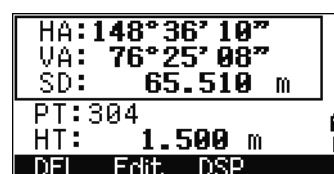


- Use **[↑]** or **[↓]** to highlight a field. Then modify the value in the selected field.

**Note** – When you change the *HT* of an *SS*, *SO*, or *CP* measurement record, its *Z* coordinate is recalculated.

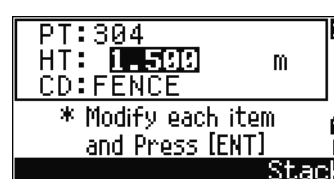


- When you press **[ENT]** on the last line of the edit screen, a confirmation screen appears.

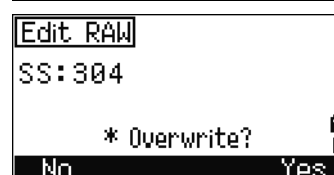

- Do one of the following:
  - To accept the changes and return to the data view screen, press **[ENT]** or the **Yes** softkey.

- To return to the edit screen, press **[ESC]** or the **No** softkey.

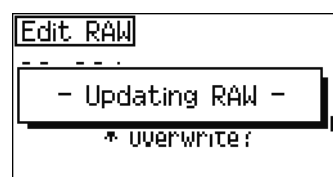


## Editing coordinate records


You can edit PT, CD, and coordinate values in coordinate records

**Note** – You cannot edit the coordinate record for the current station.


- Do one of the following:
  - In the XYZ screen, use **[^]** or **[v]** to highlight the record that you want to edit. Then press the **Edit** softkey.
  - In the detailed data screen, press the **Edit** softkey.
- Use **[^]** or **[v]** to highlight a field. Then modify the value in the selected field.
- To finish editing, press **[ENT]** in the CD field.

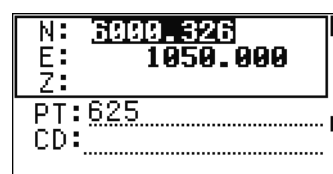

A confirmation screen appears.

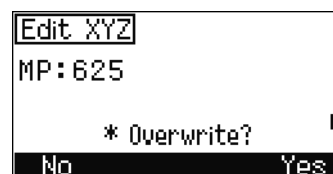

- Do one of the following:
  - To accept the changes and return to the data view screen, press **[ENT]** or the **Yes** softkey.
  - To go back to the edit screen, press **[ESC]** or the **No** softkey.

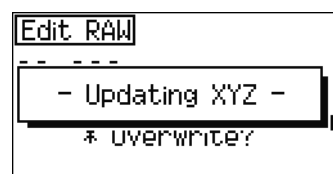

## Editing station records

**Note** – The system will not recalculate measurements if you change the station record. All coordinate and raw data observed from an edited station record must be recalculated in your postprocessing software.

In the RAW screen, use  $\square$  or  $\nabla$  to highlight the station record that you want to edit. Then press the **Edit** softkey.



You can edit any field in the ST record, but the instrument does not recalculate any measurements from this station.

Press **[ENT]** in the AZ field to confirm the change.



**Note** – If you change the ST or HI values, the coordinates of observation points are not recalculated. A comment record is stored to record the change. The following example shows a comment record for a changed HI value: CO, HI changed at ST:9012 Old HI= 1.345 m.

If you change the BS or AZ values, raw records are not recalculated. A comment record is stored to record the change.

## Searching records


You can search for records by their type, point name, code, or by any combination of these values.

### Searching raw records


In the RAW screen, press the **Srch** softkey to access the raw data search function.




To find a point by name, enter the name in the PT field and press **[ENT]** twice.

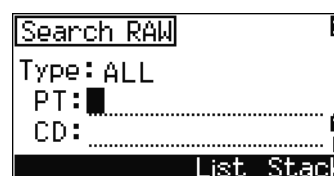

You can use the asterisk (\*) as a wildcard. For example, when you enter 30\* in the PT field, the search matches the points named 300, 301, 302, 3000A2, and 3010.

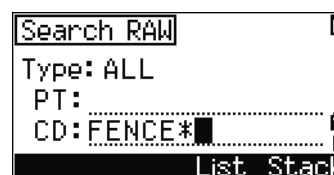

To search by point type, move to the Type field and use  $\leftarrow$  or  $\rightarrow$  to change the selected point type. The options are ALL, ST, SS, SO, CP, CO, CO(SY), and CO(RDM).

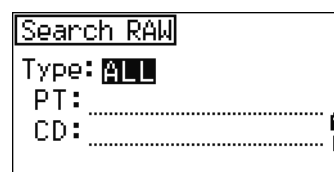

If you selected ST, SO or F1 in the Type field, you do not have to enter a value in the CD field. Press **[ENT]** in the PT field to start the search.

If you selected CO, CO(SY), or CO(RDM) in the Type field, you cannot enter a value in the PT or CD fields. Press **[ENT]** in the Type field to start the search.

If more than one point matches the search criteria, the matching points are displayed in a list.

Use **[^]** or **[v]** to highlight the point you want to use. Then press **[ENT]** to select it.

Detailed data for the selected record appears. Press the **DSP** softkey to change the fields shown.

Press **[ESC]** to return to the list.

**Note** – If no point matches the specified criteria, an error screen appears. Press any key to return to the data screen.

### Searching coordinate records

In the XYZ screen, press the **Srch** softkey to access the XYZ data search function.






To find a coordinate by name, enter the name in the PT field and press **[ENT]** twice.

You can use the asterisk (\*) as a wildcard. For example, when you enter 500\* in the PT field, the search matches the points named 500, 500-1, 500-A, and 5000.

**Note** – To search by point type, move to the Type field and use **[<]** or **[>]** to change the selected point type. The options are ALL, MP, UP, CC, and RE.

If more than one point matches the search criteria, the matching points are displayed in a list.

Use **[^]** or **[v]** to highlight the point you want to use. Press **[ENT]** to select it.

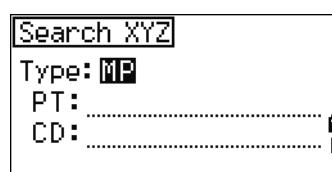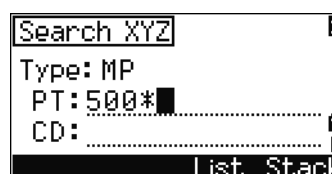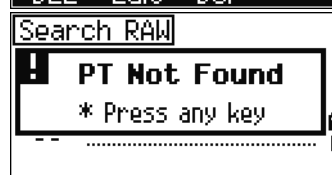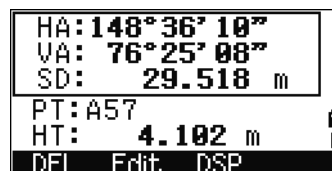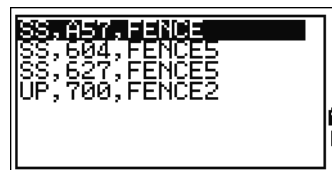

Detailed data for the selected record appears. Press the **DSP** softkey to change the fields shown.

Press **[ESC]** to return to the list.

If no point matches the specified criteria, an error screen appears. Press any key to return to the data screen.

## Entering coordinates

In the XYZ screen, press the **Input** softkey to display a new input point screen.

The PT field defaults to the last recorded PT + 1, but you can change the value shown.

Enter the PT and CD and then press **[ENT]** to enter coordinates.

Use the numeric keys to enter the coordinates. Press **[ENT]** or **[v]** in each field to move to the next field.

When you press **[ENT]** in the CD field, the point is stored as an MP record.

After you have recording a point, the next point input screen is shown with the updated default PT.

**Note** – You can record NE, NEZ, or Z-only data to the database.

## Point name list and code list


The instrument stores two list files: a list of PT names and a list of CD names. The structure and functionality of these files is the same.

- The **PT name list** is useful if you have to handle more than one patterns of point names in the field. For example, you may need to use points named 1, 2, 3 ..., as well as points named A1, A2, A3 ....
- The **code list** is a prepared list of feature codes. You can use it to store your own codes.

Press [4] or select **PT name List** in the Data menu to open the point name list.

Press [5] or select **Code list** to open the code list.

The point or code names and layers are shown in alphabetic order. Use the four softkeys to customize the list.

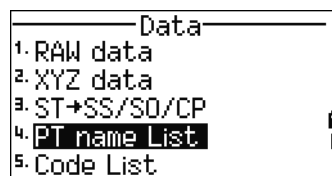


**Note** – You can store up to 254 points, codes, or layers in each list. Each list entry can be up to 16 characters long. You can use the first character search to find a point, code, or layer in the list. In the list screen, enter the first character of the name you want to find to jump to that part of the list. For more information, see [Advanced feature: Searching for a code using the first character, page 62](#).

### Deleting points, codes, or layers


In the point or code list, use [^] or [v] to highlight the item you want to delete. Then press the **DEL** softkey.




A confirmation screen appears. Press [ENT] or the **Yes** softkey to delete the item.

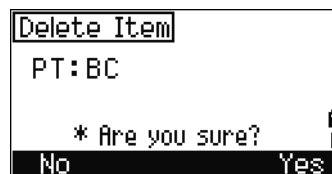

Press [ESC] or the **No** softkey to cancel the deletion.

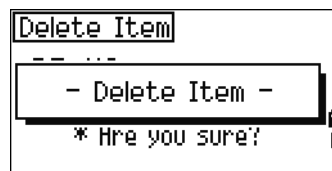

**Note** – To delete a whole layer, highlight the layer name in the list and press the **DEL** softkey. All codes and layers in the selected layer are deleted.

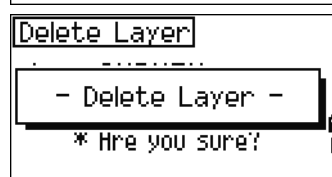

### Editing an item in the point list or code list

Use [^] or [v] to highlight the item that you want to edit. Then press the **Edit** softkey.



An editing screen appears. For points, the Edit Item screen appears. It contains only the PT field. For codes, the Edit Code screen appears, containing the CD field and the REC field.

Edit the text shown and then press **[ENT]**.

A confirmation screen appears. Press **[ENT]** or the **Yes** softkey to accept the changes and update the list.

### Edit code list

The Edit Code screen has two fields:

- The CD field contains the text that appears in the list screen. The REC field is optional. It contains the text that is stored in the job. If you leave the REC field blank, the value in the CD field is used.
- You can use the REC field to use familiar words or codes on the screen, but store a numeric code in the job. For example, if you set the CD field to MANHOLE and the REC field to 1155, the text MANHOLE appears on the screen, but the code 1155 is stored.

If you press the **Edit** softkey when a layer name appears, only the Lyr field appears. To save changes to the layer name, press **[ENT]** in the Lyr field.

### Adding a point name

In the point list, press the **Add** softkey to add a new point name to the current layer.

Enter a new point name and then press **[ENT]**.

The point name is added to the current layer and the list is updated.

Edit Item

PT: NO

\* Max 16 characters

Edit Item

NO

→ NO-

\* Overwrite?

No Yes

Edit Code

CD: MANHOLE

(REC: MANHOLE)

\* REC= Item for record ;  
can be diff. from CD

Edit Code

CD: MANHOLE

(REC: 1155)

\* REC= Item for record ;  
can be diff. from CD

Edit Layer

Lyr: SURFACE

\* MAX 16 characters

BC

EC

EP

IP

NO

P-50

DEL Edit Add Layer

Add Item

PT: KA

\* Max 16 characters

BC

EC

EP

IP

KA

NO

DEL Edit Add Layer





### Adding a code

In the code list, press the **Add** softkey to add a new feature code to the current layer.

Enter the feature code in the CD field. Press **(MODE)** to change between alphabetic and numeric input mode.

You can use the REC field to define a numeric identifier for each feature code. This is optional: If there is a value in the REC field, this value is stored. If you leave the REC field blank, the CD value is stored.

Press **(ENT)** to add the new code and update the code list.

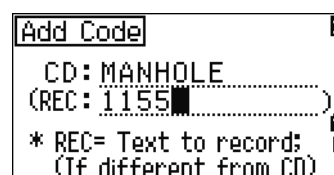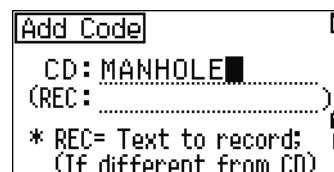


### Adding a layer

1. In the point or code list, press the **Layer** softkey.

2. Enter the name of the new layer.

3. To change between alphabetic and numeric input mode, press **(MODE)**. To store the new layer, press **(ENT)**.

The new layer is added to the list in alphabetic order.

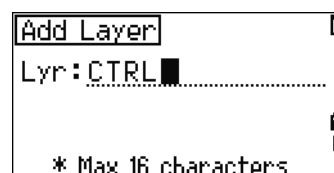


## Communication

Use the Communication menu to download or upload data. To display the Communication menu, press [5] or select Comm. on the MENU screen.




### Downloading data

To go to the download settings screen, press [1] or select Download in the Communication menu.

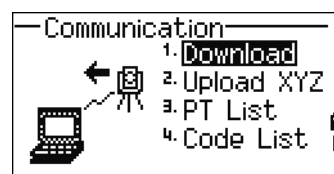


Format      NIKON  
SDR2x  
SDR33

Data        RAW  
Coordinate  
To display the total number of records that will be downloaded, press [ENT] in the Data field.

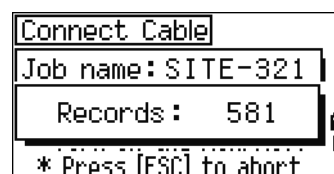


### Optional Bluetooth function

When the optional Bluetooth is installed, Port selection screen appears when pressing the Comm softkey.

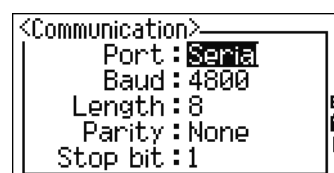


As each record in the current job is output from the instrument (downloaded), the current line number is updated.

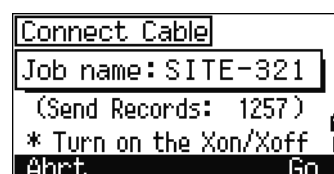


After downloading is completed, you can choose to delete the current job.

To delete the current job, press [4]. To return to the Basic Measurement Screen (BMS), press [ESC] or the **Abt** softkey.

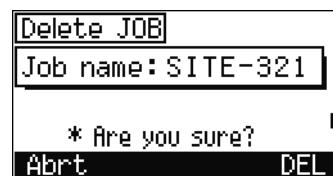


## Uploading coordinate data

To upload coordinate data from a computer, press [2] or select **Upload XYZ** in the Communication menu.

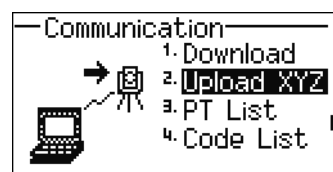


The default data format appears. To change the order of data fields, press the **Edit** softkey. For more information, see [Advanced feature: Editing the data order for upload, page 146](#).

Otherwise, just press [ENT].

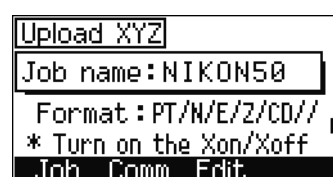


**Note** – Press the **Job** softkey to go to the Job Manager screen. For more information, see [Job Manager, page 110](#).

To change the communication settings, press the **Comm** softkey. The serial port settings must match the settings used by the terminal software on the computer.

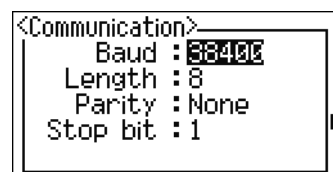

Port selection field appears in the Communication menu only when the optional Bluetooth is on-board.

Use an RS-232C cable to connect the instrument to the computer.

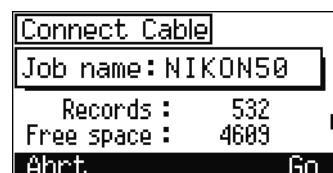

The Free space field shows the number of points that can be stored.

Press [ENT] to put the instrument in receive mode. Then use the Send Text File command in the terminal program on the computer to start sending data.

**Note** – In the terminal program, set flow control to Xon/Xoff.

As each point is received by the instrument, the value in the Records field is incremented.

**Note** – If you press [ESC] during data upload, the upload is canceled and the display returns to the Communication menu. Records that were received before you pressed [ESC] are stored in the job.





The system truncates any code that is longer than 16 characters.

## Duplicate points

If the existing point is a UP, CC, or MP record, and it is not referred to by any ST or BS, it is automatically overwritten by the uploaded point. No error message appears.

## Advanced feature: Editing the data order for upload

1. To open the Data Fields screen, press the **Edit** softkey.
2. To move between the fields, press **[←]** or **[→]**.
3. To change the selected item in a field, use the **[↑]** and **[↓]** softkeys. The options are PT, N, E, Z, CD, or blank.
4. To save your changes and return to the previous screen, press the **Save** softkey.

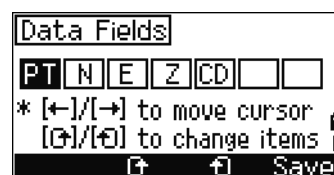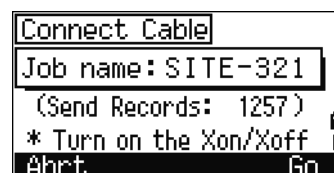

For example, if your original data is as follows:

1, UB, 30.000, 20.000, L1

and you set the data fields to PT N E CD, then the uploaded data is:

PT=1, N=30.000, E=20.000, CD=L1

## Uploading coordinates without points

You can upload data without points. If you do not include a point in the format definition, each line of data is automatically assigned the next available point number. To help you to select points in the field, make sure that you store an identifier in the CD field.


**Note** – The data format cannot include duplicate items. Use PT, N, E, Z and CD once each in the data format. To skip some items in your original file, set the corresponding field to blank.

## Uploading a point name list or code list

**Note** – When you upload a code list, it always replaces the existing code list on the instrument.

To upload a point name list via cable, press **[3]** or select **PT List** in the Communication menu.

To upload a code list, press [4] or select Code List.

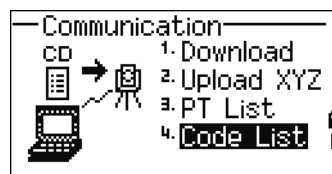

Connect the RS-232C cable.

Start a terminal program on the computer.


To put the instrument into receive mode, press [ENT] or the OK softkey.



The counter is updated as each line in the list is stored.


You can store up to 254 codes or point names.

**Note** – If a code or point name is longer than 16 characters, it is truncated.

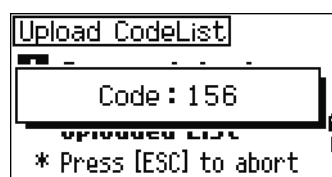


## 1sec-Keys

Use the 1sec-Keys menu to configure the settings for the one-second keys, [MSR], [DSP], [USR], [S-O], and [DAT]. To access this menu, press [6] or select 1sec-Keys in the MENU screen.

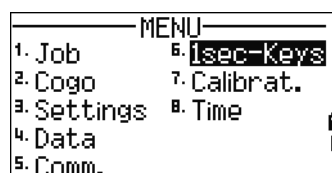


### [MSR] key settings

To change settings for the [MSR1] and [MSR2] keys, press [1] or select [MSR] in the 1sec-Keys menu.

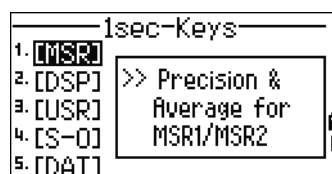


There are two [MSR] keys:

- To change the settings for the [MSR1] key, press [1] or select MSR1.
- To change the settings for the [MSR2] key, press [2] or select MSR2.

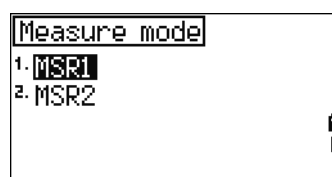

Each [MSR] key has five settings.

In the Const and AVE fields, use the numeric keys to enter values. In the other fields, use [◀] or [▶] to change the settings.

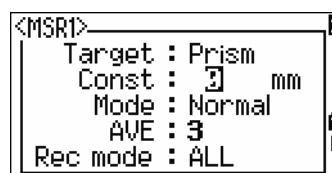


**Tip** – You can also access the settings screen by holding down [MSR1] or [MSR2] for one second.

**DSP key settings**

To change the display items in the BMS and in Stakeout observation screens, press **[2]** or select **[DSP]** in the 1sec-Keys menu.

To move the cursor, use **[←]**, **[→]**, **[↑]**, or **[↓]**. To change the display item, press either the **[G]** softkey or the **[H]** softkey.

To save the changes, press **[ENT]** at the last line of <DSP3> or press the **Save** softkey.

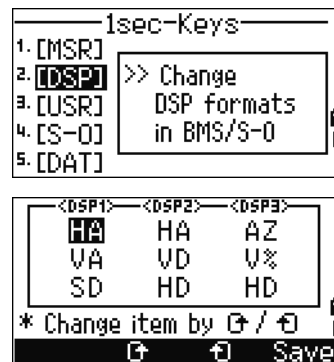

**Tip** – You can also access the DSP settings screen by holding down **[DSP]** for one second.

**USR key settings**



To change the functions that are assigned to the **[USR1]** and **[USR2]** keys, press **[3]** or select **[USR]** in the 1sec-Keys menu.

There are two **[USR]** keys. The function that is assigned to each key appears beside the key name.


- To change the settings for the **[USR1]** key, press **[1]** or select **USR1**.
- To change the settings for the **[USR2]** key, press **[2]** or select **USR2**.

In the Select Functions screen, the asterisk (\*) indicates the function that is currently assigned to the key.

To highlight a function, use **[↑]** or **[↓]**. To assign that function to the selected **[USR]** key, press **[ENT]**.

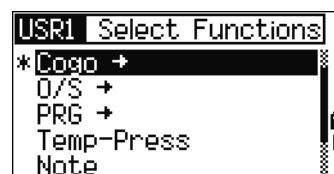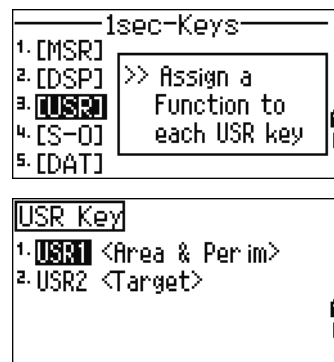**S-O key settings**

To enter the Stakeout settings screen, press **[4]** or select **[S-O]** in the 1sec-Keys menu.

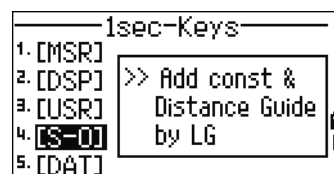


There are two Stakeout settings. For more information, see [Stakeout](#), page 128.




### **[DAT]** key settings

1. To change the settings for the [DAT] key, press [5] or select [DAT] in the 1sec-Keys menu.

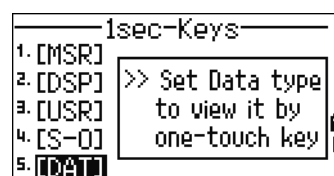

The asterisk (\*) indicates the currently selected view format.

2. To move the cursor, use [▲] or [▼].
3. To change the format displayed by [DAT], press [ENT].

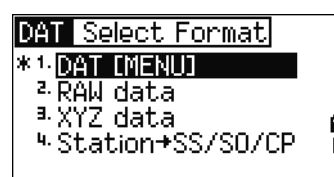

## Calibration

Use the Calibration screen to calibrate the instrument. To open the Calibration screen, press [7] or select **Calibrat.** on the MENU screen.

For more information, see [Adjusting](#), page 153.



## Time


Use the Date & Time screen to set the current date and time.

1. To open the Date & Time screen, press [8] or select **Time** on the MENU screen.




The current date and time settings are displayed.

2. Enter the date in Year-Month-Day format. For example, to change the date to June 18, 2008, press [2][0][0][8][ENT][6][ENT][1][8][ENT].

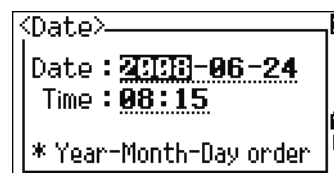

If the highlighted part of the field (for example, the year) is already correct, you can just press [ENT] to use the current value. For example, if the date is already set to June 24, 2008, and you want to change the date to June 18, 2008, press [ENT][ENT][1][8][ENT].

3. To move to the Time field, press **[ENT]** in the Date field.
4. Enter the time in 24-hour format. For example, to set the time to 4:35 PM, press **[1][6][ENT][3][5][ENT]**.
5. Do one of the following:
  - To finish setting the date and time, press **[ENT]** in the Minutes field.
  - To cancel the input, press **[ESC]**.

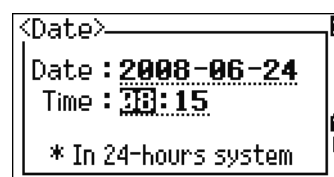



# Checking and Adjustment

**In this chapter:**

- Adjusting the electronic level
- Checking and adjusting the circular level
- Checking and adjusting the optical/laser plummet
- Zero point errors of vertical scale and horizontal angle corrections
- Checking the instrument constant
- Checking the laser pointer

This chapter describes how to check the accuracy of the Focus 6 2" total station, and if necessary, adjust the required settings.

## Adjusting the electronic level

Adjustment of the electronic level is done by Zero point errors of vertical scale and horizontal angle corrections. For detailed instruction, please see [page 153](#).

## Checking and adjusting the circular level

Once you have checked and adjusted the electronic level, check the circular level.

If the bubble is not in the center of the level, use the adjusting pin to rotate the three adjustment screws of either circular level on the instrument main body or tribrach until the bubble is centered.



## Checking and adjusting the optical/laser plummet

The optical axis of the plummet must be aligned with the vertical axis of the instrument.

To check and adjust the optical/laser plummet:

1. Place the instrument on the tripod. You do not have to level the instrument.
2. Place a thick sheet of paper marked with an X on the ground below the instrument.

While you are looking through the optical plummet, adjust the leveling screws until the image of the X is in the center of the reticle mark ☉.



For laser plummet, adjust the laser pointer to the X.

3. Rotate the alidade 180°.

If the marked image is in the same position in the center of the reticle mark, no adjustment is required.

For laser plummet, if the laser pointer is on the X, no adjustment is required.

4. If the image or laser pointer is not in the same position, adjust the optical or laser plummet:

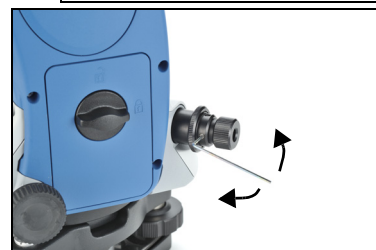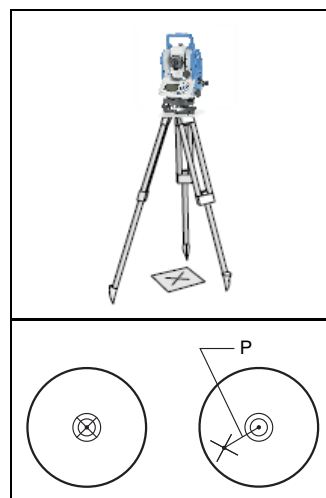

- a. Use the supplied hexagonal wrench to turn the adjustment screws until the image of the X is in Position P. Position P is the center point of the line connecting the X and the center of the reticle mark ☉.
- b. Repeat from [Step 2](#).  
For laser plummet adjustment, a cap needs to be removed.

## Zero point errors of vertical scale and horizontal angle corrections

### Checking

1. Set up the instrument on the tripod.
2. Follow the leveling procedures described in [Leveling the instrument](#), page 31.
3. Flip the telescope to the Face-1 position.
4. Sight a target that is within 45° of the horizontal plane.
5. Read the vertical angle from the VA1 field in the Basic Measurement Screen (BMS).
6. Rotate the instrument 180° and flip the telescope to the Face-2 position.
7. Read the vertical angle from the VA2 field.
8. Add the two vertical angles together, VA1 + VA2.
  - No adjustment is required if the zero reference for vertical angles (VA zero setting) is set to Zenith, and VA1 + VA2 equals 360°.
  - No adjustment is required if the zero reference for vertical angles (VA zero setting) is set to Horizon, and VA1 + VA2 is either 180° or 540°.
  - An adjustment is required if VA1 + VA2 is not one of the values listed above.

**Note** – The difference between the vertical angle reading the relevant angle (either 360° for Zenith, or 180° or 540° for Horizon) is called the **altitude constant**.


### Adjusting

To enter the calibration screen, press **[MENU]** and **[7]**.




1. The Focus 6 2" total station has two-axis level compensation. Take an F1 measurement to a target on the horizon. Press **[ENT]**.

The vertical angle is shown in the  
V0 dir= Horiz setting.

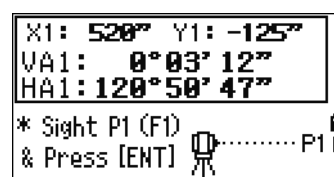


- VA1 Face-1 vertical angle (tilt-off value)
- HA1 Face-1 horizontal angle (tilt-off value)
- X1 Face-1 X axis tilt value
- Y1 Face-1 Y axis tilt value

When you have taken the measurement, the message on the bottom line changes from DO NOT TOUCH! to Turn to F2.

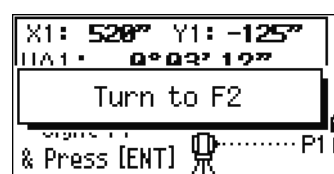


2. Take an F2 measurement to the same target. Press **[ENT]**.

- VA2 Face-2 vertical angle (tilt-off value)
- HA2 Face-2 horizontal angle (tilt-off value)
- X2 Face-2 X axis tilt value
- Y2 Face-2 Y axis tilt value

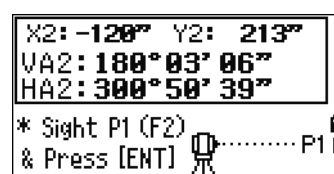


When the observation on F2 is completed, four parameters are displayed.

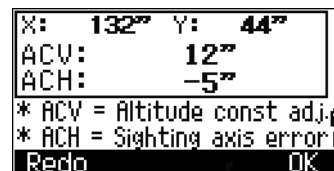

3. Do one of the following:
  - To return to the first observation screen, press **[ESC]** or the Redo softkey.
  - To set parameters on the instrument, press **[ENT]** or the OK softkey.


**Note** – If ACV, ACH, X, or Y is out of range, OVER appears. Press any key to return to the first observation screen.

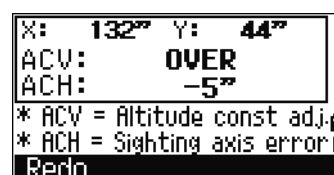

## Checking the instrument constant

The instrument constant is a numerical value used to automatically correct for the displacement between the mechanical and electrical centers when measuring distances. The instrument constant is set by the manufacturer before the instrument is shipped. However, to ensure the highest operational accuracy, we recommend that you check the instrument constant several times a year.

To check the instrument constant, you can either compare a correctly measured base line with the distance measured by the EDM, or follow the procedure below.

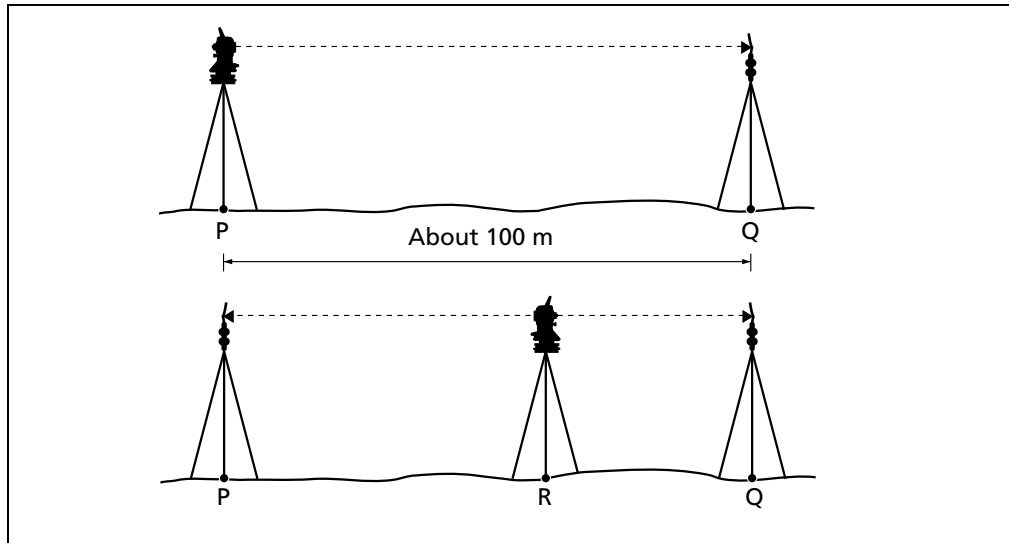

To check the instrument constant:

1. Set up the instrument at Point P, in as flat an area as possible.
2. Set up a reflector prism at Point Q, 100 m away from Point P. Make sure that you take the prism constant into account.
3. Measure the distance between Point P and Point Q (PQ).
4. Install a reflector prism on the tripod at Point P.
5. Set up another tripod at Point R, on the line between Point P and Point Q.
6. Transfer the Focus 6 2" series instrument to the tripod at Point R.
7. Measure the distance from Point R to Point P (RP), and from Point R to Point Q (RQ).
8. Calculate the difference between the value of PQ and the value of  $RP + RQ$ .
9. Move the Focus 6 2" series instrument to other points on the line between Point P and Point Q.
10. Repeat [Step 5](#) through [Step 9](#) ten times or so.
11. Calculate the average of all the differences.

The error range is within 3 mm. If the error is out of range, contact your dealer.

## Checking the laser pointer

The Focus 6 2" total station total station uses a red laser beam to a laser pointer. The laser pointer is coaxial with the line of sight of the telescope. If the instrument is well adjusted, the red laser pointer coincides with the line of sight. External influences such as shock or large temperature fluctuations can displace the red laser pointer relative to the line of sight.

# Specifications

## In this chapter:

- [Main body](#)
- [Standard components](#)
- [External device connector](#)

This chapter details the specifications and standard components of the Focus 6 2" total station. It also describes the connector that is used to connect the instrument to an external power source or to communicate with an external device.

## Main body

### Telescope

|  |  |
|--|--|
| <b>Tube length</b>                     | 125 mm (4.91 in.)                          |
| <b>Magnification</b>                   | 30 X                                       |
| <b>Effective diameter of objective</b> | 40 mm (1.57 in.)<br>EDM 45 mm (1.77 in.)   |
| <b>Image</b>                           | Erect                                      |
| <b>Field of view</b>                   | 1°20'<br>2.3 m at 100 m (2.3 ft at 100 ft) |
| <b>Resolving power</b>                 | 3.0"                                       |
| <b>Focusing distance</b>               | 1.5 m to infinity (4.92 ft to infinity)    |

### Measurement range

Distances shorter than 1.5 m (4.92 ft) cannot be measured with this EDM.

#### Measurement range with no haze, visibility over 40 km (25 miles)

##### Prism mode

|                               |                    |
|-------------------------------|--------------------|
| Reflector sheet (5 cm x 5 cm) | 270 m (886 ft)     |
| Standard prism (1P)           | 3,000 m (9,840 ft) |

##### Reflectorless mode

|                  |                |
|------------------|----------------|
| Reference target | 300 m (984 ft) |
|------------------|----------------|

- The target should not receive direct sunlight.
- “Reference target” refers to a white, highly reflective material. (KGC90%)
- The maximum measurement range is 500 m in the reflectorless mode.

### Distance precision

#### Precise mode

**Prism**  $\pm (2 + 2 \text{ ppm} \times D) \text{ mm}$  (–20 °C to +50 °C)

**Reflectorless**  $\pm (3 + 2 \text{ ppm} \times D) \text{ mm}$  (–20 °C to +50 °C)

#### Normal mode

**Prism**  $\pm (10 + 5 \text{ ppm} \times D) \text{ mm}$

**Reflectorless**  $\pm (10 + 5 \text{ ppm} \times D) \text{ mm}$

ISO17123-4 for Prism measurement



## Measurement intervals

Measurement intervals may vary with the measuring distance or weather conditions.  
For the initial measurement, it may take few more seconds.

|                                |                                |
|--------------------------------|--------------------------------|
| <b>Precise mode</b>            |                                |
| <b>Prism</b>                   | 1.6 sec.                       |
| <b>Reflectorless</b>           | 2.1 sec.                       |
| <b>Normal mode</b>             |                                |
| <b>Prism</b>                   | 0.8 sec.                       |
| <b>Reflectorless</b>           | 1.2 sec.                       |
| <b>Prism offset correction</b> | –999 mm to +999 mm (1 mm step) |

## Angle measurement

|                                  |  |
|----------------------------------|--|
| <b>Reading system</b>            | Absolute encoder<br>Diametrical reading on HA/VA |
| <b>Minimum display increment</b> |  |
| <b>360°</b>                      | 1''/5''/10''                                     |
| <b>400G</b>                      | 0.2 mgon/1 mgon/2 mgon                           |
| <b>MIL6400</b>                   | 0.005 MIL/0.02 MIL/0.05 MIL                      |
| <b>DIN18723 accuracy</b>         | 2''/0.6 mgon                                     |

## Tilt sensor

|                           |                                       |
|---------------------------|---------------------------------------|
| <b>Method</b>             | Liquid-electric detection (Dual axis) |
| <b>Compensation range</b> | ±3°                                   |

## Tangent screw

|             |                                     |
|-------------|-------------------------------------|
| <b>Type</b> | Friction clutch endless fine motion |
|-------------|-------------------------------------|

## Tribrach

|             |            |
|-------------|------------|
| <b>Type</b> | Detachable |
|-------------|------------|

## Level

|                            |                        |
|----------------------------|------------------------|
| <b>Electronic level</b>    | Displayed on the LCD   |
| <b>Circular level vial</b> | Sensitivity 10' / 2 mm |

## Optical plummet

|                       |                            |
|-----------------------|----------------------------|
| <b>Image</b>          | Erect                      |
| <b>Magnification</b>  | 3×                         |
| <b>Field of view</b>  | 5°                         |
| <b>Focusing range</b> | 0.5 m (1.6 ft) to infinity |

## Optional laser plummet

|                       |              |
|-----------------------|--------------|
| <b>Wave length</b>    | 635 nm       |
| <b>Laser class</b>    | Class 2      |
| <b>Focusing range</b> | ∞            |
| <b>Laser diameter</b> | Approx. 2 mm |

## Display and keypad

|                             |               |
|-----------------------------|---------------|
| <b>Display type</b>         | Graphical LCD |
| <b>Resolution</b>           | 128 × 64      |
| <b>Display illumination</b> | Backlight     |
| <b>Keys</b>                 | 25            |

## Connections in the base of instrument

|  |                        |
|--|------------------------|
| <b>Communications</b>                      |                        |
| <b>Type</b>                                | RS-232C                |
| <b>Maximum baud rate</b>                   | 38400 bps asynchronous |
| <b>External power supply input voltage</b> | 4.5 V DC to 5.2 V DC   |

## Battery pack

|  |                       |
|--|-----------------------|
| <b>Output voltage</b>                              | 3.8 V DC rechargeable |
| <b>Continuous operation time</b>                   |                       |
| <b>Continuous distance/angle measurement</b>       | 19 hours              |
| <b>Distance/angle measurement every 30 seconds</b> | 57 hours              |
| <b>Continuous angle measurement</b>                | 62 hours              |

Tested at 25 °C (nominal temperature). Operation times may vary depending on the condition and deterioration of the battery.

## Environmental performance

|                                    |  |
|------------------------------------|--|
| <b>Operating temperature range</b> | –20 °C through +50 °C (–4 °F through +122 °F)  |
| <b>Storage temperature range</b>   | –25 °C through +60 °C (–13 °F through +140 °F) |

## Dimensions

|                      |                                |
|----------------------|--------------------------------|
| <b>Main unit</b>     | 149 mm W x 145 mm D x 306 mm H |
| <b>Carrying case</b> | 435 mm W x 206 mm D x 297 mm H |

## Weight

|                               |                                  |
|-------------------------------|----------------------------------|
| <b>Main unit w/o battery</b>  | 3.8 kg (8.38 lbs), approximately |
| <b>Battery</b>                | 0.1 kg (0.22 lbs), approximately |
| <b>Carrying case</b>          | 2.4 kg (5.28 lbs), approximately |
| <b>Charger and AC adapter</b> | 0.4 kg (0.99 lbs), approximately |

## Environmental protection

|   |      |
|---|------|
| <b>Watertight/dust-proof protection</b> | IP66 |
|---|------|

## Standard components

- Instrument main body
- Battery pack (X 2)
- Universal charger, power cord, and adapters
- Adjustment pin, Allen wrench
- Objective lens cap
- Vinyl cover
- *Spectra Precision Focus 6 2" Total Station User Guide* (this document)
- Carrying case
- Shoulder strap (x 2)

## External device connector

This connector can be used to connect to an external power source or to communicate with an external device.

Before using the external device connector, make sure that the external device meets the specifications below.

|                                  |                                  |
|----------------------------------|----------------------------------|
| <b>Input voltage</b>             | 4.5 V to 5.2 V DC                |
| <b>System</b>                    | RS-232C                          |
| <b>Signal level</b>              | ±9 V standard                    |
| <b>Maximum baud rate</b>         | 38400 bps asynchronous           |
| <b>Compatible male connector</b> | Hirose HR10A-7P-6P or HR10-7P-6P |




**CAUTION** – Except for the connection shown in [Figure 8.1](#) on [page 166](#), use of this connector is at your own risk.



**CAUTION** – Use only the male connectors specified above. Using other connectors will damage the instrument.

The external device connector is a Hirose HR 10A-7R-6S female connector. The pinouts for connecting it to an external device connector are shown below:

| Pin | Signal | Description          |
|-----|--------|----------------------|
| 1   | RXD    | Receive data (Input) |
| 2   | TXD    | Send data (Output)   |
| 3   | NC     | No connection        |
| 4   | V      | Power                |
| 5   | GND    | Ground               |
| 6   | NC     | No connection        |

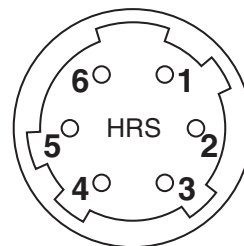

**CAUTION** – Use only the pin connections shown above. Using other connections will damage the instrument.



**CAUTION** – The Focus 6 2" total station total station has different pin assignment from other models of Nikon total station.

To connect to an external power source, supply power to Pin 4 (power terminal) and Pin 5 (ground terminal) on the instrument. The instrument will use the external power source even if the internal battery packs are attached.



**CAUTION** – Make sure that the power supplied is within the rated input range (4.5 V to 5.2 V DC, 1 A maximum). Power supplied outside this range will damage the instrument.

To communicate with an external device, connect the RS-232C signal from the external device to Pin 1 (input terminal) and to Pin 2 (output terminal) on the instrument.

Cap the data output/external power input connector securely while not in use. The instrument is not watertight if the cap is not attached or not attached securely, and when the data output/external power input connector is in use.

The instrument can be damaged by static electricity from the human body discharged through the data output/external power input connector. Before handling the instrument, touch any other conductive material once to remove static electricity.



# System diagrams

## In this chapter:

- [System components](#)

## System components

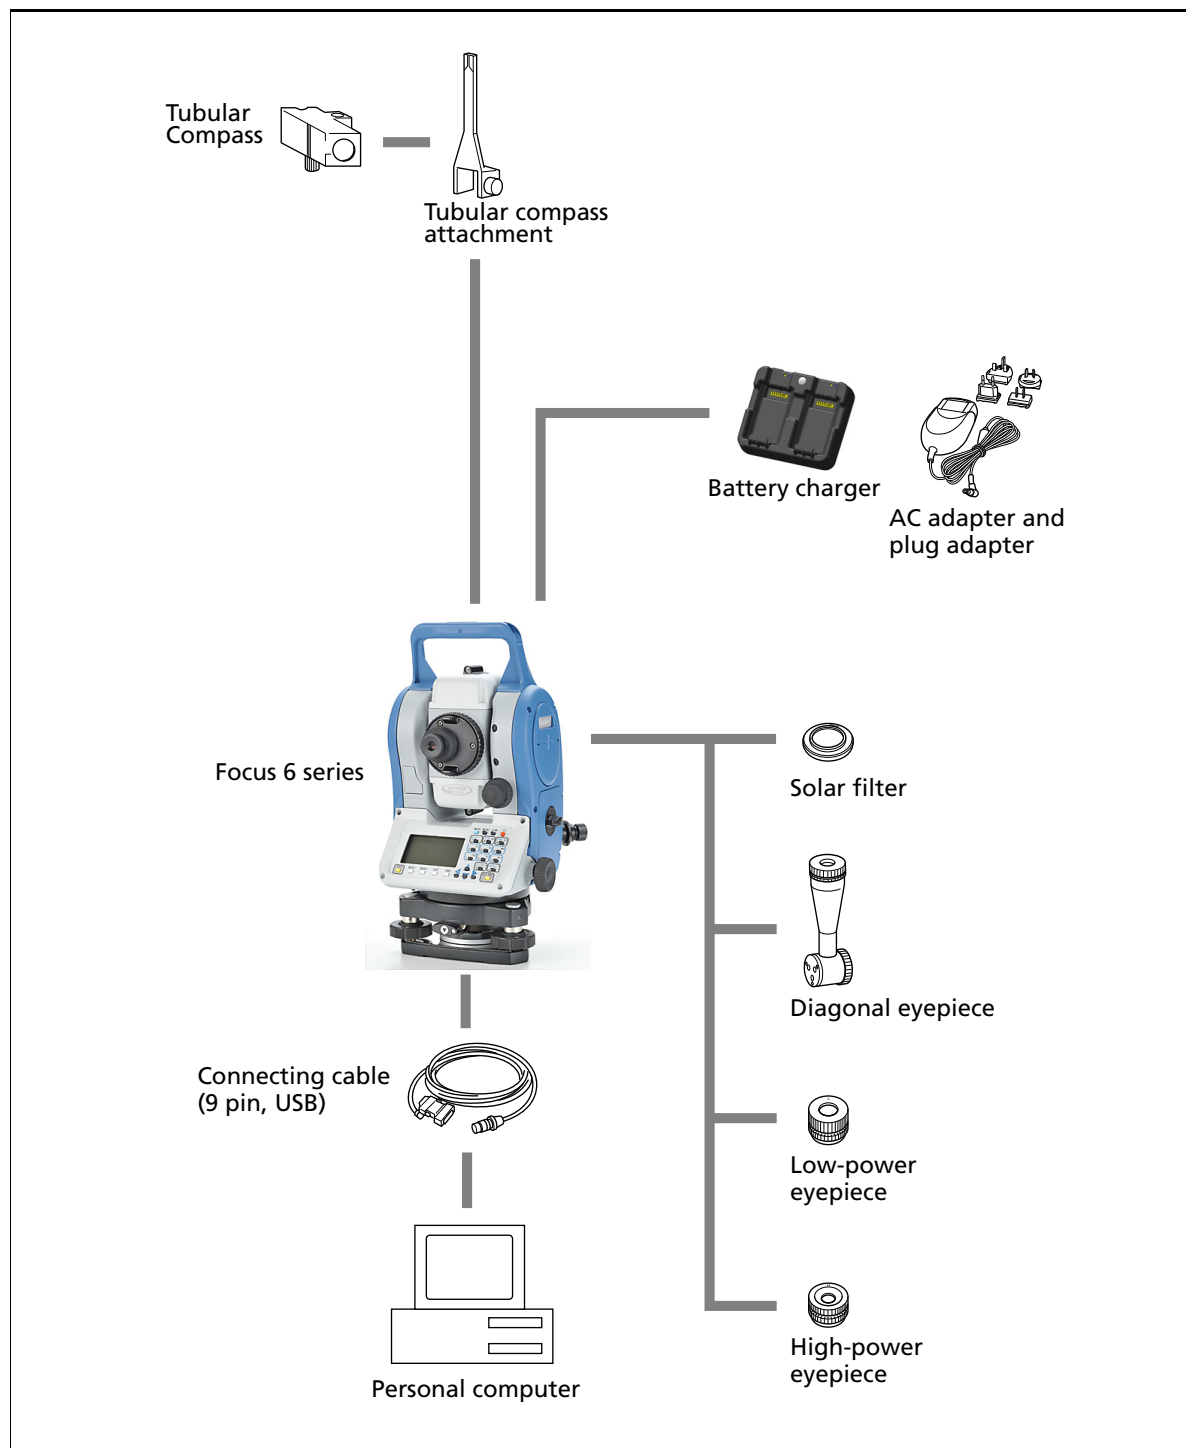


Figure 8.1 Measurement side



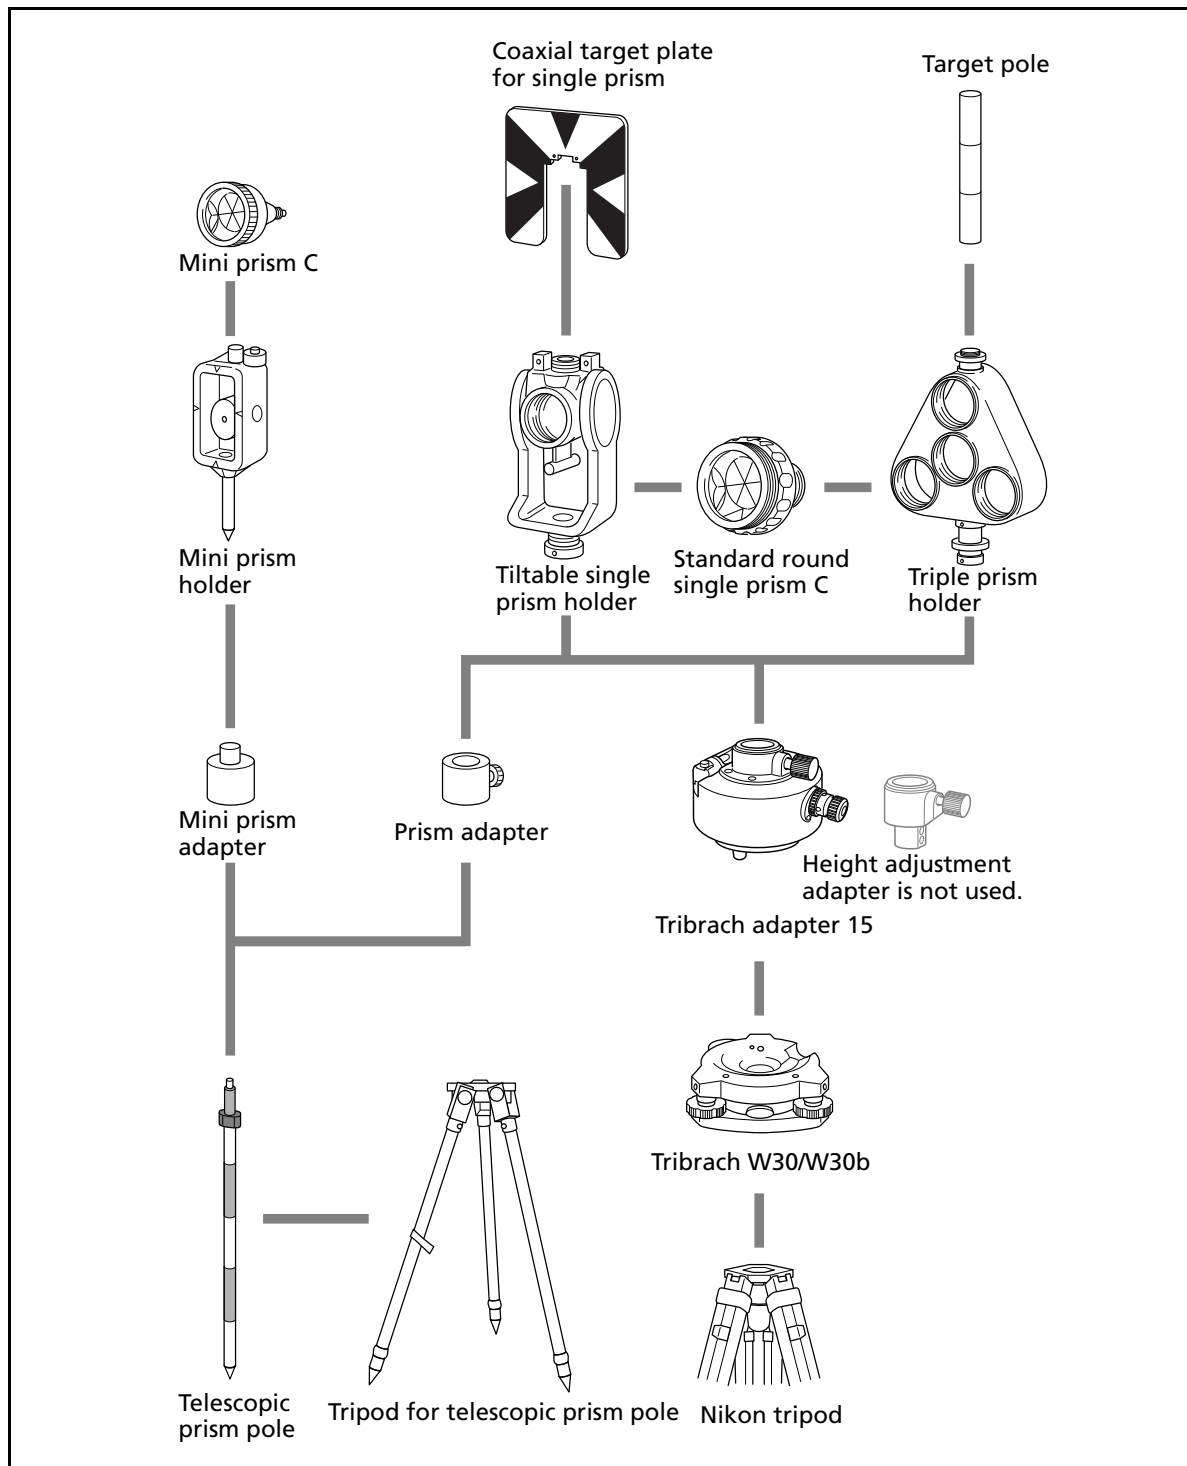


Figure 8.2 Prism reflector side

**Note** – The Focus 6 2" series must be used with the W30 or W30b tribrach.



# Communications


## In this chapter:

- Uploading coordinate data
- Uploading point lists and code lists
- Downloading data

## Uploading coordinate data

### Settings

To configure the transmission speed and other settings, go to **MENU** > **Settings** > **Comm**. For more information, see [Communications, page 128](#).

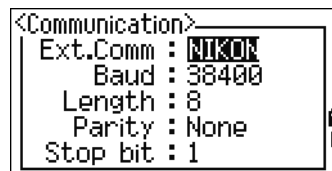

### Record format

You can upload coordinate records in the following formats:

|    |   |   |   |   |   |   |   |    |
|----|---|---|---|---|---|---|---|----|
| PT | , | X | , | Y | , | Z | , | CD |
|----|---|---|---|---|---|---|---|----|

|    |  |   |  |   |  |   |  |    |
|----|--|---|--|---|--|---|--|----|
| PT |  | X |  | Y |  | Z |  | CD |
|----|--|---|--|---|--|---|--|----|

|    |   |   |   |   |   |   |
|----|---|---|---|---|---|---|
| PT | , | X | , | Y | , | Z |
|----|---|---|---|---|---|---|

|    |  |   |  |   |  |   |
|----|--|---|--|---|--|---|
| PT |  | X |  | Y |  | Z |
|----|--|---|--|---|--|---|

|    |   |   |   |   |   |  |    |
|----|---|---|---|---|---|--|----|
| PT | , | X | , | Y | , |  | CD |
|----|---|---|---|---|---|--|----|

|    |  |   |  |   |  |    |
|----|--|---|--|---|--|----|
| PT |  | X |  | Y |  | CD |
|----|--|---|--|---|--|----|

|    |   |   |   |   |   |  |
|----|---|---|---|---|---|--|
| PT | , | X | , | Y | , |  |
|----|---|---|---|---|---|--|

|    |   |   |   |   |   |
|----|---|---|---|---|---|
| PT | , | X | , | Y | , |
|----|---|---|---|---|---|

|    |   |  |  |   |   |    |
|----|---|--|--|---|---|----|
| PT | , |  |  | Z | , | CD |
|----|---|--|--|---|---|----|

|    |   |  |  |   |
|----|---|--|--|---|
| PT | , |  |  | Z |
|----|---|--|--|---|

The record formats shown above use the following codes:

| Code | Description         | Length              |
|------|---------------------|---------------------|
| PT   | Point number        | Up to 20 digits     |
| X    | Actual X coordinate | Variable length     |
| Y    | Actual Y coordinate | Variable length     |
| Z    | Actual Z coordinate | Variable length     |
| CD   | Feature code        | Up to 16 characters |

#### Data example

```

20100,6606.165,1639.383,30.762,RKBSS
20104,1165611.6800,116401.4200,00032.8080
20105 5967.677 1102.343 34.353 MANHOLE
20106 4567.889 2340.665 33.444 PT1
20107 5967.677 1102.343 34.353
20109,4657.778,2335.667,,PT2
20111,4657.778,2335.667
20113 4657.778 2335.667
20115,,,34.353,MANHOLE
20117,,,33.444

```

## Uploading point lists and code lists

### Settings

To configure the transmission speed and other settings, go to **MENU** / **Settings** / **Comm**. For more information, see [Communications, page 128](#).



### File format

PT lists and code lists use the same record format. Use the filenames POINT.LST for a PT list, and CODE.LST for a code list.

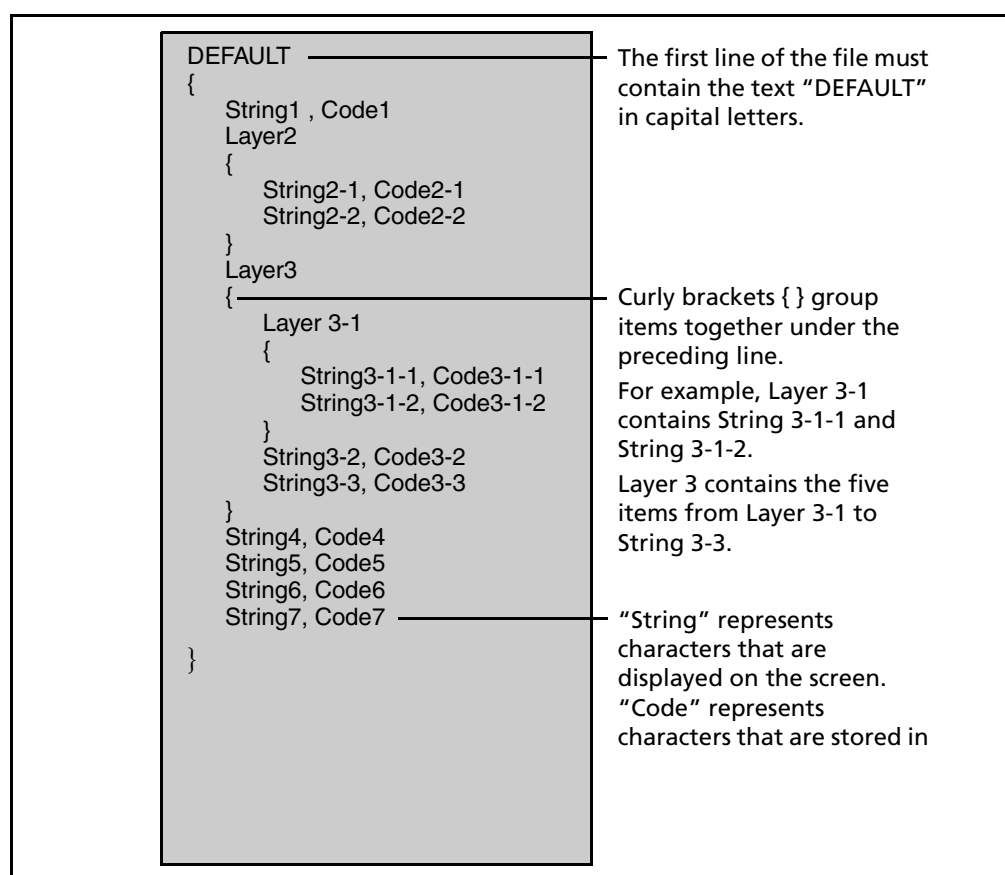


Figure 9.1 Record format for PT lists and code lists

## Data example

```

"STRUCTURES"
{
  "TREE", "S0001"
  "FENCE", "S0002"
  "MAIL BOX", "S0003"
  "FLOWER BED", "S0004"
}
"ROADS"
{
  "MANHOLE", "R0001"
  "CENTER LINE"
  {
    "WHITE", "R002-W"
    "YELLOW", "R002-Y"
  }
  "SIDEWALK", "R0003"
  "CROSSING", "R0004"
  "BRIDGE", "R0005"
  "SIGNAL", "R0006"
  "HIGHWAY STAR", "R0007"
}
"RAILWAY"
{
  "CROSSING", "RW001"
  "STATION", "RW002"
  "SIGNAL", "RW003"
  "BRIDGE", "RW004"
  "TUNNEL", "RW005"
}
}

```

# Downloading data

## Settings

To configure the transmission speed and other settings, go to **[MENU]** / **[Settings]** / **[Comm]**. For more information, see [Communications, page 128](#).



## Nikon raw record formats

### Coordinate records

|  |  |  |  |  |  |          |   |         |   |           |   |      |
|--|--|--|--|--|--|----------|---|---------|---|-----------|---|------|
|  |  |  |  |  |  | northing | , | easting | , | elevation | , | code |
|--|--|--|--|--|--|----------|---|---------|---|-----------|---|------|

|           |                             |
|-----------|-----------------------------|
| type      | One of the following codes: |
| <b>UP</b> | Uploaded point              |
| <b>MP</b> | Manually input point        |
| <b>CC</b> | Calculated coordinate       |
| <b>RE</b> | Resection point             |
| pt        | Point number                |
| (pt id)   | (Point ID)                  |
| northing  | Northing of the coordinate  |
| easting   | Easting of the coordinate   |
| elevation | Elevation of the coordinate |
| code      | Feature code                |

### Station records

|           |  |  |  |  |  |      |   |         |   |    |   |        |   |      |
|-----------|--|--|--|--|--|------|---|---------|---|----|---|--------|---|------|
| <b>ST</b> |  |  |  |  |  | bspt | , | (bs id) | , | hi | , | bsazim | , | bsha |
|-----------|--|--|--|--|--|------|---|---------|---|----|---|--------|---|------|

|           |  |
|-----------|--|
| <b>ST</b> | Station record identifier (fixed text) |
| stnpt     | Station point number                   |
| (stn id)  | (Station ID)                           |
| bspt      | Backsight point number                 |
| (bs id)   | (Backsight ID)                         |
| hi        | Height of instrument                   |
| bsazim    | Backsight azimuth                      |
| bsha      | Backsight horizontal angle             |



### Control point records

|           |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|
| <b>CP</b> |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|

|           |  |
|-----------|--|
| <b>CP</b> | Control point record identifier (fixed text) |
| pt        | Point number                                 |
| (pt id)   | (Point ID)                                   |
| ht        | Height of target                             |
| sd        | Slope distance                               |
| ha        | Horizontal angle                             |
| va        | Vertical angle                               |
| time      | 24-hour time stamp                           |
| code      | Feature code                                 |

### Sideshot records

|           |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|
| <b>SS</b> |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|

|           |   |
|-----------|---|
| <b>SS</b> | Sideshot record identifier (fixed text) |
| pt        | Point number                            |
| ht        | Height of target                        |
| sd        | Slope distance                          |
| ha        | Horizontal angle                        |
| va        | Vertical angle                          |
| time      | 24-hour time stamp                      |
| code      | Feature code                            |

### Stakeout records

|           |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|
| <b>SO</b> |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|

|           |   |
|-----------|---|
| <b>SO</b> | Stakeout record identifier (fixed text) |
| pt        | Recorded point number                   |
| (sopt)    | (Original number of point staked)       |
| ht        | Height of target                        |
| sd        | Slope distance                          |
| ha        | Horizontal angle                        |
| va        | Vertical angle                          |
| time      | 24-hour time stamp                      |

**F1 records**

|      |   |    |   |    |   |    |   |    |   |    |   |      |
|------|---|----|---|----|---|----|---|----|---|----|---|------|
| face | , | pt | , | ht | , | sd | , | ha | , | va | , | time |
|------|---|----|---|----|---|----|---|----|---|----|---|------|

|      |   |
|------|---|
| face | One of the following:<br><b>F1</b> Shot taken using Face-1 (fixed text)<br>Shot taken using Face-1 for Station setup (fixed text) |
| pt   | Point number  |
| ht   | Height of target  |
| sd   | Slope distance  |
| ha   | Horizontal angle  |
| va   | Vertical angle  |
| time | 24-hour time stamp  |

**Comment/note records**

|  |   |      |
|--|---|------|
|  | , | text |
|--|---|------|

|           |  |
|-----------|--|
| <b>CO</b> | Comment record identifier (fixed text) |
| text      | Comment text                           |

## SDR2x and SDR33 record formats

### Header record

| 00NM  | ver      | 0000  | datetime | ang | dist | press | temp | coor | 1 |
|-------|----------|---|----------|-----|------|-------|------|------|---|
| 1–4   | 00NM     | Header record identifier (fixed text)   |          |     |      |       |      |      |   |
| 5–20  | ver      | SDR download version. One of the following:<br><b>SDR20V03-05</b> SDR2x<br><b>SDR33V04-01</b> SDR33 |          |     |      |       |      |      |   |
| 21–24 | 0000     | Not used  |          |     |      |       |      |      |   |
| 25–40 | datetime | Download date and time (in hours and minutes)   |          |     |      |       |      |      |   |
| 41    | ang      | Angle units. One of the following:<br><b>1</b> Degrees<br><b>2</b> Gons<br><b>4</b> Mils            |          |     |      |       |      |      |   |
| 42    | dist     | Distance units. One of the following:<br><b>1</b> Meters<br><b>2</b> Feet                           |          |     |      |       |      |      |   |
| 43    | press    | Pressure units. One of the following:<br><b>1</b> mm Hg<br><b>2</b> In. Hg<br><b>3</b> hPa          |          |     |      |       |      |      |   |
| 44    | temp     | Temperature units. One of the following:<br><b>1</b> Celsius<br><b>2</b> Fahrenheit                 |          |     |      |       |      |      |   |
| 45    | coor     | Coordinate order. One of the following:<br><b>1</b> NEZ<br><b>2</b> ENZ                             |          |     |      |       |      |      |   |
| 46    | 1        | Not used  |          |     |      |       |      |      |   |

**Instrument record**

|              |       |       |       |       |          |         |              |              |              |
|--------------|-------|-------|-------|-------|----------|---------|--------------|--------------|--------------|
| <b>01KI1</b> | instr | serNo | Instr | serNo | <b>1</b> | zero VA | <b>0.000</b> | <b>0.000</b> | <b>0.000</b> |
|--------------|-------|-------|-------|-------|----------|---------|--------------|--------------|--------------|

|                 |              |   |
|-----------------|--------------|---|
| 1-5             | <b>01KI1</b> | Instrument record identifier (fixed text)   |
| 6-21,<br>28-43  | instr        | Instrument make and model   |
| 22-27,<br>44-49 | serNo        | Instrument serial number  |
| 50              | <b>1</b>     | Not used  |
| 51              | zero VA      | The reference point for vertical angles. One of the following:<br><b>1</b> Zenith<br><b>2</b> Horizon |
| 52-61,          | <b>0.000</b> | Not used  |
| 62-71,          | <b>0.000</b> | Not used  |
| 72-81,          | <b>0.000</b> | Not used  |

**Station details record**

|             |       |          |         |           |    |      |
|-------------|-------|----------|---------|-----------|----|------|
| <b>02KI</b> | stnpt | northing | easting | elevation | hi | desc |
|-------------|-------|----------|---------|-----------|----|------|

|                            |             |  |
|----------------------------|-------------|--|
| 1-4                        | <b>02KI</b> | Station details record identifier (fixed text) |
| 5-8 (2x),<br>5-20 (33)     | stnpt       | Station point number                           |
| 9-18 (2x),<br>21-36 (33)   | northing    | Northing of station                            |
| 19-28 (2x),<br>37-52 (33)  | easting     | Easting of station                             |
| 29-38 (2x),<br>53-68 (33)  | elevation   | Elevation of station                           |
| 39-48 (2x),<br>69-84 (33)  | hi          | Height of instrument                           |
| 49-64 (2x),<br>85-100 (33) | desc        | Station description                            |

### Target details record

|             |    |
|-------------|----|
| <b>03NM</b> | ht |
|-------------|----|

|                         |             |   |
|-------------------------|-------------|---|
| 1-4                     | <b>03NM</b> | Target details record identifier (fixed text) |
| 5-14 (2x),<br>5-20 (33) | ht          | Height of target                              |

### Backsight bearing details record

|      |       |      |        |    |
|------|-------|------|--------|----|
| 07KI | stnpt | bspt | bsazim | ha |
|------|-------|------|--------|----|

|                           |             |   |
|---------------------------|-------------|---|
| 1-4                       | <b>07KI</b> | Backsight bearing details record identifier<br>(fixed text) |
| 5-8 (2x),<br>5-20 (33)    | stnpt       | Station point number  |
| 9-12 (2x),<br>21-36 (33)  | bspt        | Backsight point number                                      |
| 13-22 (2x),<br>37-52 (33) | bsazim      | Backsight azimuth   |
| 23-32 (2x),<br>53-68 (33) | ha          | Horizontal angle  |

## Coordinates record

| 08KI | pt | northing | easting | elevation | desc |
|------|----|----------|---------|-----------|------|
|------|----|----------|---------|-----------|------|

|                           |             |  |
|---------------------------|-------------|--|
| 1-4                       | <b>08KI</b> | Coordinates record identifier (fixed text) |
| 5-8 (2x),<br>5-20 (33)    | pt          | Point number                               |
| 9-18 (2x),<br>21-36 (33)  | northing    | Northing of the coordinate                 |
| 19-28 (2x),<br>37-52 (33) | easting     | Easting of the coordinate                  |
| 29-38 (2x),<br>53-68 (33) | elevation   | Elevation of the coordinate                |
| 39-54 (2x),<br>69-84 (33) | desc        | Feature code                               |

### Observation record

| 09MC | stnpt | pt | sd | va | ha | desc |
|------|-------|----|----|----|----|------|
|------|-------|----|----|----|----|------|

|                            |             |  |  |  |  |  |
|----------------------------|-------------|--|--|--|--|--|
| 1–4                        | <b>09MC</b> | Observation record identifier (fixed text) |  |  |  |  |
| 5–8 (2x),<br>5–20 (33)     | stnpt       | Station point number                       |  |  |  |  |
| 9–12 (2x),<br>21–36 (33)   | pt          | Observed point number                      |  |  |  |  |
| 13–22 (2x),<br>37–52 (33)  | sd          | Slope distance                             |  |  |  |  |
| 23–32 (2x),<br>53–68 (33)  | va          | Vertical angle                             |  |  |  |  |
| 33–42 (2x),<br>69–84 (33)  | ha          | Horizontal angle                           |  |  |  |  |
| 43–58 (2x),<br>85–100 (33) | desc        | Feature code                               |  |  |  |  |

### Job identifier record

| 10NM | jobid | 1 | incZ | T&Pcorr | C&Rcorr | refcon | sealev |
|------|-------|---|------|---------|---------|--------|--------|
|------|-------|---|------|---------|---------|--------|--------|

|                        |             |                                       |  |  |  |  |  |
|------------------------|-------------|---------------------------------------|--|--|--|--|--|
| 1–4                    | <b>10NM</b> | Job identifier record ID (fixed text) |  |  |  |  |  |
| 5–8 (2x),<br>5–20 (33) | jobid       | Job name/title                        |  |  |  |  |  |

*Note – The following fields occur only in SDR33 format.*

|    |          |   |
|----|----------|---|
| 21 | <b>1</b> | Point ID length option  |
| 22 | incZ     | 2D or 3D coordinates. One of the following:<br><b>1</b> 2D<br><b>2</b> 3D                 |
| 23 | T&Pcorr  | Atmospheric correction. One of the following:<br><b>1</b> Off<br><b>2</b> On              |
| 24 | C&Rcorr  | Curvature and refraction correction. One of the following:<br><b>1</b> Off<br><b>2</b> On |
| 25 | refcon   | Refraction constant. One of the following:<br><b>1</b> 0.132<br><b>2</b> 0.200            |
| 26 | sealev   | Sea level correction. One of the following:<br><b>1</b> Off<br><b>2</b> On                |

**Note record**

|             |      |
|-------------|------|
| <b>13NM</b> | note |
|-------------|------|

|      |             |                             |
|------|-------------|-----------------------------|
| 1-4  | <b>13NM</b> | Note record ID (fixed text) |
| 5-64 | note        | Note text                   |

## Data examples

### Nikon raw data format

CO,Nikon RAW data format V2.00  
CO,EXAMPLE5  
CO,Description: SAMPLE DATA OF DOWNLOAD  
CO,Client:  
CO,Comments:  
CO,Downloaded 22-JUL-2008 18:56:10  
CO,Software: Pre-installed version: 1.0.0.1  
CO,Instrument: Focus 6 2"  
CO,Dist Units: Metres  
CO,Angle Units: DDDMMSS  
CO,Zero azimuth: North  
CO,Zero VA: Zenith  
CO,Coord Order: NEZ  
CO,HA Raw data: Azimuth  
CO,Tilt Correction: VA:ON HA:ON  
CO, EXAMPLE5 <JOB> Created 22-JUL-2008 07:09:21  
CO,S/N:213705  
MP,1,,100.000,200.000,10.000,  
CO,Temp:20C Press:760mmHg Prism:0 22-JUL-2008 07:11:34  
ST,1,,,,1.400,55.4500,55.4500  
F1,,,,0.0000,90.0000,8:27:58  
SS,3,1.200,330.706,326.027,20.320,07:13:46,SIGN  
SS,4,1.250,379.193,300.847,29.084,07:14:24,TREE  
SS,5,1.218,363.344,328.032,30.105,07:14:57,TREE R  
SO,1003,,1.240,331.220,326.783,19.998,07:18:17,

### Nikon coordinate data format

1,100.0000,200.0000,10.0000,  
2,200.0000,300.0000,20.0000,  
3,116.9239,216.9140,11.8425,TRAIN PLATFORM  
4,126.6967,206.2596,11.2539,RAMP  
11,100.0045,199.9958,10.0000,  
13,116.9203,216.9113,11.7157,  
14,126.6955,206.2579,10.9908,  
21,100.0103,199.9958,10.0000,  
31,100.0013,200.0005,10.0000,  
41,100.0224,200.0331,9.9000,  
43,116.9263,216.9165,11.8016,CURB  
44,126.7042,206.2871,10.8193,DITCH  
45,116.9266,216.9160,11.8028,  
46,126.7046,206.2845,10.8213,CP POINT



**SDR2x raw data format**

```

00NMSDR20V03-05 000023-Jul-2008 18:39:111211
10NMEXAMPLE6
01KI1 Spectra Precision Focus 6 2" 000000 Spectra Precision Focus 6 2" 00000012 0.000
0.000 0.000
13NMDownloaded 23-Jul-2008 18:39:22
13NMSftware: Pre-install version: 1.0.0.1
13NMInstrument: Spectra Precision Focus 6 2"
13NMDist Units: Metres
13NMAngle Units: Degrees
13NMZero azimuth: North
13NMZero VA: Horizon
13NMCoord Order: NEZ
13NMClient:
13NMDescription:
13NMTilt Correction: VA:ON HA:ON
13NM EXAMPLE6 <JOB> Created 23-Jul-2008 07:09:21
08KI0001100.000 200.000 10.000
08KI0002200.000 300.000 20.000
02KI0001100.000 200.000 10.000 0.100
07KI0001000245.0000 0.0000
13F100000002<null> <null> 0.0000
13F200000002<null> <null> 179.9639
13NMBS Check HA:359.3525 Reset to HA: 0.0000 07:21:41
13F10000000323.990 4.1694 0.0000
13F20000000323.990 175.8403 180.0028
03NM0.000
13F10001000323.990 4.1653 359.9833 MAIN PLATFORM
13F10001000427.445 2.4097 328.1958 RAMP
13NMStart of 2-Pt Resection
13F10000000427.445 2.4097 0.0000
13F10000000323.991 4.1542 31.8042
13F10000000427.430 1.8583 121.4306
13F10000000323.976 3.8625 153.2306
08KI0011100.005 199.996 10.000
02KI0011100.005 199.996 10.000 0.100
07KI0011000344.9980 0.0000

```

**SDR2x coordinate data format**

```

00NMSDR20V03-05 000023-Jul-2008 18:40:111211
10NMEXAMPLE6
01KI1 Nikon Focus 6 2" 000000 Nikon Focus 6 2" 00000012 0.000 0.000 0.000
13NM 080926-2 <JOB> Downloaded 08-Oct-2008 18:40:06
13NMSftware: Pre-install version: 1.0.0.1
13NMInstrument: Nikon Focus 6 2"
13NMDist Units: Metres
13NMAngle Units: Degrees
13NMZero azimuth: North
13NMZero VA: Horizon

```

13NMProjection correction: OFF  
 13NMC&R correction: OFF  
 13NMSea level correction: OFF  
 13NMCoord Order: NEZ  
 13NMClient:  
 13NMDescription:  
 13NMTilt Correction: VA:OFF HA:OFF  
 13NM EXAMPLE6 <JOB> Created 23-Jul-2008 07:09:21  
 13NMPrism constant: 0  
 08KI0001100.000 200.000 10.000  
 08KI0002200.000 300.000 20.000  
 13NMBacksight Check to Pt:2 HA:359.3525 07:21:39  
 13NMBacksight Pt:2 Reset to HA: 0.0000 07:21:41  
 08KI0003116.924 216.914 11.843 MAIN PLTFORM  
 08KI0004126.697 206.260 11.254 RAMP  
 13NMStart of 2-Pt Resection  
 08KI0011100.005 199.996 10.000

# Error Messages

## In this chapter:

- [Cogo](#)
- [Communications](#)
- [Data](#)
- [Job Manager](#)
- [Programs](#)
- [Recording Data](#)
- [Searching](#)
- [Settings](#)
- [Stakeout](#)
- [Station Setup](#)
- [System Error](#)

The chapter describes the error messages that may appear when you use the Focus 6 2" total station.

## Cogo

### NO Result

The system was unable to calculate an area because points were not entered in the correct order.

Press any key to return to the Cogo menu. Then enter the points in the correct order.

### Same Coordinate

The point or coordinate that you entered is identical to the previous input point.

Press any key to return to the point input screen. Then use a different point.

### XY-coordinate is required

The input point does not have XY (NE) coordinates.

Press any key to return to the point input screen. Then enter a point that has X and Y coordinates.

## Communications

If an error is detected during uploading of data, the Focus 6 2" instrument aborts the upload process and displays one of the following messages.

### Check Data

There are errors in the uploaded data. The uploaded data contains errors, such as an alphabetic character in a coordinate field.

Press any key. Then check the specified line in the data.

### DUPLICATE PT

The uploaded data contains a duplicate PT.

Press any key. Then check the specified point in the data.



**Tip** – If the existing point is a UP, CC, or MP record, and is not referred by ST or BS, then it will be overwritten by the uploaded record. No error message appears.

### PT MAX20 chars

The uploaded data contains a PT with a name or number that is longer than 20 digits.

Press any key. Then check the specified line in the data.

### XYZ OVERRANGE

The uploaded data contains a coordinate that is longer than 13 digits.

Press any key. Then check the specified line in the data.

Data

Can't Edit Current ST  
You have tried to edit the current ST.

***Note** – You cannot edit the current ST. However, old ST records can be edited. No recalculation can be performed on the instrument.*

Press any key to return to the code/layer name input screen.

Can't Edit ST/BS refer to this PT  
You have tried to edit a coordinate that the current ST or BS refers to. You cannot change a coordinate if the current ST or BS refers to it.

Press any key to return to the Data view screen.

Can't Edit XYZ from measurement  
You have tried to change the coordinates of an SO, SS, or CP record. You cannot change the coordinates of an SO, SS, or CP record.

Press any key to return to the previous screen.

DELETE Stn-XYZ  
You have tried to delete a coordinate record that the current ST or BS refers to. You must confirm that you want to delete a coordinate record that the current ST or BS refers to.

| To ...   | Press ...                              |
|--|--|
| delete XYZ   | the <b>DEL</b> softkey                 |
| return to the previous screen without deleting XYZ | <b>ESC</b> or the <b>Abort</b> softkey |

## Job Manager

### Cannot Assign

You have tried to set the current job as the control file.

Press any key to return to the previous screen. Then select a different job.

### Can't Create

There is no space available to create a job or record a point.

Press any key to return to the Job Manager. Then use the **DEL** softkey to delete old jobs.

### Existing Job

You have entered an existing job name for a new job.

Press any key and then change the name for the new job.

### MAX 32Jobs

You are trying to create a new job when the maximum number of jobs (32) is already stored.

Press any key to return to the Job Manager. Then use the **DEL** softkey to delete old jobs.

## Programs

### NO Stn Setup

You did not perform a station setup or BS check before entering the Programs function.

| To ...                   | Press ...                    |
|--------------------------|------------------------------|
| go to the Stn Setup menu | <b>2</b> or select Stn Setup |
| return to the BMS        | <b>ESC</b>                   |
| go to the Programs menu  | <b>1</b> or select Continue  |



**Tip** – Selecting **Continue** does **not** resume the last ST record. You should only use the **Continue** option if you are sure that the previous ST coordinates and the current HA orientation are correct. Otherwise, records in the Programs function may not be correct.

### XY&Z coordinate are required

Three-dimensional coordinates are required in S-Plane function.

Press any key to return to the point input screen. Then enter a three-dimensional point.

## Recording Data

### DATA FULL

The data storage is full.

Press any key to return to the Basic Measurement Screen (BMS). Then:

| To ...                  | Go to ...   |
|-------------------------|-------------|
| delete unnecessary data | MENU / Data |
| delete jobs             | MENU / Job  |

### DUPLICATE PT

The input PT you are trying to record already exists in the current job. An existing coordinate record cannot be overwritten by measured data.

Press any key to return to the point input screen. Change PT.

### Duplicate PT

The input PT you are trying to record already exists in the current job as an SS, SO, or CP record. An existing SS, SO, or CP record can be overwritten by measured data.

| To ...                              | Press ...                                |
|-------------------------------------|--|
| return to the PT input screen       | <b>[ESC]</b> or the <b>Abort</b> softkey |
| record RAW data and update XYZ data | the <b>XYZ</b> softkey                   |
| record RAW data only                | the <b>RAW</b> softkey                   |

### No Open Job

No job is open.

| To ...  | Press ...                              |
|---|--|
| open the job list, if there are existing jobs | <b>[1]</b> or select <b>Select job</b> |
| create a new job                              | <b>[2]</b> or select <b>Create job</b> |
| return to the previous screen                 | <b>[ESC]</b>                           |

### NO Stn Setup

There is no station record in the current job, or a station setup or BS check has not been done since the program was rebooted.

| To ...                        | Press ...   |
|-------------------------------|---|
| continue recording            | <b>[1]</b> or select <b>Continue</b> . If there is already an ST record in the job, the message <b>CO, Use current orientation</b> appears. |
| go to the Stn Setup menu      | <b>[2]</b> or select <b>STN Setup</b>   |
| return to the previous screen | <b>[ESC]</b>  |

**OVER RANGE**

You are trying to record a coordinate with more than 13 digits

Press any key to return to the previous screen. Then check the current ST coordinate.

## Searching

**PT Not Found**

There is no point that matches the criteria you entered.

Press any key to return to the point input screen.

This message may appear in any function where the PT/CD is input, such as Station Setup or Stakeout.

## Settings

**Job Settings will be changed**

You have changed one or more of the following job settings:

- VA zero or HA in the Angle screen (see [Angle, page 125](#))
- Scale, T-P, Sea Lvl, or C&R in the Distance screen (see [Distance, page 125](#))
- Coord or Az Zero in the Coordinates screen (see [Coordinate, page 127](#))
- Angle, Dist, Temp, or Press in the Unit screen (see [Unit, page 128](#))

| To ...   | Press ...   |
|--|---|
| discard the changes to the job settings                        | <b>[ESC]</b> or the <b>Abort</b> softkey. The current job remains open. |
| close the current job and save the changes to the job settings | <b>[ENT]</b> or the <b>OK</b> softkey                                   |

**Note** – To record a point using the new settings, create a new job using the new settings.

## Stakeout

**Input Error**

The point name style used in the Fr field is not the same as the style used in the To field. For example, the Fr field style is 1, and the To field style is A200.

Press any key to return to the Fr/To input screen. Then re-enter the point name, using the same naming style in both fields.



**NO Stn Setup**

You did not perform a station setup or BS check before entering the Stakeout function.

| To...  | Press ...               |
|--|-------------------------|
| go to the Stn Setup menu                     | [2] or select Stn Setup |
| return to the Basic Measurement Screen (BMS) | [ESC]                   |
| go to the Stakeout menu                      | [1] or select Continue  |



**Tip** – Selecting Continue does **not** resume the last ST record. You should only use the Continue option if you are sure that the previous ST coordinates and the current HA orientation are correct. Otherwise, records in the Stakeout function may not be correct.

## Station Setup

**Calc ST Failed Need additional PT**

Calculating ST failed in resection. This message may appear after you have deleted a point the View shots screen.

Press any key to return to the PT input screen. Take another shot to calculate the ST coordinate.

**Same Coordinate**

The input PT or coordinate is identical to the current station in STN/1:Known, or the same coordinate or point name/number is found in Resection.

Press any key to return to the PT input screen. Then use a different PT.

**Space LOW**

There is not enough space to record a station when you start any of the Station Setup functions.

| To ...            | Press ...  |
|-------------------|--|
| return to the BMS | press [ESC] or the Abort softkey. Use the DEL softkey in Job Manager to delete old jobs. |
| continue          | press [ENT] or the OK softkey. You may not be able to record the whole process.          |

**XY-coordinate is required**

The input point for ST/BS does not have N/E coordinates.

Press any key to return to the PT input screen. Then use a PT that has N/E coordinates.

**Z-coordinate is required**

The input point for Benchmark does not have a Z coordinate.

Press any key to return to the PT input screen. Then use a PT that has a Z coordinate.

## System Error

=SYSTEM ERROR=

The system has detected an internal error that is related to the lower-level system.

Press any key to turn the instrument off. The system will reboot when this error is reported. If you still have more points to shoot in the site, turn the instrument on and repeat the open a job and station setup procedures.

Data stored before this error will be kept safely in the Job file.

If the error appears frequently, please contact your dealer or Trimble Support and report the message that appears below the =SYSTEM ERROR= line.

SPECTRA PRECISION  
10355 Westmoor Drive, Suite #100  
Westminster, CO 80021  
USA  
+1-720-587-4700 Phone  
888-477-7516 (Toll Free in USA)  
[www.spectraprecision.com](http://www.spectraprecision.com)

